3M

Scotchlok[™] Shield Bond Connectors


4462 4462-FN 4462-SN 4462-SNA

May 2008 78-8135-4337-4-B

1.0 General

The 3M[™] Scotchlok[™] Shield Bond Connectors 4462, 4462-FN, 4462-SN and 4462-SNA are designed to make a stable and low resistance electrical connection between the shield of a communications cable and a conductor such as a strap, bar, wire or braid. The 4462 connector includes standard Whiz-Lock® nuts. The 4462-FN connector includes flanged nuts. The 4462-SN connector has a longer stud and the nuts have been deepened. The 4462-SNA connector has the longer stud, deepened nuts and an insulating shoe.

2.0 Components

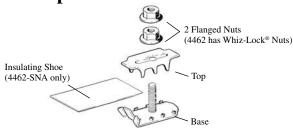


Note: Visually inspect all components. If any component is missing or appears damaged, do not install and call 3M customer service at 1-800-426-8688 for a replacement product.

3.0 Tools Required


3/8" Terminal Wrench Tabbing shears or sheath knife

4.0 Cable Preparation


Note: For both single and double sheath cables, cut shield flush with sheath.

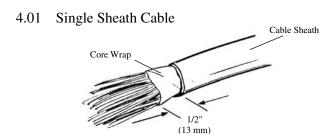


4.02 Double Sheath Cable

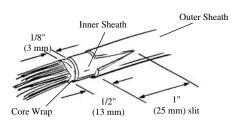

 
Note: On cables less than 3/4" (19 mm) in diameter, cut a 1 1/2" (38 mm) slit in the sheath opposite connector location. Then complete procedure.



 
4.03 When using the 4462-SNA connector on single sheath cable, insert the insulating shoe between the core wrap and shield.



 4.04 Make a 1" (25 mm) slit in the outer sheath and shield. Lift corners for base insertion.



 5.03 Place connector top over stud and tighten firmly with securing nut. Torque nut to 40-50 in-lbs (5.2±0.6 kgm) with company approved tool.




Tail of base must contact connector top.

torque requirements specified.

Use a company approved tool to achieve the

5.0 Installation

 5.01 Insert connector base between shield and insulating shoe or core wrap; inner sheath for double sheath cable, until stops meet outer sheath.




Torque nut to 40-50 in-ll company approved tool.


Note:

Note:

5.02 Place terminal wrench over stud and push down to bend corners and pull slit together.

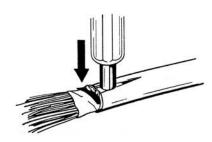

 5.04 Place bond conductor (strap, bar, wire, or braid) over stud and secure in place with nut supplied. Torque nut to 40-50 in-lbs (5.2±0.6 kgm) with company approved tool.



3M and Scotchlok are trademarks of 3M Company. Whiz-Lock is a registered trademark of Mac-Lean Fogg Company.

Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

Warranty; Limited Remedy; Limited Liability.

This product will be free from defects in material and manufacture for a period of one (1) year from the time of purchase. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.**



Communication Markets Division 3M Telecommunications 6801 River Place Blvd

6801 River Place Blvd. Austin, TX 78726-9000 1-800-426-8688 www.3MTelecommunications.com

Please Recycle. Printed in USA.
© 3M 2008. All Rights Reserved.
78-8135-4337-4-B