


Assembly Instructions-C13 Triax BNC, TNC Threaded, 7/16-28

Note: For alternate Assembly instructions see sheet page 288

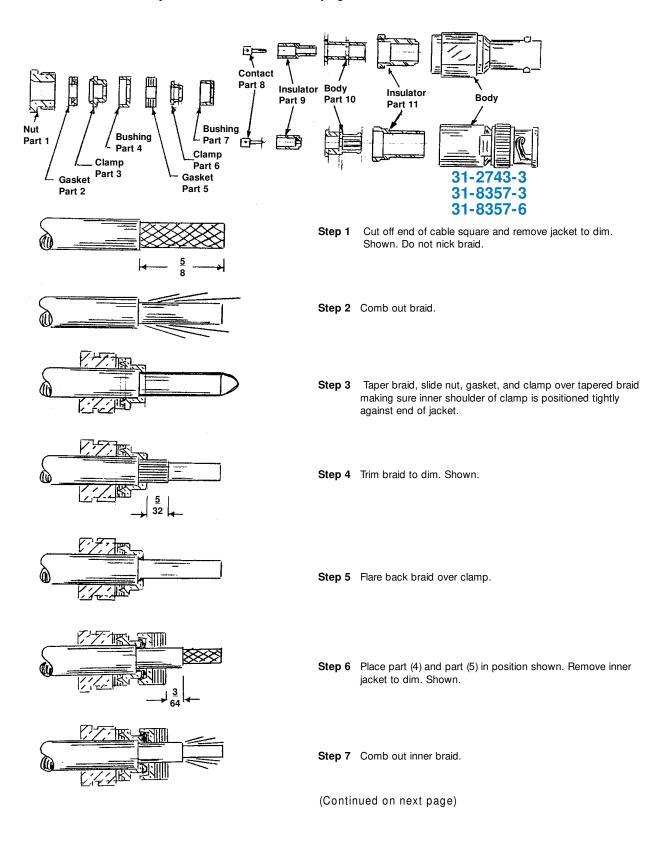

Assembly Instructions-C13 Triax BNC, TNC Threaded, 7/16-28 (continued)

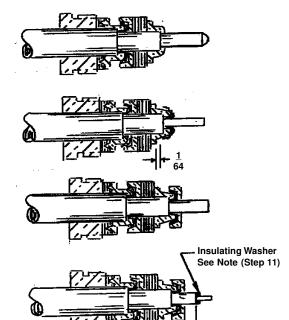

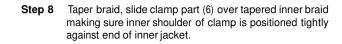


Fold back inner braid over clamp and trim inner braid to Step 9 dim. shown.

Step 10 Place small bushing part (7) in position shown. Push firmly against braid.



Note: For assemblies 00-8354-4, 00-8354-5, 00-8470-2 and 00-8470-3 only, trim to 1/16 in lieu of 5/64, then assemble insulating washer.

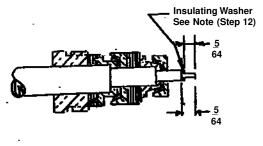


Step 12 Trim inner conductor to dim. shown.

Note: For assemblies 00-8354-4, 00-8354-5, 00-8470-2 and 00-8470-3 only, trim inner conductor to 5/64 with insulating washer assembled.



Step 13 Solder contact on inner conductor. Remove excess solder. Do not overheat dielectric as it will distort and will not enter insulator properly.

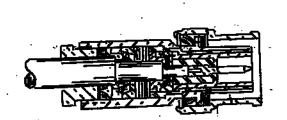

Step 14 Insert completed cable hardware assy. into either Jack or Plug body. Make sure part (2) is properly seated on sharp edge of part (3). After nut is started, tighten with torque wrench to 25 in. lbs.

Note: Sharp edge of clamp part (3) must split gasket part (2).