Field calibration for thermometers 317c 09.10

Field calibration for thermometers TPI 317c FIELD CALIBRATION

Test the TPI advantage



Acessories

Adapters Cables/Connectors Oscilloscope Probes Test Leads

Clamp-on meters (Current)

Combustion Efficiency Analyzers

Gas Detection
Carbon Monoxide (CO)

Combustibles
Refrigeration
Indoor Air Quality

(IAQ)
Manometers

(Pressure)
Multimeters
(DMMs)

Oscilloscopes (Hand held)

Specialty TestersInsulation
Multifunction
Photo-tachometer

Temperature

Contact Non-Contact (IR) Pocket Digital

Temperature Probes

J-Type K-Type T-Type Thermistor

Test Leads & Accessories

Fused Modular Push-on Screw-on

TPI

Headquarters: 9615 SW Allen Blvd. Beaverton, OR 97005 USA 503-520-9197 Fax: 503-520-1225

www.tpithevalueleader.com

Step-by-Step Procedures

to have effect.

- 1. Fill a plastic or metal container with crushed ice and add clean water to a depth of at least 4 inches. Stir the ice and water for 2 to 3 minutes prior to performing calibration to ensure the water is completely chilled. Make certain there is plenty of ice in the mixture and always use clean water. Distilled water works well. The temperature of an ice bath is approximately 32°F (0°C).
- 2. Insert the stainless steel shaft of the 317c into the ice bath making sure at least one inch of the tip is immersed. Allow the reading on the thermometer to stabilize.

 Note: The temperature reading must be within 23°F to 41°F (-5°C to 5°C) for calibration
- 3. Press and hold the **D-H/CAL** button for approximately 8 seconds until "CAL" is displayed. "CAL" will display for approximately 2 seconds and then the 317c will return to normal operation. Calibration is complete.

Note: If the temperature reading was not within 23°F to 41°F (-5°C to 5°C) when step 3 was performed no change in calibration occurred. The 317c was designed with this feature to prevent improper calibration.

