


0.64mm Connector System

Contact Assembly Instructions

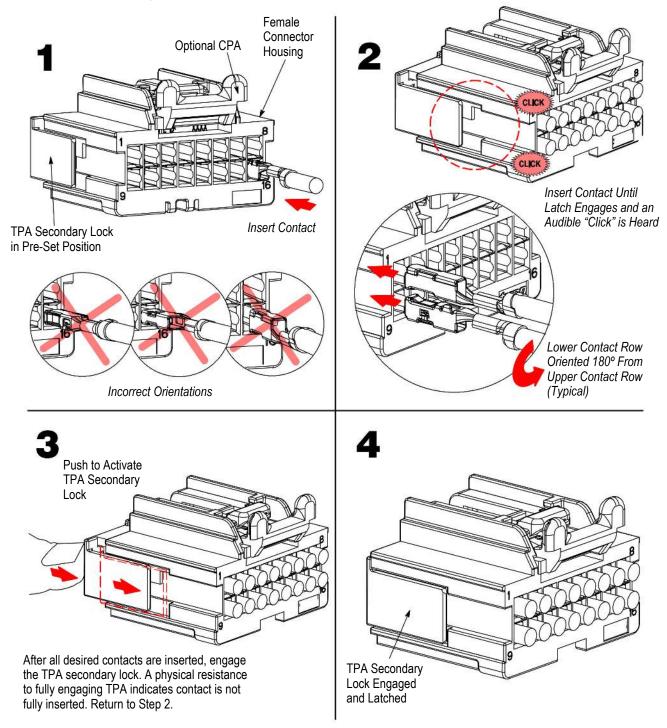




This document is representative of all connector positions in this product family.

©2011 Tyco Electronics Corporation, Berwyn, PA All Rights Reserved TE logo and Tyco Electronics are trademarks. TOOLING ASSISTANCE CENTER 1-800-722-1111 PRODUCT INFORMATION 1-800-522-6752

TE logo and Tyco Electronics are trademarks. *Trademark. Other products, logos, and company names might be trademarks of their respective owners. 1 of 4

Contact Disassembly Instructions (Use Extraction Tool 3-1579007-6)

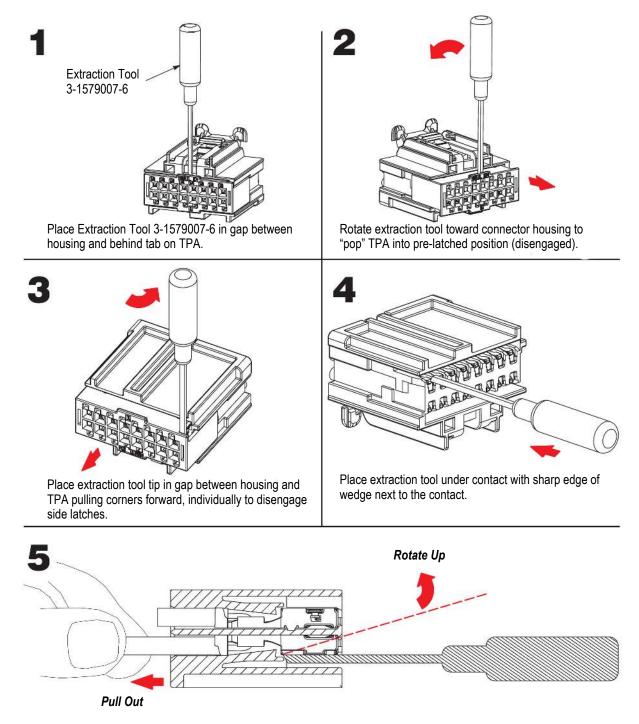


Gently press tool toward the contact latching beam while simultaneously pulling on the wire.




DO NOT re-use damaged or worn contacts. Instead, replace them with new contacts and discard the old ones.


Mating Instructions -- with CPA

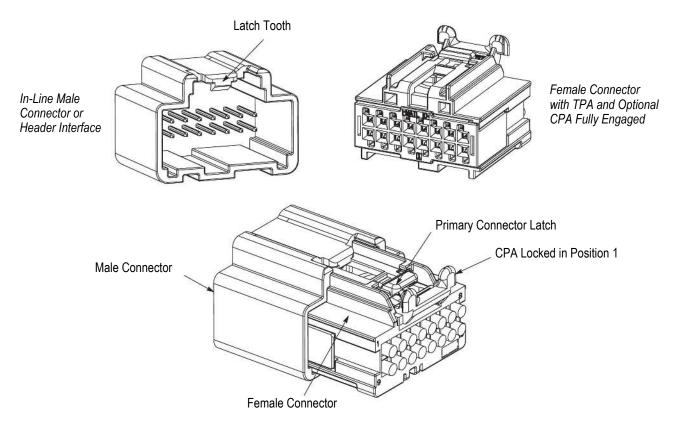

Optional CPA is locked in Position 1 for shipping and handling before engaging the primary connector latch. CPA can NOT move forward or backward until the connectors are mated and the primary latch "clicks" and engages the interface latch tooth.

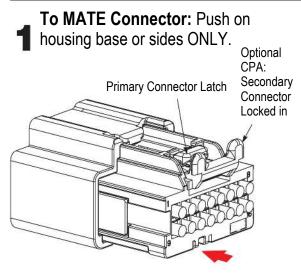


Do not push CPA forward until primary connector latch "clicks" and engages the interface latch tooth. Repeat. 2 To LOCK CPA After Connector Mate : Push CPA forward until an audible "click" is heard.

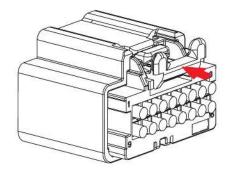


Finally, push the CPA forward to engage secondary lock and ensure proper CPA locking.

Unmating Instructions -- with CPA

To UNMATE CPA: Lightly PULL CPA back from Position 1 (pre-installed position) until audible "click" is heard.

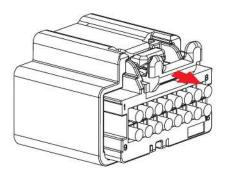

2 To UNMATE Connector: With CPA in Position 1, DEPRESS Primary Connector Latch, then simultaneously pull connector/wires while gripping the housing with thumb, index finger, and palm (wire bundle).

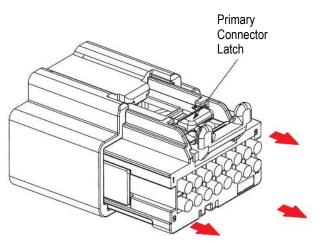

REVISION SUMMARY

Since the previous release of these instructions, the TE logo was applied.