

Tyco Electronics Corporation 300 Constitution Drive Menlo Park, CA 94025 U.S.A. **Raychem Devices**

No: **RPIP-500-03**

Rev: F

Date: August 7, 2007

Page 1 of 6

Coaxial SolderSleeve Termination with Pre-Installed Wires or PCB Termination Body, B-044, B-043, B-041, B-040, B-020, B-021, B-046, D-148 Series

	Typical	Pre-Installed		
Cable	RG	Stranded	Solid	PCB Terminator Body
Type	Cable #	Wires	Wires	·
				B-046-10-N / D-148-0202
		B-044-22-N	B-043-24-N	B-046-11-N / D-148-0204
-A-	RG 178	B-044-24-N	B-043-26-N	B-046-12-N / D-148-0203
	RG 404	B-044-26-N	B-043-28-N	B-046-13-N / D-148-0205
		B-044-30-N	B-043-30-N	B-046-14-N / D-148-0201
				B-046-78-N
		B-040-20-N		B-046-15-N / D-148-0206
		B-040-22-N	B-041-24-N	B-046-16-N / D-148-0208
-B-	RG 179	B-040-24-N	B-041-26-N	B-046-18-N / D-148-0210
	RG 316	B-040-26-N	B-041-28-N	B-046-66-N / D-148-0207
		B-040-28-N	B-041-30-N	B-046-68-N / D-148-0209
		B-040-30-N		
	RG 180	B-020-20-N		
-C-	RG 302	B-020-22-N	B-021-26-N	n/a
	RG 303	B-020-24-N		
		B-020-26-N		
-D-	n/a	n/a	n/a	B-046-10
				B-046-14

Sections

- 1. Application Equipment
- 2. Cable Preparation
- 3. Assembly
- 4. Termination Procedure
- 5. Inspection
- 6. Repair
- 7. Connection to PCB



Raychem Devices No: **RPIP-500-03** Tyco Electronics Corporation Rev: F 300 Constitution Drive Menlo Park, CA 94025 U.S.A.

Date: August 7, 2007

Page 2 of 6

1. **Application Equipment:**


The use of Tyco Electronics holding fixture AD-1319-9 is recommended to facilitate the 1.1 installation.

1.2 Heating tools:

Recommended Tyco Electronics hot air guns and adequate reflectors.

Heating tool	Reflector
AA-400 Superheater	AA-400-94
CV-1981	PR-25D
HL 1910E: 6 on dial (1)	HL1802E-ADAPT and
HL 2010E: 700°F on LCD (1)	PR25D


2. **Cable Preparation:**

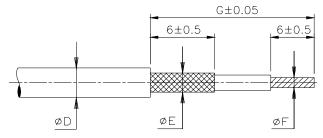

Cable	Ø	D	Ø.	E	øF	G±0.5
Type	min	MAX	min	MAX	min	
A	1.7	3.4	1.3	2.3	0.3	16
В	1.7	4.4	1.5	2.8	0.3	16
С	2.4	6.3	2.4	4.6	0.3	19
D	1.7	2.2	1.3	1.7	0.3	16

For best results, it is recommended to pre-tin the central conductor if the diameter øF >0.5mm.

Note: If the diameter over the braid (øE) is smaller than the minimum mentioned in the table above, foldback the braid over the cable jacket as shown below.

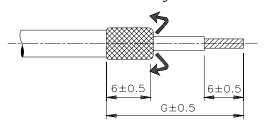




Tyco Electronics Corporation	Raychem Devices	No: RPIP-500-03
300 Constitution Drive		Rev: F
Menlo Park, CA 94025 U.S.A.		Date: August 7, 2007
		Page 3 of 6


3. Assembly:

Insert the prepared coaxial cable into the open end of the coaxial SolderSleeve termination so that the ground wire/pin is almost touching the cable jacket. The solder preforms are thus positioned in the middle of the braid and in the middle of the stripped part of the center conductor.

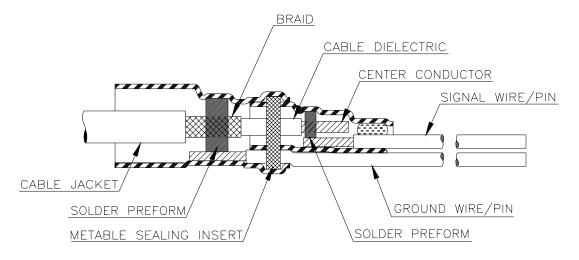

4. Termination Procedure:

- 4.1 Select the heating tool and fit it with the appropriate reflector. Allow the hot air generator to warm up and reach operating temperature.
- 4.2 Place the coaxial SolderSleeve termination assembly in the front of the heating tool.

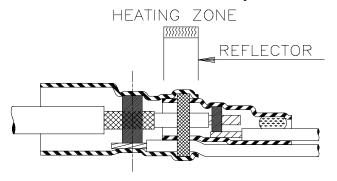

Position the center sealing insert of the SolderSleeve termination assembly whithin the heating tool reflector and apply heat until soldersleeve tubing collapses onto cable dielectric. Move assembly whithin the reflector to the large solder preform and apply heat until it melts and flows forming a solder fillet between the cable shield and the ground wire and then shrink the tubing onto the cable jacket.




Tyco Electronics Corporation 300 Constitution Drive Menlo Park, CA 94025 U.S.A. **Raychem Devices**

No: **RPIP-500-03**


Rev: F

Date: August 7, 2007


Page 4 of 6




4.3 Move the reflector to center the small solder preform in the heating zone

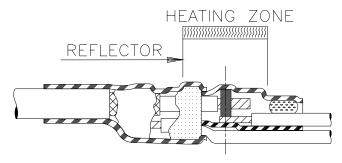

- Apply heat to the small preform until it melts and flows forming a solder fillet between the two conductors.
- 4.4 Hold the assembly steady while cooling down (the figures below show a typical completed termination).

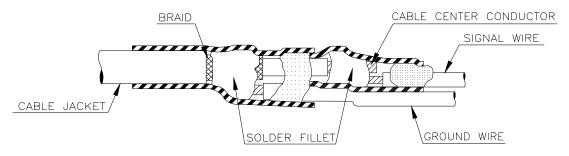

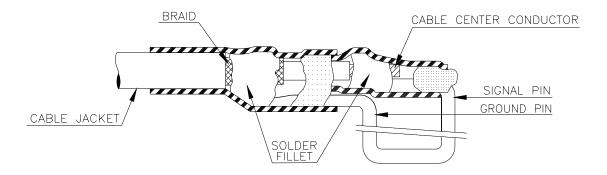



Tyco Electronics Corporation	Raychem Devices	No: RPIP-500-03
300 Constitution Drive		Rev: F
Menlo Park, CA 94025 U.S.A.		Date: August 7, 2007
		Page 5 of 6

5. Inspection:

- 5.1 Inspection for proper assembly.
- 5.1.1 There must be no solder bridge between the ground wire/pin and the center conductor.
- 5.1.2 The signal wire/pin must not overlap the cable dielectric.
- 5.1.3 The ground wire/pin must not overlap the cable jacket.
- 5.1.4 The insulation sleeve must overlap the cable jacket so that there is no exposed braid.
- 5.2 Inspection for proper heating.
- 5.2.1 The two solder preforms must be completely melted and have flowed along the conductors.


A solder fillet must be visible between the ground wire/pin and the braid, and between the signal wire/pin and the center conductor.

- Visible remnants of the original shape of the solder preforms indicate an underheated termination.
- Lack of solder fillets indicates an overheated termination.
- 5.2.2. The sleeve must be fully shrunk onto the cable jacket.
 - An incompletely shrunk sleeve indicates an underheated termination.
 - A discolored dark brown sleeve indicates an overheated termination.
- 5.3 Inspection for damage.
- 5.3.1 The sleeve must not be cut or split.
- 5.3.2 There must be no braid or center conductor strands poking through the sleeve.
- 5.3.3 The cable jacket and the coaxial SolderSleeve termination may not exhibit signs of mechanical damage or overheating such as cuts, melting, charring.
- **6. Repair**: (if necessary)
- 6.1 Repair of underheated termination.
- 6.1.1 Reheat underheated termination to obtain proper solder flow (see section 4).
- Repair of overheated or damaged termination.
- 6.2.1 If the coaxial cable jacket is not damaged, remove the coaxial SolderSleeve termination as follows:
- 6.2.1.1 Score the full length of the sleeve with a sharp blade.
 - Be careful not to cut the cable jacket or the dielectric.
- 6.2.1.2 By using the same heating tool as for installation, heat the coaxial Soldersleeve termination to soften it, and strip it off with pliers or twizzers.
- 6.2.1.3 Install a new coaxial SolderSleeve termination in accordance with the procedure (see section 3).



Tyco Electronics Corporation	Raychem Devices	No: RPIP-500-03
300 Constitution Drive		Rev: F
Menlo Park, CA 94025 U.S.A.		Date: August 7, 2007
		Page 6 of 6

- 6.2.2 If the coaxial cable jacket or the dielectric is damaged, cut off the assembly, re-strip and install a new coaxial SolderSleeve termination (see section 2).
- 7. Connection to PCB: (For PINPAK device only)
 Trim the pins with a side cutter.
 Insert the pins into the PCB and proceed with other necessary procedures.



DISCLAIMER

_

All of the above information, including illustrations, is believed to be reliable. Users, however, should independently evaluate the suitability of each product for their application. Tyco Electronics makes no warranties as to the accuracy or completeness of the information, and disclaims any liability regarding its use. Tyco Electronics' only obligations are those in the Standard Terms and Conditions of Sale for this product, and in no case will Tyco Electronics be liable for any incidental, indirect, or consequential damages arising from the sale, resale, use or misuse of the product.

These values are for reference only and may change based on other variables (i.e. reflector type, sleeve's relative distance to the reflector, etc.)