
# 1000 WickGun™ Desoldering Braid Dispenser

### Loading the WickGun™


Important - With WickGun™ pointing left insert cassette with label facing up so wick will feed from the right (counter clockwise).

- 1. Grasp cassette and pull out foam plug, then pull out approximately 2 1/4" (57 mm) of wick.
- Insert wick into guide slot. Rotate drive knob in feed direction while seating cassette. Ensure wick is not pinched between cassette and WickGun™ and that cassette alignment tabs are seated in the alignment slots in the gun.
- If wick fails to feed, disengage cassette, grasp wick and pull from wick guide slot, do not allow cassette to unwind. Eliminate any kinks and/or frayed wick. Repeat steps 1 – 2.

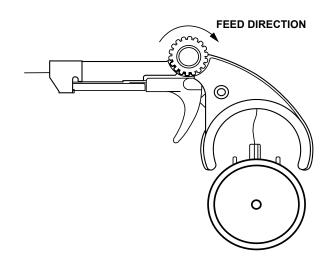

#### **Operating Instructions**


- Hold with thumb on drive knob and index finger over the trigger.
- Rotate drive knob in feed direction exposing 3/4" to 1" (19 to 25 mm) of wick. Do not press on the trigger while dispensing wick.
- 3. Perform desoldering operation.
- Squeeze trigger to cut off filled wick.
   Caution: to prevent jamming, do not retract wick more than 1/2" (12 mm) past cutting blades and never retract solder saturated wick past cutting blades.

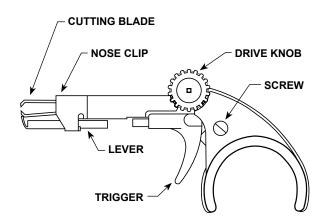

### Replacing the Cutter

- 1. To remove cutter:
  - A. Remove lever by pressing up and sliding forward
  - B. Slide nose clip up, then out to disengage.
  - C. Slide cutter out through front.
- To install new Cutter:
  - A. Slide cutter inserting feed tube through slot in back.
  - B. Slide lever into place. Nose clip tabs must be seated in lever locator holes. Compress with appropriate object pushed through small hole in lever to facilitate this step.
- To maintain good cutting action periodically remove blades and clean with flux solvent.

AVOID contact between solvent and plastic parts.

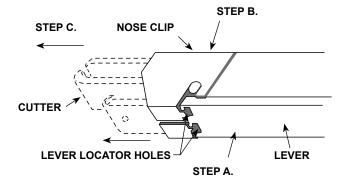

11520 K-Tel Drive, Minnetonka, Minnesota 55343

Phone: 909-627-2453 | Email: Service@EasyBraidco.com | Web: EasyBraidco.com

# **1000 WickGun™ Desoldering Braid Dispenser**

### **Replacement Cassettes**

PART NO.	DESCRIPTION
W4015-1	Cassette, Replacement, #1 Quick Braid Rosin Wick
W4015-1LF	Cassette, Replacement, #1 Wick, Lead-Free
W4015-1NC	Cassette, Replacement, #1 One Step No-Clean Wick
W4015-1NF	Cassette, Replacement, #1 Wick, Sea Braid Unfluxed
<u>W4015-2</u>	Cassette, Replacement, #2 Quick Braid Rosin Wick
W4015-2LF	Cassette, Replacement, #2 Wick, Lead-Free
W4015-2NC	Cassette, Replacement, #2 One Step No-Clean Wick
W4015-2NF	Cassette, Replacement, #2 Wick, Sea Braid Unfluxed
<u>W4015-3</u>	Cassette, Replacement, #3 Quick Braid Rosin Wick
W4015-3LF	Cassette, Replacement, #3 Wick, Lead-Free
W4015-3NC	Cassette, Replacement, #3 One Step No-Clean Wick
W4015-3NF	Cassette, Replacement, #3 Wick, Sea Braid Unfluxed
<u>W4015-4</u>	Cassette, Replacement, #4 Quick Braid Rosin Wick
W4015-4LF	Cassette, Replacement, #4 Wick, Lead-Free
W4015-4NC	Cassette, Replacement, #4 One Step No-Clean Wick
W4015-4NF	Cassette, Replacement, #4 Wick, Sea Braid Unfluxed
<u>W4015-5</u>	Cassette, Replacement, #5 Quick Braid Rosin Wick
W4015-5LF	Cassette, Replacement, #5 Wick, Lead-Free
W4015-5NC	Cassette, Replacement, #5 One Step No-Clean Wick
W4015-5NF	Cassette, Replacement, #5 Wick, Sea Braid Unfluxed

11520 K-Tel Drive, Minnetonka, Minnesota 55343
Phone: 909-627-2453 | Email: Service@EasyBraidco.com | Web: EasyBraidco.com