



	m	1		D							<u>C</u>							B				⊳	
		H26W-/1S-0.	-61S-0.	57S-0.	51S-0.	-45S-0.	FH26W-41S-0.	37S-0.	-35S-0·	FH26W-33S-0.3	-31S-O.	-29S-0.	-27S-O.	-25S-0.	. 0-SEG			155-0.	138-0.		PART NUMBER		
		38HW(9/)		3SHW(97)	3SHW(97)	97	3SHW(9/)	3SHW(97)		3SHW(97)	3SHW(97)	3SHW(97)	3SHW(97)	97	7 7	3SHW(07)	35HW(9/)						
		CL580 2419-/-9,	580-2418-4-		580-2415-6	580-2414-	CL580-2412-8-9/ CL580-2413-0-97	580-2411-	-2410-2	$   \omega   $	-2408-0	-2407-8-	580-2400-9-	_580-2406-5-	580-2405-2-	CI 580-240/9 9/	.580-2403-/-	580-2402-4-	580-2401-1-		<u></u>		
		71	61	-	51			+	35					25	+	) L	+	+	7 13	CONTACT	NUMBEH	NI MOTO	
		22.8	19.8	18.6	16.8	15.0	13.2	12.6	12.0	11.4	10.8	10.2	9.6	9.0	8.4	7.0	5.6	6.0	5.4		DIMENSION	<del></del>	
		20.4	17.4	16.2	14.4	12.6	11.4	10.2	9.6	9.0	8.4	7.8	7.2	6.6	6.0	. a	4.2	. u. o. o	3.0	m	유		
		21.0	18.0	16.8	15.0	13.2	11. 4 12. 0	10.8	10.2	93	9.0	8.4	7.8	7.2	5. F	s 0.4	4.8	4.2	3.6	0	CONNECTOR, FPC		
		21.63	18.63	17. 43	15.63	13.83	12.03	11. 43	10.83	10. 23	9.63	9.03	8. 43	7.83	7. 23	5. CJ	5. 43	4. 83	4. 23		C PATTERN		
		22.3	19.3	18. 1	16.3	14.5	12.7	12.1	11.5	10.9	10.3	9.7	9.1	8.5	7.9	7 2	6.1	5 5	4.9	Ш	AND METAL		
		21.6	18.6	17.4	15.6	13.8	12.0	11.4	10.8	10.2	9.6	9.0	8.4	7.8	7.2	n c	5.4	4.8	4.2	П	MASK		
		44	:   23	జ	24	24	24	24	24	24	24	24	16	16	16	î lo	16	16	16	G			
		40.4	28.4	28.4	ı	1	1 1	ı	ı	ı	1	-	1	1	ı				ı	エ	DIMENSION OF	}	
表		20.2	14.2	14.2	11.5	11.5	11.5	11.5	11.5	11.5	11.5	11.5	7.5	7.5	7.5	7 5	7.5	7.5	7.5	_	DRAWING F	1	
DRAWING NO. CODE		45. 4	33.4	33. 4	25. 4	23.	25 4 4	25, 4	25. 4	25.4	25.4	25.4	17.4	17.4	17.4	17.4	17.4	17.4	17.4	大	OR PACKING		
		49. 4	37.4	37.4	29.4	29. 4	29. 4 29. 4	29.4	29.4	29.4	29.4	29.4	21.4	21.4	21.4	21.4	21.4	21.4	21.4		16		
EDC-323714-97-00 FH26W-**S-0.3SHWC97																							

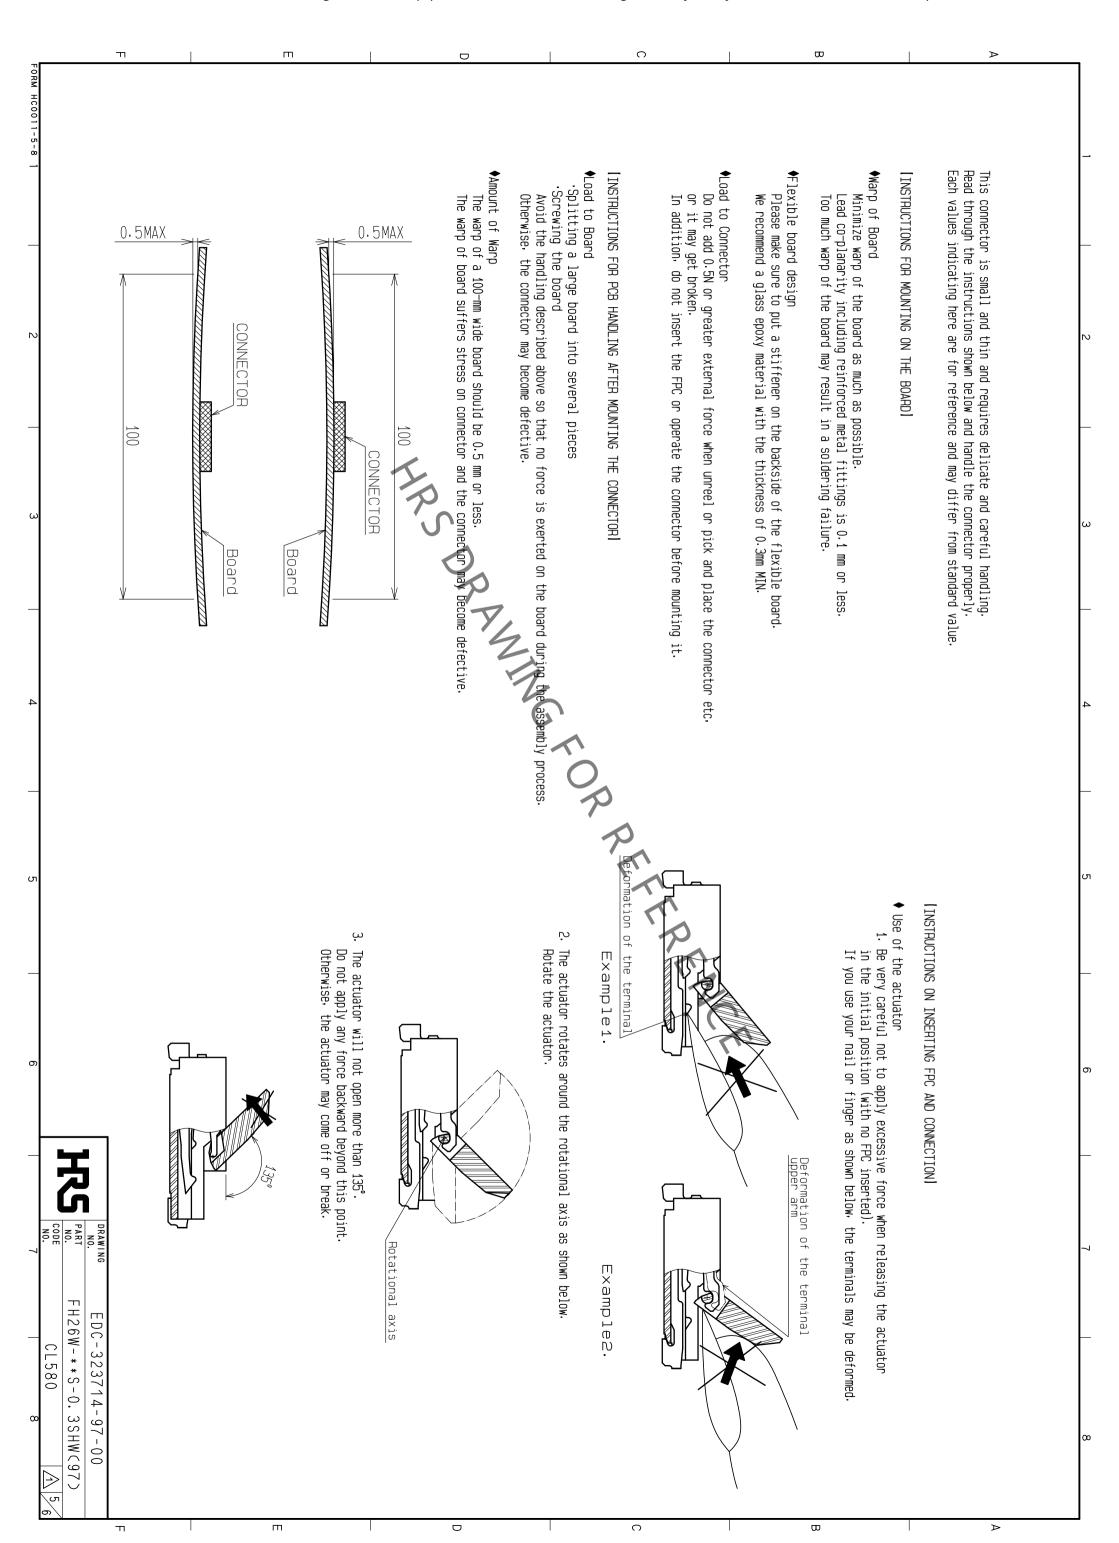

Move the actuator at approximately the center.

4 5

Do not pinch or pick the actuator to lift it as shown below. Otherwise. it may break. (Do not carry out any operation other than rotating the actuator as shown in 2 above.)

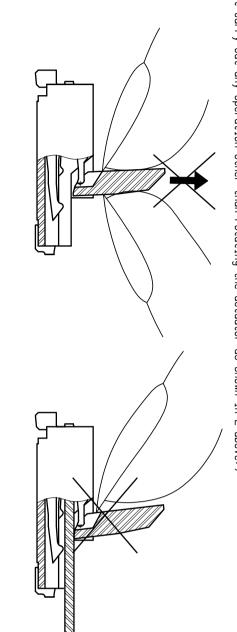

## ◆Direction of Contacts

This connector has contacts on the bottom. Thus, insert the FPC with the exposed conductors face down.

### ♦Inserting the FPC

- the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminals.

  This connector has a ZIF structure, and its effective engagement length is 0.35 mm (when the recommended FPC nominal is used).


  Use the actuator carefully to prevent the FPC from dislocating after inserting it.

  To not insert the FPC diagonally from above.

  If the FPC is inserted at a slant (incorrectly).
- 'n Do not insert the FPC diagonally from above. If the FPC is inserted at a slant (incorrectly) as shown below in the FPC insertion the FPC may bend and patterns may break or the FPC may not insert completely. resulting in improper conduction.

\*Keep a sufficient FPC insertion space in the stage of the Besides, it is not difficult to insert FPC correctly all the way to the end. Design the proper layout of parts. order to avoid incorrect FPC insertion.


\*Make adjustments with the FPC manufacturer for FPC bending perfomance and wire breakage

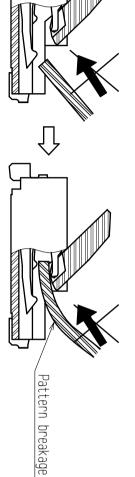

# INSTRUCTIONS ON FPC LAYOUT AFTER CONNECTION

#### ◆Load to FPC


Fix the FPC in particular, when loads are applied to it continuously. Design the FPC layout with care not to bend it sharply near the insertion opening. Otherwise: the connector may become unlocked or the FPC may break. Be very careful not to apply any force to the FPC after inserting it.

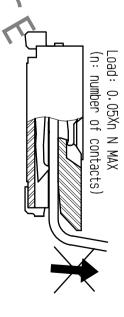

 $\varpi$ 

#### INSTRUCTIONS ON REMOVING FPC

 $\circ$ 

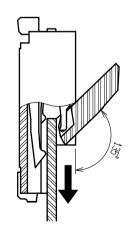

# ♦Instructions on Manual Soldering

1. Do not perform reflow soldering or manual Follow the instructions shown below when so

D

- ollow the instructions shown below when soldering the connector manually during repair work, etc. Do not perform reflow soldering or manual soldering with the FPC inserted into the connector. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.
- Do not use excessive solder (or flux).
- or rotating parts of the actuator· resulting in poor contact or a rotation failure of the actuator. If excessive solder (or flux) is used on the terminals, solder or flux may adhere to the contacts

Supplying excessive solder to the reinforcing bracket may hinder actuator rotation resulting in breakage of the connector.

л				
8				
7	CODE NO.	PART NO.	DRAWING NO.	
8	CL580 A	FH26W-**S-0.3SHW(97)	EDC-323714-97-00	
	<u>o</u>			7

HC0011-5-

◆Checking the Locking Condition

In the locked condition, make sure that the actuator is horizontal on the board surface. Do not apply excessive force to it near the O° position of the actuator. Otherwise, the terminals may be deformed. (Allowable force: 1 N or less)