LASER SENSORS

PHOTOELECTRIC SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS WIRE-SAVING SYSTEMS MEASUREMENT

SENSORS

PLC

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

HUMAN MACHINE

ENERGY CONSUMPTION ISUAI IZATION

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

COMPONENTS

MICRO PHOTOELECTRI SENSORS AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS

## Micro-differential Pressure High-precision Digital Pressure Sensor For Gas

# ERIES

General terms and conditions...... F-7 **Related Information** Glossary of terms ..... P.1469~ Sensor selection guide ...... P.731~ General precautions ...... P.1472





## High accuracy & resolution

## High accuracy and resolution

Due to differential pressure sensing, the pressure can be set with a high resolution of 0.01 kPa.D {1 mmH2O.D} over a pressure range of 0 to 2.00 kPa.D {0 to 204 mmH2O.D} and, moreover, the detection accuracy is within ±1 % F.S.

## Setting resolution

0.01 kPa.D {1 mmH<sub>2</sub>O.D}


## Repeatability

Within ±1 % F.S.

## Detecting clogging of filter

The clogging of a filter can be reliably detected by the differential pressure, indicating the time for filter replacement.

output



## **FUNCTIONS**

## Bright display and easy key operation

Three bright red 7-segment LEDs, 12 mm 0.472 in high, are incorporated in the compact body. They can be clearly read not only in a dark place, but also, in a welllit place. Further, initialization or pressure settings can be easily done with key operation while looking at the display.

## Pressure unit selectable

The pressure unit can be selected from "kPa" and "mmH2O" according to your requirement. Further, during measurement, the pressure unit can be recognized at a glance from the pressure unit indicator.



When the pressure unit is changed, threshold values and the measured pressure value are automatically converted.

## Versatile control with two output modes

#### 1 Hysteresis mode

The lower threshold value and the upper threshold value establish the hysteresis of the comparative output.

## **② Window comparator mode**

The comparative outputs can be made ON or OFF by a pressure within the limits set by the upper and the lower threshold levels.

## VARIETIES

## Analog current output type: DP-M2A

DP-M2A is incorporated also with the analog current output (4 to 20 mA). Hence, it is ideally suited for real time monitoring and multi-point control in combination with an analog controller (ultra-compact digital panel controller CA2 series).



**DP-100** 

SENSOR OPTIONS

## ORDER GUIDE

-				-	<b>.</b>	LASER SENSORS
Туре	Appearance	Rated pressure range	Model No.	Pressure port	Output	PHOTO- ELECTRIC SENSORS
Standard		0 to 2.00 kPa.D {0 to 204 mmH2O.D}	DP-M2	ø4.6 mm ø0.181 in resin pipe	NPN open-collector transistor	MICRO PHOTO- ELECTRIC SENSORS
Star						AREA SENSORS
t			DP-M2A			LIGHT CURTAINS / SAFETY COMPONENTS
analog ent output						PRESSURE / FLOW SENSORS
With and current (						INDUCTIVE PROXIMITY SENSORS
						PARTICULAR USE SENSORS

## OPTIONS

Designation	Model No.	Description	
Sensor mounting bracket	MS-PE-1	L-shaped bracket [Two M3 (length 8 mm 0.315 in) screws with washers are attached.]	WIRE-SAVING SYSTEMS MEASURE- MENT
Panel mounting bracket	MS-PE-2	It can be used for mounting on a panel (1 to 3.2 mm 0.039 to 0.126 in thick).	SENSORS STATIC ELECTRICITY
Front protection cover	MS-PE-3	It protects the sensor's adjustment panel. (It can be fitted when the panel mounting bracket is used.)	LASER MARKERS
Digital panel	anel r CA2-T1	This is a very small controller which allows two independent threshold level settings. • Supply voltage: 24 V DC ±10 % • No. of inputs: 1 No. (sensor input)	
controller (Note)		<ul> <li>Input range: 4 to 20 mA</li> <li>Output: NPN open-collector transistor</li> <li>Main functions:</li> </ul>	HUMAN MACHINE INTERFACES
		Threshold level setting function, zero-adjust function, scale setting function, hysteresis setting function, start / hold function, auto-reference function, power supply ON-delay function, etc.	ENERGY CONSUMPTION VISUALIZATION COMPONENTS

Note: Refer to p.1143~ for details of the ultra-compact digital panel controller CA2 series.


## Sensor mounting bracket

• MS-PE-1



Two M3 (length 8 mm 0.315 in) screws with washers are attached.

## Panel mounting bracket Front protection cover

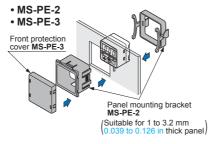

## **Digital panel controller**

CA2 series



Selection Guide
Pressure/ Digital Display
Pressure/ Head-separated
Flow

FA COMPONENTS MACHINE VISION SYSTEMS

UV CURING SYSTEMS

DP-100 DP-M


## SPECIFICATIONS

LASER SENSORS	$\swarrow$	Туре	Standard type	With analog current output type		
PHOTO- ELECTRIC SENSORS	Item		DP-M2	DP-M2A		
MICRO	Type of pressure		Differential	pressure		
PHOTO- ELECTRIC SENSORS	Rate	ed pressure range	0 to 2.00 kPa.D {0 to 204 mmH2O.D}			
AREA	Set	pressure range	0 to 2.00 kPa.D {0 to 204 mmH2O.D}			
	Set	pressure resolution	0.01 kPa.D {1 mmH2O.D}			
LIGHT CURTAINS / SAFETY COMPONENTS	Pres	sure withstandability	6 kPa.D {612 mmH2O.D}			
PRESSURE / FLOW SENSORS	App	licable fluid	Non-corrosive gas			
	Selectable units		kPa, mmH2O			
INDUCTIVE PROXIMITY SENSORS	Sup	ply voltage	12 to 24 V DC <sup>+10</sup> <sub>-15</sub> % Ripple P-P 10 % or less			
PARTICULAR USE SENSORS	Curr	ent consumption	50 mA or less	75 mA or less		
SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS	Comparative output		Residual voltage: 1 V or less (at 1	between comparative output and 0 V) 00 mA sink current) 16 mA sink current)		
WIRE-SAVING SYSTEMS		Utilization category	DC-12 of	r DC-13		
		Output operation	Selectable either normally open (NO) or normally closed (NC) by the key			
MEASURE- MENT SENSORS		Hysteresis	0.01 kPa.D {1	I mmH2O.D}		
STATIC ELECTRICITY PREVENTION		Repeatability	Within ±1 % F.S.			
DEVICES		Response time	10 ms or less			
LASER MARKERS	Short-circuit protection		Incorpo	prated		
PLC HUMAN MACHINE INTERFACES ENERGY	Anal	log current output		Output current: 4 to 20 mA (from 0 to 1.96 kPa.D {0 to 200 mmH2O.D}) Zero-point: within 4 mA $\pm$ 1 % F.S. Span: within 16 mA $\pm$ 3 % F.S. Linearity: within $\pm$ 1 % F.S. Load resistance: 0 to 250 $\Omega$		
CONSUMPTION VISUALIZATION COMPONENTS	Disp	lay	3 digit red LED display (Sampli	ing rate: 4 times/sec. approx.)		
FA		Displayable pressure range	-0.05 to 2.10 kPa.D {-5 to 210 mmH20.D}			
COMPONENTS		Operation	Orange LED (lights up when the comparative output is ON)			
MACHINE VISION SYSTEMS	itors	Pressure unit	Red LED (The indicator corresponding to the selected unit lights up during the sensing mode.)			
UV CURING	Indicators	M1 setting	Red LED (blinks in the M1 setting mode)			
SYSTEMS	_	M2 setting	Red LED (blinks in the M2 setting mode)			
		Pollution degree	3 (Industrial environment)			
	JCe	Ambient temperature	0 to +50 °C +32 to +122 °F (No dew condensation), Storage: -10 to +60 °C +14 to +140 °F			
	Environmental resistance	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH			
Selection Guide	al re	EMC	EN 61000-6-2, EN 61000-6-4			
Pressure/ Digital Display	ment	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure			
Pressure/ Head-separated	/iron	Insulation resistance	50 M $\Omega$ , or more, with 500 V DC megger between all	supply terminals connected together and enclosure		
Flow	Env	Vibration resistance	10 to 150 Hz frequency, 0.75 mm 0.030 in amplit	tude in X, Y and Z directions for two hours each		
		Shock resistance	100 m/s <sup>2</sup> acceleration (10 G approx.) in X	, Y and Z directions for three times each		
DP-100	Tem	perature characteristics	Over ambient temperature range 0 to +50 °C +32 to +122 °	F: within ±3 % F.S. of detected pressure at +25 °C +77 °F		
DP-M	Pressure port		ø4.6 mm ø0.181 in resin pipe			
	Material		Front case: ABS, Rear case: ABS, LED display: Acrylic, Pressure port: PA			
	Cab	le	0.18 mm <sup>2</sup> 3-core oil resistant cabtyre cable, 2 m 6.562 ft long	0.18 mm <sup>2</sup> 4-core oil resistant cabtyre cable, 2 m 6.562 ft long		
	Cable extension		Extension up to total 100 m 328.084 ft (less than 10 m 32.808 ft when conforming to CE marking) is possible with 0.3 mm <sup>2</sup> , or more, cable.			
	Weight		Net weight: 75 g approx., Gross weight: 135 g approx.			
		14/1				

Note: Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +20 °C +68 °F.

## I/O CIRCUIT AND WIRING DIAGRAMS

#### I/O circuit diagram

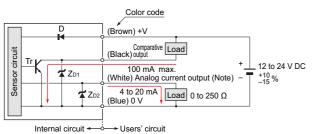

Note: The analog current output is equipped only with the **DP-M2A**. The analog current output of **DP-M2A** does not incorporate a shortcircuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

Symbols ... D: Reverse supply polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr: NPN output transistor

## PRECAUTIONS FOR PROPER USE

- Never use this product as a sensing device for personnel protection.
- In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.
- The DP-M series is designed for use with non-corrosive gas. It cannot be used for liquid or corrosive gas.

## Mounting

- The displayed value may vary by 1 digit (0.01 kPa.D {1 mmH2O.D}) maximum depending on whether the sensor is installed vertically or horizontally.
- A sensor mounting bracket **MS-PE-1** (optional) may be used. When mounting the sensor with the sensor

mounting bracket, the tightening torque should be 0.5 N·m or less




## Conditions in use for CE conformity

• The **DP-M** series is a CE conformity product complying with EMC Directive. The harmonized standard with regard to immunity that applies to this product is EN 61000-6-2 and the following condition must be met to conform to that standard.

#### Conditions

- The sensor should be connected less than 10 m 32.808 ft from the power supply.
- The signal line to connect with this sensor should be less than 30 m 98.425 ft.

## Wiring diagram

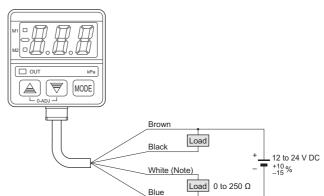

Note: The white lead wire is equipped only with the DP-M2A

Refer to p.1472 for general precautions.

#### Operation

- If setting is impossible even with pressing the MODE key, verify whether the key-protect function is enabled. Please note that pressing down on the MODE key for an extended moment (for 4 sec. or more) will enable the key-protect function as soon as the key is released. The key-protect function is set when the display shows and is released when the display shows and is released when the display shows the function is set when the display shows the display shows the function is set when the display shows the disp
- If using the window comparator mode, lower threshold value (M1) and upper threshold value (M2) should be set with a difference of 3 digits (0.03 kPa.D {3 mmH<sub>2</sub>O.D}) or more. No output will be possible with a 0 to 2 digits difference.


## Piping

 Apply higher pressure to the Hi-port and lower pressure to the Lo-port.


• Use flexible tubes (silicone tube etc.) that can fit the pressure ports, ø4.6 mm ø0.181 in in diameter. The tubes should cover more than half the length of the pressure ports.

#### Recommended tube

• TYGON<sup>®</sup> tube R-3603, size: internal dia 4 mm 0.157 in, external dia 6 mm 0.236 in, manufactured by Saint-Gobain K. K. Contact the manufacturer for details of the recommended product.



- Notes: 1) TYGON is registered trademarks of Saint-Gobain K. K. 2) Ensure that excessive pressure is not applied to the pressure
  - 2) Listie that excessive pressure is not applied to the pressure ports. Since this sensor is designed for detecting small pressures, if excessive pressure or shock is applied to the pressure ports, the diaphragm (pressure sensing device) in the sensor may get damaged.
  - Please do not compress the tube. If the tube is compressed, pressure exceeding the rated value may be generated, damaging the diaphragm (pressure sensing device).



FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO

AREA SENSORS

LIGHT CURTAINS /

SAFETY COMPONENTS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR

USE SENSORS

SENSOR

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION

LASER MARKERS

DEVICES

PLC

HUMAN

ENERGY

MACHINE INTERFACES

COMPONENTS

FA COMPONENTS

MACHINE

VISION SYSTEMS

UV CURING SYSTEMS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO

PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS SAFETY COMPONENTS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR

SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE MENT SENSORS

STATIC ELECTRICITY PREVENTION

LASER MARKERS

DEVICES

PLC

HUMAN MACHINE

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS MACHINE VISION SYSTEMS

CURING

Guid

Flow


DP-100 DP-N

## Refer to p.1472 for general precautions.

## Wiring

• The analog current output of DP-M2A does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

## **Functional description**

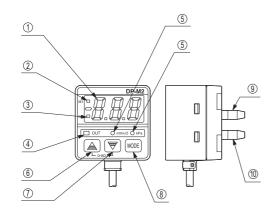


$\geq$	Description	Function		
1	3 digit LED display (Red)	The measured differential pressure level, setting values, error codes, and key protection sign are displayed.		
2	M1 setting indicator (Red) Blinks in the lower threshold value (M1) setting mode.			
3	M2 setting indicator (Red)	Blinks in the upper threshold value (M2) setting mode		
4	Operation indicator (Orange)	Lights up when the comparative output is ON.		
5	Pressure unit indicator (mmH2O, kPa) (Red)	<ul> <li>The indicator of the selected unit lights up during the sensing mode.</li> <li>Both indicators light off during the initial setting mode and during an error occurrence.</li> <li>The indicator of the selected unit blinks during the upper and lower threshold value setting mode.</li> </ul>		
6	Increment key ( ( )	<ul> <li>The settable digit is shifted cyclically at every press of the key during the initial setting mode.</li> <li>Pressing the key increases the set value, in the upper and lower threshold value setting mode.</li> </ul>	During the sensing mode, pressing both switches calibrates the sensor into atmospheric zero.	
0	Decrement key ( (♥)	<ul> <li>The set condition changes at every press of the key during the initial setting mode.</li> <li>Pressing the key decreases the set value, in the upper and lower threshold value setting mode.</li> </ul>		
8	Mode selection key (1900)	<ul> <li>Three modes, the sensing mode, the lower threshold value (M1) setting mode, and the upper threshold value (M2) setting mode, are cyclically selected at every press of the key.</li> <li>During the sensing mode, pressing the key for 4 sec., or more, can make the key protection either effective or ineffective.</li> <li>Holding the increment key ( ) and simultaneously pressing the mode selection key brings the sensor from the sensing mode to the initial setting mode.</li> </ul>		
9	Pressure Lo-port	Lower pressure should be applied.		

#### Output mode and output operation


#### Hysteresis mode ( // ) (M1 < M2)

• The lower threshold value and the upper threshold value establish the hysteresis of the comparative output.

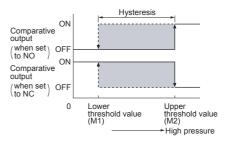

#### Window comparator mode ( $\begin{bmatrix} \\ \\ \\ \end{bmatrix}$ ) (M1 < M2)

. The comparative outputs can be made ON or OFF by a pressure within the limits set by the upper and the lower threshold levels.

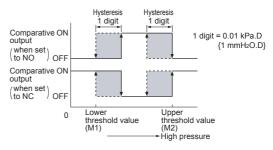

 When operating in window comparator mode ( [ ) lower threshold value (M1) and upper threshold value (M2) should be set with a difference of 3 digits (0.03 kPa.D {3 mmH2O.D}) or more.


#### Others

- · Use within the rated pressure range.
- Do not apply pressure exceeding the pressure withstandability value. The diaphragm will get damaged and correct operation shall not be maintained.
- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- · Do not insert wires, etc., into the pressure port. The diaphragm will get damaged and correct operation shall not be maintained.
- · Do not operate the keys with pointed or sharp objects.


## DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.

Sensor mounting bracket (Optional)

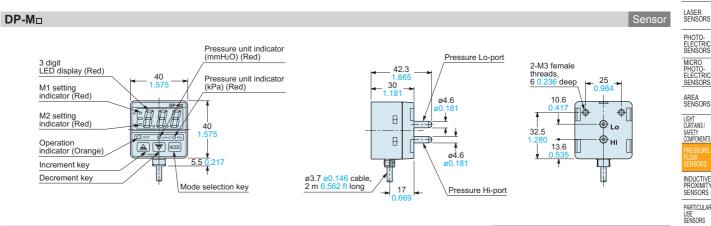


## MS-PE-1

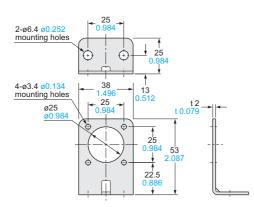


Material: Cold rolled carbon steel (SPCC) Two M3 (length 8 mm 0.315 in) screws with washers are attached

## MS-PE-2 MS-PE-3


## Assembly dimensions

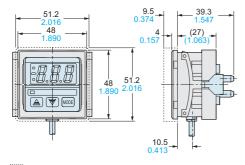

portion shows the front protection cover. Material: Polycarbonate (Front protection cover) Nylon 6, Polyacetal (Panel mounting bracket)

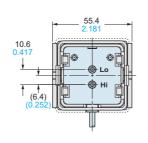

**Assembly dimensions** 

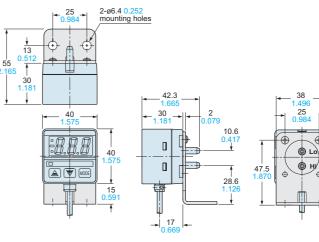

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS PLC HUMAN MACHINE INTERFACES ENERGY

Ð

-⊕

н

756

FIBER SENSORS

CONSUMPTION VISUALIZATION COMPONENTS FA COMPONENTS MACHINE VISION SYSTEMS UV CURING SYSTEMS

Selection

Guide
Pressure/ Digital Display
Pressure/ Head-separated
Flow

DP-100

Note: The panel thickness should be 1 to 3.2 mm 0.039 to 0.126 in.

Panel mounting bracket, front protection cover (Optional)

Panel cut-out dimensions

70

70

2

45 <sup>+0.6</sup>

772

45 +0.6

1.772