12 / 2020 ver. 1.26

# **INSTALLATION GUIDE**

1 C

GENERAL INFORMATION ABOUT ASSEMBLING LEDIL PRODUCTS





LEDIL PRODUCTS TO ENSURE RELIABLE ASSEMBLY.

# CONTENTS

MATERIALS	3	INSTALLATION	23
PMMA & PC	3	Таре	23
Silicone (as a lens material)	3	Screw	24
Heat durability of different materials	4	Glue	25
CHEMICALS	6	Potting	25
Glues / adhesives / potting / thread lock	6	Press-fit	25
Chemical resistance	7	Holder	25
Silicone	7	Profiles	26
PMMA	7	PCB design	27
PC	8	LED assembly	27
STRESS CRACKING	15	LED chip positions	28
UV-RESISTANCE	16	LED compatibility tolerances	2
Plexiglas guarantee	16	Distance between lenses	28
Silicone	16	Sealing and ingress protection of LEDiL optics	29
PC	16	THERMAL MANAGEMENT	30
FIRE RATING	17	Heat sink machining	31
Fire ratings	17	Thermal interface materials	31
Hot Wire Ignition (HWI)	18	Thermal measurements	32
High Amp Arc Ignition (HAI)	18	METAL COATING	33
Outdoor suitability	18	Vacuum Evaporation PVD	34
LEDiL materials fire rating	19	HMDS	34
TENSILE STRENGTH	20	STORAGE	35
TOLERANCES	21	LINKS TO USEFUL INFORMATION	35



# PMMA & PC (TRANSPARENT PLASTIC POLYMERS IN OPTICS)

#### PMMA:

- Rigid and hard
- Average chemical resistance
- Good UV-resistance (naturally UV-stable technology)
- Good light transmission

PC:

- Very tough with excellent physical properties
- Good chemical resistance
- Good heat resistance
- Average UV-resistance (LEDiL uses UV-stabilized clear PC-grade)

In general, PMMA is harder and more fragile than PC, which has greater resistance to impact and heat. LEDiL uses many different types of PC in its products and the information given here is only valid for Makrolon 2407. Although other types of PC offer similar properties their performance should be verified separately.

Transparent polymers can reflect, absorb and refract visible light. Absorption causes the temperature to increase in a lens and this should be taken into consideration during heat simulations. In general, PMWA lenses have higher light transmission rates meaning less light is absorbed. PC on the other hand has better heat resistance, but thicker parts can absorb more light resulting in increased internal temperatures. LEDiL uses UV-stabilized clear PC for optics and all materials are f1-rated (UL746C-standard is suitable for outdoor applications and meets UV and water exposure demands).

# SILICONE (AS A LENS MATERIAL)

Silicone has excellent optical properties, great impact strength, durability and high thermal stability. Silicone's elasticity allows complex optical and functional forms and low viscosity makes microstructural design possible. Silicone has high stability in ultraviolet light and ozone and can be used with UV LEDs where even UV stabilized plastics are unsuitable.

#### Silicone:

- Excellent optical properties with even better efficiency than glass
- Elasticity allows complex optical and functional forms
- High thermal and UV stability
- Great impact strength
- Lightweight design (lighter than glass)

As part of our continuous research and improvement processes LEDiL reserves the right of changing material grades without further notice to ensure best possible quality and availability of our products.

The information contained herein is the property of LEDiL Oy, Joensuunkatu 13, FI-24100 SALO, Finland and is subject to change without notice. Please visit www.ledil.com for additional information, such as the latest photometric files, 3D mechanical models, and application notes relating to handling, gluing and taping.



# HEAT DURABILITY OF DIFFERENT MATERIALS

LED lighting consumes much less power compared to other light sources such as bulbs, fluorescent or energy saving lamps. These tiny light sources are at the focal point of worldwide continuous improvement constantly pushing the edge of heat resistance and luminous output.

If in the early days of LED lighting the power consumption produced around 80°C or 90°C of heat, today the extremely large COBs can produce around 150°C. This direction has led to a situation where luminaire materials need to handle and dispose of more and more heat to ensure safe operation.

# Sources of heat

As a general rule 1/3 of an LED's power consumption is turned into visible light and 2/3 into heat. There are three sources that produce heat in LED lighting: **conduction**, **convection** and **radiation**. All of these are extremely important when a new luminaire design is made but there are also other things to consider regarding heat generation.

Some materials absorb more light than others. This means that an optic's efficiency has a direct link to how hot the lens will get. All sorts of **dirt**, **dust** and **grease** on the optical surface block some of the light rays generating more heat inside the luminaire. During the product lifetime both of these effects tend to increase and therefore speed up the aging process. Every luminaire element and component that stops or reflects some of the light such as **protective glass** and **shades**, may also increase heat inside the luminaire and therefore speed up the aging process.

Careful consideration should be given to all of these areas when designing a luminaire to ensure a safe and long product lifetime. LEDiL products are designed and manufactured to meet high efficiency values to help extend the product lifetime.


# Choosing the right material

On the following page you can find a list of materials and recommended maximum service temperatures.

Please note that because of the complex nature and numerous variables involved in luminaire design and manufacturing that affect the final product heat control, LEDiL cannot take responsibility for third party solutions and designs we can't control. It is always the customer's responsibility to determine and verify there is sufficient cooling and maintenance in the final product and its components.



MATERIAL LINK TO DATASHEETS	MAX RECOMMENDED SERVICE TEMPERATURE (°C)	SPECIMEN THICKNESS (MM) (UL SPECIFICATION)
ABS	70	1.5 - 3
HTPC APEC 1695	130	> 1.5
HRPC <sup>1</sup> ) (LISA2, RITA-A, RITA-B, RITA-WAS, BRITNEY-XW, BOOM-MC-XW, LENINA-XW, LAURA-R-XW, LENA- XWAS, TINA2-R-CLIP16, LEILA-R-CLIP16 LEILA, MINNIE- XW, MINNIE-LTXW, SAGA-FRAME, MIRELLA-XW, MIRELLA-40-XW, MIRELLA-50-XW, MIRELLA-50-WW-PF, REBECCA-RGB-HLD, BROOKE-XW, BARBARA-XW)	70	1.5
$HRPC^{2}$ (angela, angelina, barbara, mirella-G2)	105	> 1.5
PA66GF15	110	1.7
PA66GF30	110	1.5
PBT	125	> 0.75
PC LEXAN 123R	90 (LONG TERM) 110 (SHORT TERM)	> 0.75
PC MAKROLON 2407	90 (long term) 110 (short term)	> 0.75
PMMA (PLEXIGLAS 8N/ALTUGLAS VO40)	80	1.5
POLYPROPYLENE	55	> 0.75
POM	85	> 0.75
SILICONE LENSES & SEALS	1 <i>5</i> 0	> 1
TAPE	120	
METALLIZATION METHODS		PRODUCT FAMILIES
PVD + LACQUER (METALLIZED REFLECTORS)	80	ANGELETTE-WAS, BARBARA, BLONDIE, BOOM, BOOMERANG, BRIDGET, BRITNEY, BRITNEYTE, BROOKE, LENA, LENINA, MINNIE, MIRELLA, REGINA, VENLA
HMDS METALLIZATION	SAME AS BASE MATERIAL	ANGELA, ANGELETTE, ANGELINA, BARBARA-XX-PF, BROOKE-G2, MIRELLA-G2, BARBARA-G2, TYRA, TYRA2, TYRA3

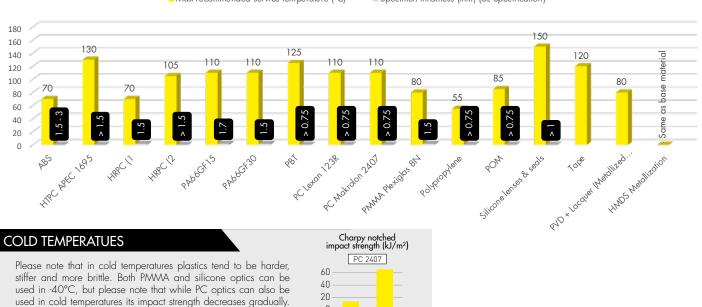

Max recommended service temperature (°C)

Specimen thickness (mm) (UL Specification)

E.g. in -30°C polycarbonate impact strenght is equal to PMMA.

0

-30°C

23°C



# CHEMICALS

# GLUES / ADHESIVES / POTTING / THREAD LOCK

We strongly recommend that every customer fully tests and takes the necessary precautions to ensure there is complete chemical compatibility with each particular product, LEDs and other components. Testing and verifying adhesives, potting agents, coatings and their combinations are always the responsibility of the customer. Please also see sealing and ingress protection chapter on page 29.

# General instructions of use

All surfaces where adhesive is applied must be clean, dry and free from grease and dirt. If the PCB surfaces need to be cleaned, please follow the LED manufacturer cleaning instructions carefully – this is important as cleaning should, under no circumstances, damage LEDs or other electronic components on the PCB. Please note **optical components should not be cleaned with chemicals** – only a micro fiber cloth should be used to remove fingerprints or other traces from handling. To clean silicone lenses use a low-pressure stream of water. We recommend cleaning metallized reflectors with gentle air pressure or an air ionizer. When using adhesive, please follow the detailed instructions of the adhesive manufacturer. E.g. note that different humidity and/or temperature levels may slow down the curing process of the adhesive bond or shorten its lifetime

#### LEDiL Disclaimer:

LEDiL cannot take responsibility for the results obtained by third party methods we cannot control. It is always the customer's responsibility to determine the chemicals suitability for their product and to take precautions for protection of property and persons against any hazards that may be involved in the handling and use such of chemicals. LEDiL disclaims all warranties, including warranties of merchantability or suitability for a particular purpose, arising from use of any adhesive product. LEDiL disclaims any liability for consequential or incidental damages of any kind, including lost profits.



The information contained herein is the property of LEDiL Oy, Joensuunkatu 13, FI-24100 SALO, Finland and is subject to change without notice. Please visit www.ledil.com for additional information, such as the latest photometric files, 3D mechanical models, and application notes relating to handling, gluing and taping.



# **CHEMICAL RESISTANCE**

### Silicone

LEDiL silicone lenses are made of VMQ, Vinyl Methyl group, general purpose silicone.

For more information: www.ledil.com/dow\_corning\_fluid\_resistance\_guide

### PMMA

The chemical resistance of mouldings made from Plexiglas moulding powder (tables on pages 9-14)

- The behaviour in the tables on pages 9 to 14 relate to a test temperature of 23°C, a relative humidity of 50% and mouldings with few internal stresses.
- The behaviour of injection mouldings made from Plexiglas moulding powder depends in practice on the internal and external stresses, the orientation in the moulding and the change of temperature in the resistance to solvents and swelling.
- Plexiglas moulding powder resists all factors met in normal use such as water, perspiration, ink, lipstick, alkaline solutions and weak acids.
- As a result of the chemical structure, most organic solvents, e.g. aromatics, dissolve Plexiglas moulding powder which does, however, resist aliphatic hydrocarbons.
- Do not join Plexiglas moulding powder to plasticized thermoplastics and elastomers because some plasticisers migrate at high temperatures.
- Mouldings occasionally show residual stresses caused by processing or use, but this does not have a negative effect on their resistance to fracture. Inducing to solvents or swelling agents may however cause crazing.
- The material compatibility should be tested in advance in the actual application conditions.



# PC

# General chemical behaviour

The chemical resistance of Makrolon® depends on the concentration of the substance, the temperature, contact time and internal tension level of the polycarbonate sheet depending on fabrication. The following types of damage can arise, sometimes more than one at the same time.

# • Dissolving / Swelling

Low-molecular, aromatic, halogenated and polar components migrate into the plastic. The damage can range from a sticky surface to complete dissolving.

### • Stress cracking

Some chemicals migrate to a minor extend and in very low quantity into the surface, and lead to relaxation of tensions in the material. This results in stress cracking, which can be optically disturbing. Because of increased notch occurance, some mechanical properties are negatively influenced. Stress cracking is usually easy to see in transparent sheets.

### • Molecular reduction

Some properties of materials are determined by the molecular weight. If a substance initiates a molecular reduction through a chemical reaction, the impact resistance and elastic properties of the material will be influenced. Electrical properties are usually not influenced, thermal properties are only slightly influenced by the molecular weight.

In the following tables (pages 9-14) you can find the resistance of Makrolon® to chemicals and several other substances. The test results have been obtained at samples with low internal tensions, which have been stored during 6 months in the substance at a temperature of 20°C, without any mechanical load.

Apart from the nature of the substances, the chemical resistance also depends on the concentration of the substance, the temperature during the contact, the contact time and the internal tension of the tested specimen. This means that our products can be resistant to a number of chemicals for short contacts, but are not resistant in the case of long exposure, such as performed in these tests. Therefore, it is always recommended to execute a test in the actual application conditions. The tested substances have been chosen according to their importance in several areas. In a lot of cases it is possible to assume similar results for other chemically comparable substances, even if these have not been tested.

Our UV-protected materials (Makrolon® UV) are slightly more sensitive to chemicals in comparison to unprotected materials, but in general the results shown in the table still comply.



SUBSTANCE	PC	PMMA
Acetaldehyde	Х	_
	R	
Acetic acid, up to 10% solution Acetone	Х	X
		~
Acetylene	R	-
Acid-containing combustion gasses	R	-
Acrylate sealing compounds	-	Х
Acrylic paints	-	0
Acrylonitril	Х	-
Ajax ®	R	R
Alcohol, concentrated	-	Х
Alcohol, up to 30%	-	R
All purpose adhesive	-	0
All-purpose glue	0	-
Allylalcohol	0	-
Alum	R	-
Aluminum chloride, saturated aqueous solution	R	-
Aluminum oxalate	R	-
Aluminum sulphate, saturated aqueous solution	R	-
Ammonia	Х	R
Ammonia solution acids	-	R
Ammoniacal liquor	Х	-
Ammonium chloride, saturated aqueous solution	R	-
Ammonium nitrate, saturated aqueous solution	R	-
Ammonium sulphate, saturated aqueous solution		-
Ammonium sulphide, saturated aqueous solution		-
Amylo acetate	X	-
Anfistatic plastics cleaner and preserving agent	-	R
Aniline	Х	R.
Antimony chloride, saturated aqueous solution	R	
Antistatik C, 5%	Х	-
Antistatikum 58		-
	0	-
Antistatischer Kunst-stoff-Reiniger + Pfleger	-	R
Aqueous solutions of pesticides	-	0
Aral BG ® 58	R	-
Arquad 18 ®, 50%	0	-
Arsenic acid, 20% solution	R	-
Baktol®, 5%	R	-
BAKTOLAN, conc.	-	Х
BAKTOLAN, up to 5%	-	R
Ballpoint paste Diplomat	0	-
Ballpoint paste Othello	0	-
Ballpoint paste V77 (Linz)	R	-
Basilit ® UAK, 20% in water (wood protection agent)	R	-
Battery acid	R	-
R= Resistantv= VapourO= Limited resistancec= ConceX= No resistanceg= Gas		

SUBSTANCE	PC	PMMA
Baysilon ® Silicone oil	R	-
Benzaldehyde	Х	-
Benzene	Х	-
Benzoic acid	Х	-
Benzyl alcohol	Х	-
BFK cleaner	-	R
Bitumen emulsion	-	Х
Bleach	-	R
Bleaching agent	R	-
Blood	R	-
BOLIMENT	-	0
Borax, saturated aqueous solution	R	-
Boric acid	R	-
BOTTCHERIN	-	R
BP Energol EM 100 ®	R	-
BP Energol HL 100 ®	R	-
BP H LR 65 ®	R	-
Brake fluid (ATE)	Х	-
Bromic benzene	Х	-
Bromine	Х	-
Bromine vapours, dry	-	0
BURMAT	-	R
BURNUS	-	R
Butane (liquid or gaseous)	R	-
Butanol	R	-
Butyl acetate	Х	-
Butyl lactate	-	Х
Butylene glycol	R	-
Butyric acid	Х	-
Cable isolation oil IG 1402	R	-
Cable isolation oil KH 190	R	-
Calcium chloride,saturated aqueous solution,	R	-
Calcium hypochloride	R	-
Calcium nitrate, saturated aqueous solution	R	-
Calcium soap, fat/pure	R	-
Calciumsoap fat	R	-
Calgonit ® dishwassing	Х	-
Calgonit ® rinsing agent	R	-
Calgonit D ®, DM, DA, R	Х	-
CALGONIT D, DA, S	-	R
Calgonit S ®, 1%	R	-
Camphor oil	Х	-
Carbolic acid	Х	-
Carbolic acid (sas)	-	Х
m = Metallic		

sas = Saturated aqueous solution



SUBSTANCE	PC	PMMA
Carbon acid, wet	R	-
Carbon dioxide	-	R
Carbon disulphide	Х	Х
Carbon monoxide	R	R
Carbon tetrachloride	-	х
Castor oil	R	-
Cellux-sticking foils ®	R	-
Cement	R	R
CHINOSOL, up to 1%	-	R
Chlor. lime paste (sas)	-	R
CHLORAMIN, paste	-	Х
CHLORAMIN, solution	-	R
Chlorine benzene	Х	-
Chlorine gas, dry	0	-
Chlorine gas, wet	Х	-
Chlorine lime slurry	R	-
Chlorine lime, 2% in water	R	-
Chlorine vapours, dry	-	0
Chloroamine	R	-
Chloroform	Х	-
Chrom alum, saturated aqueous solution	R	-
Chromic acid, 20% in water	R	-
CILLIT-GRON	-	R
Citric acid	R	-
Citric acid, up to 20% (sas)	-	R
Cleaning gasoline	R	-
CLOPHEN T 55, A 60	-	R
Coal gas, natural gas	-	R
Cod-liver oil	R	-
Contact oil 61	R	-
Copper sulphate, saturated aqueous solution	R	-
Corrosive sublimate	-	R
Cresol	Х	
Cupric chloride, saturated aqueous solution	R	-
Cuprous chloride, saturated aqueous solution	R	
Cyclo hexane	Х	-
Cyclo hexanol	0	
Cyclo hexanone	Х	-
DDT	Х	-
DEKALIN	-	0
Dekaline	R	-
Delegol ®, 5%	R	-
Delu-Antistatiklösung ®	R	-
Diamyl phthalate	Х	-
R = Resistant v = Vapou		
O=Limited resistanceO=VapouO=Limited resistancec=ConceX=No resistanceg=Gas		

SUBSTANCE	PC	PMMA
Dibutyl phthalate (plasticizer)	Х	-
DIEGEL liquid film 23922	-	R
Diesel oil	0	-
Diethylene glykol	R	-
Diethylether	Х	-
Diglycolic acid, saturated aqueous solution	R	-
Dimamin T, 5%	0	-
Dimethyl formamide	Х	-
Dinonyl phthalate (plasticizer)	0	-
Dioctyl phthalate (plasticizer)	0	-
Dioxane	Х	-
Diphyl 5,3	0	-
Dor ®	R	R
DOSYL	-	R
DOSYLAN	-	R
Drilling oil	Х	-
E 605 ®, 0,5% (pesticide)	Х	
E 605 ®, conc.	Х	-
Electroplating baths	-	R
ELMOCID GAMMA, up to 2%	-	R
Esso Estic 42-45 ®	R	
Ether	Х	-
Ethyl alcohol, 96% pure	R	
Ethyl amine	Х	-
Ethyl bromide	X	
Ethylene chlorhydrine	Х	_
Ethylene chloride	X	-
Ethylene glykol	R	-
FAKO polish	-	R
FAKO polishing paste	-	R
Ferritrichloride, saturated aqueous solution	R	-
Ferro bisulphate	R	_
Fewa ®	R	R
Final-photo developer (normal use concentration)	R	-
Fish oil	R	
Foam plastics	ĸ	R
Foam plastics, plasticise		Х
Formaline, 10%ig	R	^
	K O	-
Formic acid, 30% FRAPPIN	0	D
	D	R
Freen ® TF (propellant)	R	
Freen ® T-WD 602 (propellant)	R	-
Frigen ® 113, R113 (propellant)	R	_
FRIGEN A 12 (CF2 Cl2)	-	0

sas = Saturated aqueous solution



SUBSTANCE	PC	PMMA
Fuel oil O	0	_
FULLBOX	0	R
	-	K O
GASOLIN, depending on the blend Gasoline	-	0
	R	-
Gasoline, normal	0	-
Gasoline, super	Х	-
Geha stamping ink	R	-
GLYBAL A	-	Х
Glycerine	0	-
Glycol	R	-
Green chrom oxide (polish paste)	R	-
Green soap	R	-
Gypsum	-	R
HB 155	-	R
Heptane	R	-
Hexane	R	-
Horolith M ®	R	-
Hot bitumen	-	0
Household soap	R	-
Hydraulik oil Vac HLP 16	R	-
Hydrochloric acid (c)	-	R
Hydrochloric acid, 20%	R	-
Hydrochloric acid, conc.	Х	-
Hydrofluoric acid, 5%	R	-
Hydrofluoric acid, conc.	Х	-
Hydrofluorosilicic acid, 30%	R	-
Hydrogen peroxide	R	-
Hydrogen peroxide, 30%	R	-
Hydrogen peroxide, over 40% i.w.	-	0
Hydrogen peroxide, up to 40% i.w.	-	R
Hydrogen sulphide	R	R
Impact ®, 0,2%	0	-
Indian ink S	Х	-
Indian ink T	R	-
Industrial spirit		Х
Insulating tape	-	R
Into-Fensterklar ®	R	
lodine	Х	-
lodine tincture	0	-
Isoamyl alcohol	0	-
Isolation tape	R	
Isolation tape	R	-
Isopropyl alcohol	R	Х
Jet engine fuel JP 4 (Kp 97-209°C)	0	-
R = Resistant $v$ = Var	oour ncentrate	

SUBSTANCE	PC	PMMA
Kaltron ® 113 MDR (propellant)	R	-
Kerosene (Flugbenzin)	Х	-
KOPPERSCHMIDT covering paste	-	R
Lactic acid, 10% in water	R	-
Lactic acid, up to 20% i.w.	-	0
LAVAPLEX	-	R
Lead tetraethylene, 10% in gasoline	0	-
Lighting gas	R	-
Ligroin (hydrocarbon compound)	R	-
Lime milk, 30% in water	0	-
Lubricant based on nafta	R	-
Lubricant based on paraffin	R	-
Lubricant R2 Darina ®	R	-
Lugol solution	-	R
LYSOFORM	-	Х
Lysoform, 2%	R	-
Magnesium chloride	-	R
Magnesium chloride, saturated aqueous solution	R	-
Magnesium sulphate	-	R
Magnesium sulphate, saturated aqueous solution	R	-
Maktol ®	R	-
Manganous sulphate, saturated aqueous solution	R	-
Marlon ®, 1% (moisturizing agent)	R	-
MEFAROL, up to 1%	-	R
MERCKOJOD, up to 1%	-	R
Mercuro chloride, saturated aqueous solution	R	-
Mercury	R	R
Merfen ®, 2%	R	R
Metasystox ®, 0,5% (pesticide)	Х	-
Methacrylic acid-methyester (MMA)	Х	-
Methane	R	R
Methanol	Х	-
Methanol, concentrated	-	Х
Methanol, up to 30%	-	0
Methyl amine	Х	-
Methyl ethyl ketone (MEK)	Х	Х
Methylene chloride	Х	-
, Mobil DTE Oil-Light ®	R	-
Mobil Special Oil 10 W 30 ®	R	-
Molikote ® -Paste	R	-
Molikote ® -Powder	R	-
Monobromonaphthalene	-	R
	-	R
Mortar		

sas = Saturated aqueous solution



SUBSTANCE	PC	PMMA
Motor fuel blend, free from benzene	-	R
Multi-Marker (Faber-Castell)	0	-
Nato-Turbine oil 0-250	R	-
Natril ®	R	-
Natural rubber	R	-
Nekal BX ®, 2% (moisturizing agent)	R	-
NEOMOSCAN M, M-powder	-	R
Neutol ® photo developer (normal use concentration)	R	-
NEXION stable spray	-	R
Nickel sulphate (sas)	-	R
Niroklar GR liquid	-	R
Niroklar GR powder	-	R
Nitric acid, 10%	R	-
Nitric acid, 10-20%	0	-
Nitric acid, 20 to 70% i.w.	-	0
Nitric acid, 20%	Х	-
Nitric acid, over 70% i.w.	-	Х
Nitric acid, up to 20% i.w.	-	0
Nitric Gas, dry	Х	-
Nitrobenzene	Х	-
Nitrocellulose lacquers	-	Х
Nitrogen dioxide	-	R
Nitrogen monoxide	-	R
O Sprays (in the surroundings)	-	0
Oil paints, pure	-	R
Oktozon ®, 1%	R	-
Oleic acid, conc.	R	-
Omo ®	R	-
Orthozid ® 50, 0,5% (pesticide)	R	-
Oxalic acid (sas)	-	R
Oxalic acid, 10% in water	R	-
Oxygen	R	R
Ozone	R	R
P 3	-	R
P 3 basic cleaner	-	0
P3 Asepto ®	Х	-
PALATINOL K	-	R
PALATINOL O, BB neu	-	0
Pantex ®, 2%	R	-
Paraffin oil	R	-
PATTEX special glue	-	0
Pelikan Royal Blue 4001	R	-
Pentane	R	-
PERBUNAN	-	R
R= Resistantv= VapourO= Limited resistancec= ConceX= No resistanceg= Gas		

SUBSTANCE	PC	PMMA
Perbunan C ®	R	-
Perchloric acid, 10% in water	R	-
Perchloric acid, concentrated	0	-
Perchloro ethylene	Х	Х
Perhydrol	R	R
Perhydrol, 30%	R	-
PERODIN	-	R
Persil ®	0	R
Persoftal ®, 2%	R	-
Perspex Polish 3 ®	R	-
Petrol ether	-	R
Petrol, contg. aromatic substances	-	Х
Petrol, non-aromatic	-	R
Petrol, pure	-	R
Petroleum	0	0
Petroleum ether	0	-
Petroleum spirit	R	
Phenol	Х	-
Phenols	-	Х
Phenyl ethyl alcohol	Х	-
Phosphates	-	R
Phosphonc acid, up to 10% i.w.	-	R
Phosphor trichloride	Х	-
Phosphoric acid, conc.	R	-
Phosphoric oxichloride	Х	-
Phosphorus trichloride	-	Х
Phosphorus, white	-	Х
Photochemical baths	-	R
Picric acid, 1% i.w.	-	R
Plaster	R	-
Plasticiserfree glazing kit	R	
Plexiklar ®	R	R
PLEXISOL adhesive	-	0
PLEXIT	-	0
PLEXTOL adhesive	-	R
PLK 4 (wood protection agent)	R	-
Polifac grinding paste ®	R	
Polishing wax	R	-
Polyamide	R	R
Polyethylene	R	R
Polymer plasticizer O	0	-
Polyran ® MM 25 (lubricant)	R	-
Polyvinylchloride (plasticizer free)	R	-
, , ,		

sas = Saturated aqueous solution

PC

R O R

R

R

Х

0

R

R R R

R R

R

X R

R

R

0 0

R

-

R R

X R PMMA

X X

O R

R

R

R

R R

R R

R

R

R

R

R

Х

R

X R

R



SUBSTANCE	PC	PMMA	SUBSTANCE
Potassium aluminum sulpate, (sas)	R	-	Shell Spirax 90 EP ®
Potassium bichromate, (sas)	R	-	Shell Tellus 11-33 ®
Potassium bromide, (sas)	R	-	Shell Tellus 33 ®
Potassium carbonate, (sas)	R	-	Sidolin ®
Potassium chloride, (sas)	R	-	Silicon tetrachloride
Potassium cyanide	Х	-	Silicone oil
Potassium hydroxide	Х	-	Silicone rubber (acetic acid curing)
Potassium metabisulphide, 4% in water	R	-	Silicone rubber (Camino curing)
Potassium nitrate, saturated aqueous solution	R	-	Siliconoil emulsion
Potassium perchlorate, 10% i.w.	R	-	Silver nitrate (sas)
Potassium permanganate, 10% i.w	R	-	Skydrol 500 A ®
Potassium persulphate, 10% i.w.	R	-	Soap solution
Potassium rhodanide, (sas)	R	-	Soap suds
Potassium sulphate, (sas)	R	-	Sod. hydroxide soln.
Pril ®	R	R	, Soda
Propane gas	R	-	Soda water
Propargyl alcohol	R	-	Sodium bicarbonate, (sas)
Propionic acid, 20%	R	-	Sodium bisulphate, (sas)
Propionic acid, conc.	Х	-	Sodium bisulphide, (sas)
Propyl alcohol	R	-	Sodium bisulphite
Propylene	-	R	Sodium carbonate
Putty	R	-	Sodium carbonate, (sas)
PVC	-	R	Sodium chlorate (sas)
PVC, plasticised	-	Х	Sodium chloride (sas)
Pyridine	Х	Х	Sodium hydroxide
RABOND stable spray	-	R	Sodium hypochloride, 5% in water
Rapdosept ®	0	-	Sodium hypochlorite
Rape oil	R	-	Sodium soap fat
Red lead	-	R	Sodium sulphate
Register-ink DIA type U rot	R	-	Sodium sulphate, (sas)
Rei ®	R	R	Sodium sulphide
Resorcin oil solution, 1%	R	-	Sodium sulphide, (sas)
Resorcinol solutions, 1%	R	-	Somat W ® 731
Riseptin ®	R	-	SPECTROL
Rubber	-	R	Spirit, pure
Rubber, plasticised	-	X	SPRAYLAT
Sagrotan ®, 5%	0	0	SPULI
SAGROTAN, up to 2%	-	R	Stain remover Alkaline solutions
SANGAJOL		R	Stannous chloride
Sea water	R	-	Starch
Sealing strips, (FAKO, TEROSTAT, PRESTIK)	-	R	Statexan AN ®
SEIFIX		R	Stearic acid
Sewing machine oil	R	N	Styrene
Sewing indenine on Shell IP 4 (fuel)	X		Sublimate
R = Resistant v = Va	pour oncentrate		m = Metallic sas = Saturated aqueous solution i.w. = In water



SUBSTANCE	PC	PMMA
Sublimate, (sas)	R	_
Sulphur	R	-
	К	R
Sulphur (c)	-	ĸ
Sulphur dioxide	0	R
Sulphur dioxide (dry)	-	
Sulphur dioxide, liquid	-	Х
Sulphuric acid, 50%	R	-
Sulphuric acid, 70%	0	-
Sulphuric acid, conc.	Х	-
Sulphuric acid, up to 30% i.w.	-	R
Sulphurous acid, 10%	Х	-
Sulphurous acid, (c)	-	0
Sulphurous acid, up to 5%	-	R
Sulphuryl chloride	Х	R
Suwa ®	R	-
Sweat, acid (pH 4,7)	R	-
sweat, alkaline (pH 9,5)	0	-
Tanigan ® CLS, 30%	0	-
Tanigan ® CV	0	-
Tannic acid	Х	-
Tanning oil Brunofix ®	R	-
Tartaric acid, 10%	R	-
Tartaric acid, 50% i.w	-	R
TB Lysoform	Х	-
TERAPIN	-	R
Terostat ®	R	-
Tesafilm ®	R	-
Tesamoll ®	R	-
Test fuel	Х	-
Tetrachlorocarbon	Х	-
Tetrachloroethane	Х	-
Tetrahydrofurane	Х	-
Tetralin	-	Х
Tetraline	Х	-
Texaco Regal Oil BRUO ®	R	-
Texaco Regal Oil CRUO ®	R	-
Thenocalor N	R	-
Thinners in general	-	Х
Thiokol rubber (one- and two-component grades)	-	Х
Thionyl chloride	-	Х
Thiophene	Х	-
Tincture of iodine, 5%	-	Х
Toluene	Х	Х
Trichloro acetic acid, 10%	0	-
R = Resistant v = Vapour		
O= Limited resistancec= ConceX= No resistanceg= Gas		

Trichloroactetic acid.XTrichloroattyl amineX.Trichloroattyl phosphate (plasticizer)O.Trichloroattyl phosphate.RTricresyl phosphate.RTricresyl phosphate (plasticizer)X.Tricresyl phosphate (plasticizer)X.TriethylamineTroslin F @ extra @, 1,5%R.Tubo @ carpet shampoo, (c)O.TurpentineTurpentineTurpentine ersctzR.Turpentine substituteUrea, (sas)R.ValvAlNOL, up to 2%VatrashO.Waste gases contg. hydrochloric acidWaste gases contg. sulphuric acidWaste gases contg. sulphuric acidWhale fatWisor-Pen 7 blauX Sprays (applied directly)X yleneZinc culphate, sagiZinc sulphate, solidZinc sulphate, solidZinc sulphate, solidZinc sulphate, solidX Strays (applied directly)X Sprays (applied directly)X Strays (applied directly)X Strays (applied directly)Zinc sulphate, solid<	SUBSTANCE	PC	PMMA
Trichloroethyl phosphate (plasticizer)OTrichloroethyleneX-Tricresyl phosphate-RTricresyl phosphate (plasticizer)X-Triethylamine-RTrosilin F @ extra, 2%R-Trosilin G extra @, 1,5%R-Tuba @ carpet shampoo, (c)O-Turbo oil 29R-Turpentine-OTurpentine ersatzR-Turpentine substitute-OUrea, (sas)R-ValVANOL, up to 2%-OValvoline WA 4-7O-Valvoline WA 4-7O-Waste gases contg. sulphuric acid-RWaste gases contg. sulphuric acid-RWaterRWaste Gases contg. sulphuric acid-RWisor-Pen 7 blauRWK 60 @ (Kron-Chermie)R-X Sprays (applied directly)-XXyleneXXZinc chloride, (sas)R-Zinc sulphate, aqueousR-Zinc sulphate, faslR-Zinc sulphate, solid-R	Trichloroacetic acid	-	Х
TrichloroethyleneX.Tricresyl phosphate (plasticizer)X.Tricresyl phosphate (plasticizer)X.Triethylamine.RTrosilin F @ extra, 2%R.Trosilin G extra @, 1,5%R.Tuba @ carpet shampoo, (c)O.Turbo oil 29R.Turpentine.OTurpentine ersatzR.Turpentine substitute.OUrea, (sas)R.VALVANOL, up to 2%.OValvoline WA 4-7O.Valvoline WA 4-7O.Vaste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterRWhale fatR.Whale fatR.Visor-Pen 7 blauR.WK 60 @ (Kron-Chermie)R.X Sprays (applied directly).XXyleneXXZEPHIROL, up to 5%.RZinc choride, (sas)R.Zinc sulphate, (sas)R.Zinc sulphate, solid.R	Trichloroethyl amine	Х	-
TrichloroethyleneX.Tricresyl phosphate (plasticizer)X.Tricresyl phosphate (plasticizer)X.Triethylamine.RTrosilin F @ extra, 2%R.Trosilin G extra @, 1,5%R.Tuba @ carpet shampoo, (c)O.Turbo oil 29R.Turpentine.OTurpentine ersatzR.Turpentine substitute.OUrea, (sas)R.VALVANOL, up to 2%.OValvoline WA 4-7O.Valvoline WA 4-7O.Vaste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterRWhale fatR.Whale fatR.Visor-Pen 7 blauR.WK 60 @ (Kron-Chermie)R.X Sprays (applied directly).XXyleneXXZEPHIROL, up to 5%.RZinc choride, (sas)R.Zinc sulphate, (sas)R.Zinc sulphate, solid.R	Trichloroethyl phosphate (plasticizer)	0	-
Tricresyl phosphate (plasticizer)X-Triethylamine-RTrosilin F @ extra, 2%R-Trosilin G extra @, 1,5%R-Tuba @ carpet shampoo, (c)O-Turbo oil 29R-Turpentine-OTurpentine ersatzR-Turpentine substitute-OUrea, (sas)R-ValvANOL, up to 2%-OValvoline VVA 4-7O-VarnishO-Waste gases contg. hydrochloric acid-RWaterRWaterR-Visor-Pen 7 blauR-WK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solid-RZinc sulphate, solid-RZinc sulphate, solid-R		Х	-
Triethylamine.Triethylamine.Trosilin F @ extra, 2%RTrosilin G extra @, 1,5%RTuba @ carpet shampoo, (c)OTurbo oil 29RTurpentine.Turpentine ersatzRTurpentine substitute.Urea, (sos)RValVANOL, up to 2%.Valvoline VVA 4-7OVarnishOVarnishOWaste gases contg. hydrochloric acid.WaterRWaterRWhale fatRVisor-Pen 7 blauRWK 60 @ (Kron-Chemie)RX Sprays (applied directly).XyleneXZinc chloride, (sas)RZinc sulphate, aqueousRZinc sulphate, (sas)RZinc sulphate, solid.R.Zinc sulphate, solid.R.R.R.R.R.R.R.R.R.	Tricresyl phosphate	-	R
Trosilin F @ extra, 2%R.Trosilin G extra @, 1,5%R.Tuba @ carpet shampoo, (c)O.Turbo oil 29R.Turpentine-OTurpentine ersatzR.Turpentine substitute-OUrea, (sas)R.VALVANOL, up to 2%-OValvoline WA 4-7O.VarnishO.Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterRWhale fatR.Visor-Pen 7 blauR.WK 60 @ (Kron-Chemie)R.X Sprays (applied directly).XXyleneXXZinc chloride, (sas)R.Zinc sulphate, aqueousR.Zinc sulphate, solid-R	Tricresyl phosphate (plasticizer)	Х	-
Trosilin G extra @, 1,5%R.Tuba @ carpet shampoo, (c)O.Turbo oil 29R.Turpentine-OTurpentine ersatzR.Turpentine substitute.OUrea, (sas)R.VALVANOL, up to 2%.OValvoline WA 4-7O.Valvoline WA 4-7O.Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR.Whale fatR.Visor-Pen 7 blauR.WK 60 @ (Kron-Chemie)R.X Sprays (applied directly).XXyleneXXZinc chloride, (sas)R.Zinc sulphate, aqueousR.Zinc sulphate, solidR.	Triethylamine	-	R
Tuba @ carpet shampoo, (c)OTurbo oil 29RTurpentine-Turpentine ersatzRTurpentine substitute-Urea, (sas)RValVANOL, up to 2%-Valvoline WA 4-7OValvoline WA 4-7OWaste gases contg. hydrochloric acid-Waste gases contg. sulphuric acid-WaterRWaterRWaterRWhale fatRVisor-Pen 7 blauRWK 60 @ (Kron-Chemie)RX Sprays (applied directly)-XyleneXZinc chloride, (sas)RZinc sulphate, aqueousRZinc sulphate, (sas)RZinc sulphate, solidRZinc sulphate, solidR	Trosilin F ® extra, 2%	R	-
Turbo oil 29RTurbo oil 29RTurpentine-Turpentine ersatzRTurpentine substitute-Urea, (sas)RVALVANOL, up to 2%-Valvoline VVA 4-7OVarnishOVarnishOWaste gases contg. hydrochloric acid-WaterRWaterRWaterRWhale fatRVisor-Pen 7 blauRWK 60 @ (Kron-Chemie)RX Sprays (applied directly)-XyleneXZinc chloride, (sas)RZinc sulphate, aqueous-Zinc sulphate, (sas)RZinc sulphate, solid-Tir sulp	Trosilin G extra ®, 1,5%	R	-
Turpentine.OTurpentine ersatzR.Turpentine substitute.OUrea, (sas)R.VALVANOL, up to 2%.OValvoline WA 4-7O.VarnishO.Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR.WaterR.Whale fatR.Visor-Pen 7 blauR.WK 60 @ (Kron-Chemie)R.X Sprays (applied directly).XXyleneXXZephirol @O.Zinc chloride, (sas)R.Zinc sulphate, aqueous.RZinc sulphate, (sas)R.Zinc sulphate, solid.RXXinc sulphate, solid	Tuba ® carpet shampoo, (c)	0	-
Turpentine ersatzR.Turpentine substituteUrea, (sas)RVALVANOL, up to 2%Valvoline VVA 4-7VarnishWaste gases contg. hydrochloric acidWaste gases contg. sulphuric acidWaterR.WC-00Whale fatR.Visor-Pen 7 blauR.VK 60 @ (Kron-Chemie)R.X Sprays (applied directly)X Sprays (applied directly)Zephirol @Zinc chloride, (sas)Zinc sulphate, aqueousZinc sulphate, solidTir	Turbo oil 29	R	-
Turpentine substitute-OUrea, (sas)R-VALVANOL, up to 2%-OValvoline WA 4-7O-VarnishO-Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-WC-00-RWhale fatR-Visor-Pen 7 blauR-VK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZephirol @O-Zinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-XSprays (solid met, solidRZinc sulphate, solid-R	Turpentine	-	0
Urea, (sas)R.VALVANOL, up to 2%-OValvoline WA 4.7O-VarnishO-Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-Wc-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZephirol @O-Zinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-XX-Xin sulphate, solid-RXin sulphate, solidXin sulphate, solidXin sulphate, solidXin sulphate, solid- <td< td=""><td>Turpentine ersatz</td><td>R</td><td>-</td></td<>	Turpentine ersatz	R	-
Urea, (sas)R.VALVANOL, up to 2%-OValvoline WA 4.7O-VarnishO-Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-Wc-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZephirol @O-Zinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-XX-Xin sulphate, solid-RXin sulphate, solidXin sulphate, solidXin sulphate, solidXin sulphate, solid- <td< td=""><td>Turpentine substitute</td><td>-</td><td>0</td></td<>	Turpentine substitute	-	0
Valvoline WA 4-7OVarnishO-Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-RWaterR-RWC-00-R-Whale fatR-RVisor-Pen 7 blauRWK 60 ® (Kron-Chemie)R-XX Sprays (applied directly)-XXZephirol ®O-RZinc chloride, (sas)R-RZinc sulphate, aqueous-R-Zinc sulphate, solidR-R		R	-
Valvoline WA 4-7OVarnishO-Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-RWaterR-RWC-00-R-Whale fatR-RVisor-Pen 7 blauRWK 60 ® (Kron-Chemie)R-XX Sprays (applied directly)-XXZephirol ®O-RZinc chloride, (sas)R-RZinc sulphate, aqueous-R-Zinc sulphate, solidR-R	VALVANOL, up to 2%	-	0
Waste gases contg. hydrochloric acid-RWaste gases contg. sulphuric acid-RWaterR-RWC-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXXZephirol @0-Zinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-X-R		0	-
Waste gases contg. sulphuric acid-RWaterR-WC-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 ® (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZephirol ®0-Zinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-	Varnish	0	-
WaterRWaterRWC-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 @ [Kron-Chemie]R-X Sprays [applied directly]-XXyleneXXZephirol ®0-ZEPHIROL, up to 5%-RZinc chloride, [sas]R-Zinc sulphate, aqueous-RZinc sulphate, solidR-X-R	Waste gases contg. hydrochloric acid	-	R
WC-00-RWhale fatR-Visor-Pen 7 blauR-WK 60 @ (Kron-Chemie)R-X Sprays (applied directly)-XXyleneXXZephirol ®0-ZEPHIROL, up to 5%-RZinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, solidR-Xinc sulphate, solid-R	Waste gases contg. sulphuric acid	-	R
Whale fatRVisor-Pen 7 blauRWK 60 @ [Kron-Chemie]RX Sprays [applied directly]-X Sprays [applied directly]-XyleneXZephirol @0ZEPHIROL, up to 5%-Zinc chloride, [sas]RZinc sulphate, aqueous-Zinc sulphate, solidRZinc sulphate, solid-	Water	R	-
Visor-Pen 7 blauRWK 60 ® (Kron-Chemie)RX Sprays (applied directly)-X Sprays (applied directly)-XyleneXZephirol ®0ZEPHIROL, up to 5%-Zinc chloride, (sas)RZinc sulphate, aqueous-Zinc sulphate, (sas)RZinc sulphate, solid-	WC-00	-	R
WK 60 ® (Kron-Chemie)RX Sprays (applied directly)-XXyleneXXZephirol ®0-ZEPHIROL, up to 5%-RZinc chloride, (sas)R-Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solidR-	Whale fat	R	-
X Sprays (applied directly)-XXyleneXXZephirol ®0-ZEPHIROL, up to 5%-RZinc chloride, (sas)R-Zinc oxideR-Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solid-R	Visor-Pen 7 blau	R	-
XyleneXXZephirol ®00-ZEPHIROL, up to 5%-RZinc chloride, (sas)R-Zinc oxideR-Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solid-R	······································	R	-
Zephirol ®OZEPHIROL, up to 5%-Zinc chloride, (sas)RZinc oxideRZinc sulphate, aqueous-Zinc sulphate, (sas)RZinc sulphate, solid-			
ZEPHIROL, up to 5%-RZinc chloride, (sas)R-Zinc oxideR-Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solid-R	•		
Zinc chloride, (sas)R-Zinc oxideR-Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solid-R		0	
Zinc oxideRZinc sulphate, aqueous-Zinc sulphate, (sas)RZinc sulphate, solid-		-	R
Zinc sulphate, aqueous-RZinc sulphate, (sas)R-Zinc sulphate, solid-R			-
Zinc sulphate, (sas)RZinc sulphate, solid-R			P
Zinc sulphate, solid - R			R
			R
	ÄTHROL, up to 5%	_	0

m = Metallic sas = Saturated aqueous solution i.w. = In water





LEDiL products are designed and manufactured to avoid internal stress as much as possible, but this can't be totally avoided. Common optical grade thermoplastics are vulnerable to cracking from a combination of external or internal stress sources and chemicals.

Even relatively small concentrations of stress-cracking agent may be sufficient to cause the cracking, but in many cases it's caused by a combination of several factors.

# Possible factors that cause cracking

- Manufacturing process
- Temperature changes - Thermal expansion and shrinking
- Chemical exposure
  - Detergents
  - Surface active chemicals
  - Lubricants
  - Oils
  - Ultra-pure water
  - Plating additives such as brighteners and wetting agents
  - Lock-thread fluids
- Screw type, torque and other fastening methods





# **UV-RESISTANCE**

Plastics degenerate differently when exposed to UV-light. Some plastics may show dramatic changes, turning yellow or losing some of their transmission properties over a long period of time. This must be considered when choosing materials for your application.

LEDiL has conducted extensive UV-testing over the years for various different materials and found that even materials that tend to have very heavy yellowing will not significantly suffer from efficiency loss. However yellowing may cause the colour temperature to change to warmer tones.

### Plexiglas guarantee

PLEXIGLAS® guarantees their materials will not show yellowing and will retain a high level of light transmission for 30 years.



# PMMA

High UV-resistance with no yellowing. For better impact resistance protective glass is needed.

# SILICONE

Dow Corning ® MS silicones have very high UV-resistance with no yellowing, and are highly transparent to radiation all the way down to IR-wavelengths.

# PC

Good for applications that require higher impact resistance, but will show noticeable yellowing over time when exposed to UV-radiation. Therefore LEDiL does not recommend using products made of PC in applications where exposure to UV-radiation is high. To avoid yellowing special filtering glasses can be used to block out all the damaging UV from sunlight. After a very long period of time ultraviolet light may also cause some brittleness in the material and LEDiL recommends using plastic washers with fasteners to decrease mechanical stresses.



# FIRE RATING



Fire resistance testing is carried out as stated in the UL94 standard. The standard classifies plastics according to the burning rate in different positions and different-sized pieces. All LEDiL materials have UL94 standard fire rating. For metallized products UL-class confirmation tests were carried out by Tampere University of Technology.

### Fire ratings

- HB Slow burning on a horizontal specimen; burning rate < 76mm/min for thickness < 3mm or burning stops before 100mm
- V-2 Burning stops within 30 seconds on a vertical specimen; drips of flaming particles are allowed.
- V-1 Burning stops within 30 seconds on a vertical specimen; drips of particles allowed as long as they are not inflamed.
- V-0 Burning stops within 10 seconds on a vertical specimen; drips of particles allowed as long as they are not inflamed.
- 5VB Burning stops within 60 seconds on a vertical specimen; no drips allowed; plaque specimens may develop a hole.
- 5VA Burning stops within 60 seconds on a vertical specimen; no drips allowed; plaque specimens may not develop a hole



# HOT WIRE IGNITION (HWI)

Test specimens are wrapped with resistance wire that dissipates a specified level of energy. HWI is the time it takes to either ignite or burn through a specimen. Performance Level Categories (PLC) were introduced to avoid excessive implied precision and bias.

#### HWI Mean Ignition Time (sec)

- PLCO 120 and longer
- PLC1 60 through 119
- PLC2 30 through 59
- PLC3 15 through 29
- PLC4 7 through 14
- PLC5 <7

# **HIGH AMP ARC IGNITION (HAI)**

The number of arc rupture exposures necessary to ignite a material when they are applied at a standard rate on the surface of the material. Performance Level Categories (PLC) were introduced to avoid excessive implied precision and bias.

#### HAI Mean Number of Arcs

PLCO	120 and greater
PLC 1	60 through 119
PLC2	30 through 59
PLC3	15 through 29
PLC4	<15

# **OUTDOOR SUITABILITY**

Materials considered suitable for outdoor use have been subjected to ultraviolet (UV) light exposure and/ or water immersion. UV exposure is performed by using either a twin-enclosed carbon weatherometer for 720 hours, or a xenon-arc weatherometer for 1000 hours. Water immersion testing is performed for 7 days at 70°C. Specimens are tested before and after exposure for flammability, mechanical impact and mechanical strength. Materials whose properties are not significantly degraded in any of these areas are considered to have passed and are suitable for outdoor use.



LEDiL materials fire rating					1	MATERIAI					
• HWI	HAI, RTI and phys	sical	PMMA	PC	PC	PC	PC	Silicone	Silicone	Silicone seal	Ultramid
	in a, it ii and phys	Jicut	MANUFACTURER								
			Evonik plexiglas 8N	Bayer Makrolon 2407	Sabic Lexan 123R	HRPC	HTPC	harder	softer	Silicone seal	BASF A3EG6
	FLAME RATING	TEST METHOD					VALUE				
	0.75mm	UL 94		V-2	HB		HB				HB
	0.75mm	IEC 60695-11-10,20		V-2	HB40		HB75				HB75
	1.00mm	UL 94						HB	HB		
	1.00mm	IEC 60695-11-10,20						HB75	HB75		
	1.50mm	UL 94	HB		HB	V-O	HB				HB
~	1.50mm	IEC 60695-11-10,20	HB75		HB75	V-0	HB75				HB75
filio	1.50mm to 2.60mm	UL 94, IEC 60695-11-10,20		V-2							
nak	2.50mm	UL 94				V-O, 5VB					
Flammability	2.50mm	IEC 60695-11-10,20				V-0, 5VB					
Ë	2.70mm	UL 94		HB	_			_	_		
	2.70mm	IEC 60695-11-10,20		HB75							
	3.00mm	UL 94		HB	HB	V-0, 5VA	HB	HB	HB	_	HB
	3.00mm	IEC 60695-11-10,20		HB40	HB75	V-0, 5VA	HB40	HB40	HB40	1/0	HB40
	4.00mm - 4.3mm 4.00mm - 4.3mm	UL 94 IEC 60695-11-10,20			_			_	_	V-0 V-0	
	4.00mm - 4.3mm 6.00mm	UL 94		HB						V-0	HB
	6.00mm	IEC 60695-11-10,20		HB40							HB40
	0.001111	120 00073 11 10,20		11040							11040
	Hot-wire ignition (HWI)										
	1.00mm	UL746						PLC4	PLC4		PLC4
	1.50mm	UL746			PLC4						
	1.50-2.60mm	UL746		PLC3							
	2.70mm	UL746		PLC3							
-	3.00mm	UL746		PLC2	PLC4			PLC2	PLC4		PLC 1
irico.	6.00mm	UL746		PLCO							PLCO
Electrical	High Amp Arc Ignition (H.	Al)									
ш	1.00mm	UL746						PLC 1	PLCO		PLCO
	1.50mm	UL746			PLC2						
	1.50-2.60mm	UL746		PLCO							
	2.70mm	UL746		PLCO							
	3.00mm	UL746		PLCO	PLC 1			PLCO	PLCO		PLCO
	6.00mm	UL746		PLCO							PLCO
Thermal										150°C	
	RTI Elec. (1.50mm)	UL 94	90°C	125°C	130°C	120°C	140°C	150°C	150°C	(4,0-4,3mm)	120°C
	RTI Imp. (1.50mm)	UL 94	90°C	115℃	125°C	105°C	130°C	150°C	150°C	150°C (4,0-4,3mm)	120°C
1-	RTI Str. (1.50mm)	UL 94	90°C	125°C	125°C	120°C	140°C	150°C	150°C	150°C (4,0-4,3mm)	130°C
Physical	Outdoor suitability	UL 746C	f1	f1	f1			f1	f1		

#### **Rating Description**

f1 The material has met both UV and water immersion requirements.

f2 The material has met either UV or water immersion requirements, or has only been partially tested.



# TENSILE STRENGTH

LEDiL tests its products to meet or exceed tensile strength requirements and standards; this includes tape fastening, third party adhesives and mechanical structures such as pins.

#### LEDiL Disclaimer:

LEDiL cannot take responsibility for the results obtained by third party methods we cannot control. It is always the customer's responsibility to determine and verify the sufficient tensile strenght in the final product and its components.



#### GENERAL TOLERANCES FOR LINEAR DIMENSIONS (DIN 16901-130)

Linear dimensions (mm	n) (mm)
a ≤ 1	± 0.18
l < a ≤ 3	± 0.19
3 < a ≤ 6	± 0.20
6 < a ≤ 10	± 0.21
10 < a ≤ 15	± 0.23
15 < a ≤ 22	± 0.25
22 < a ≤ 30	± 0.27
30 < a ≤ 40	± 0.30
40 < a ≤ 53	± 0.34
53 < a ≤ 70	± 0.38
70 < a ≤ 90	± 0.44
90 < a ≤ 120	± 0.51
120 < a ≤ 160	± 0.60
160 < a ≤ 200	± 0.70
200 < a ≤ 250	± 0.90
250 < a≤ 315	± 1.10
315 < a ≤ 400	± 1.30

#### DIN 16901-130

The tolerances in this standard

**are applicable** to the dimensions of plastic mouldings produced from thermoplastic and thermosetting moulding materials by compression moulding, transfer moulding, compression injection moulding or injection moulding;

**are not applicable** to extrusions, blowmoulded or foamed mouldings, deep drawn parts, sintered parts and parts produced by a chip removal machining process.

#### GENERAL TOLERANCES FOR PRODUCTS MADE OUT FROM SILICONE (ISO 3302-1 CLASS M3)

Dimensions (mm)			(mm)
а	$\leq$	6.3	± 0.40
6.3	< a ≤	10	± 0.50
10	< a ≤	16	± 0.60
16	< a ≤	25	± 0.80
25	< a ≤	40	± 1.00
40	< a ≤	63	± 1.30
63	< a ≤	100	± 1.60
100	< a ≤	160	± 2.00
> 16	0		± 1.3%

#### ISO 3302-1 Class M3

International Standard **ISO 3302-1** was prepared by Technical Committee ISO/ TC 45, Rubber and rubber products, Subcommittee SC 4, Miscellaneous products.

The tolerances are primarily intended for use with vulcanized rubber but may also be suitable for products made of thermoplastic rubbers.



SFS 3947

GENERAL TOLERANCES FOR EXTRUDED PRODUCTS (SFS 3947)					
Dimensions (mm)	(mm)				
0.1 < a ≤ 0.4	± 0.05				
$0.5 < a \le 0.9$	± 0.1				
l < a ≤ 2.9	± 0.2				
3 < a ≤ 5.9	± 0.3				
6 < a ≤ 9.9	± 0.35				
10 < a ≤ 15.9	± 0.45				
16 < a≤ 21.9	± 0.55				
22 < a ≤ 29.9	± 0.7				
30 < a ≤ 49.9	± 0.8				
50 < a ≤ 80	± 1.2				
> 80	± 1.6				



We ask customers to check and fully test the suitability of the fastening and bonding integrity for their product. For example, mechanical stress, humidity, temperature fluctuation, vibration and holes on the surface of the circuit board can weaken the strength of the fastening and bonding. Final testing and verifying of fastening methods, adhesives and their combinations are always the customer's responsibility. Always wear cotton gloves when handling optical parts and their accessories.

# TAPE

LEDiL products supplied with tape use either double-sided foam (polyurethane) or double-sided highperformance acrylic, with an acrylic pressure-sensitive adhesive coating on both sides.

All surfaces where tape is applied must be straight, clean, dry and free from grease and dirt. The taped components should be firmly held for 1-5 seconds to ensure the best possible bond. The tape will reach its final strength in 24-72 hours, depending on the tape, materials and the ambient conditions.

Any chemical used during the installation process may damage both the LED or the lens. Please ensure that all harmful chemicals have been fully removed before applying these components. Optical components should not be cleaned with any chemicals – only a micro fibre cloth should be used for cleaning.

In extreme conditions (heavy or prolonged exposure to high ultraviolet radiation, moisture, temperature changes, constant or sudden vibrations etc.) LEDiL recommends using glue or screws to ensure reliable operation. Alternatively tapes can be used to absorb small vibrations.

#### See specific technical properties from the documents below.

Adhesive tape used in LEDiL optics and assemblies (PU-tape) www.ledil.com/adhesive tape (pu)

Adhesive tape used in LEDiL optics and assemblies (Acrylic) www.ledil.com/adhesive\_tape\_(acrylic)






# **SCREW**

The following is only general information and for more details about tightening and exceptions please download the datasheet for each product.

For most of the products screws are of type M3. (DIN 7985, ISO 7045/ISO 14583 TX), with maximum tightening torque of 0.6 Nm.

Countersunk screws are not allowed, and self-tapping screws are not recommended. Thread forming or rolling screws are not allowed due to lack of control of the tightening torque.


LEDiL recommends using M3 nylon washers (DIN 125 / ISO 7089) between the screws and the lens to minimize stresses induced by fastening torque.



DIN 7985 / ISO 7045 / SFS 2976				
Thread Size	M3			
dk	6 mm			
d	3 mm			
k max	2.52 mm			
L	4-22 mm			

#### Please note:

Differing from other lenses, the **CS14145\_STRADA-IP-2X6-DWC-90** module needs countersunk screws of type M3 (DIN 965) for fastening the PCB to the heatsink.



DIN 965 / ISO 7046 / SFS 2977				
Thread Size	M3			
dk	5.6 mm			
d	3 mm			
k max	1.65 mm			
L	4 – 22 mm			

If the design requires it, it is possible to use ultra-low head cap screws.





# GLUE

Contact your local bonding manufacturer such as DELO® or LOCTITE® for recommended adhesives for your product.



More information about bonding by DELO® www.ledil.com/delo-adhesives

# POTTING

Contact your local bonding manufacturer such as DELO® or LOCTITE® for recommended adhesives for your product.




More information about bonding by DELO® www.ledil.com/delo-adhesives

# PRESS-FIT

Please note that LEDiL's press-fit products are designed to be assembled only once and pins won't withstand unfastening.

Align the pins in the socket with the holes in the reflector feet and press the reflector fully into the socket. Make sure you push the reflector evenly.

LEDiL's press-fit fasteners for the FLORENCE-3R product family are designed for electrical appliances that may, for security or safety reasons, require restricted access. They feature tamper-proof luminaire assembly and class 1 light fitting.

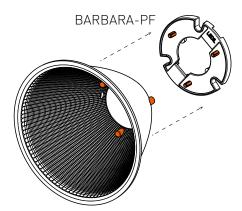

# HOLDER

LEDiL's holders are generally very straightforward and easy to assemble. They can be fastened with either positioning pins, clips or screws. If there is a certain installation requirement, for example in some of the ROSE-lenses, it is mentioned in the corresponding datasheet or application note.

#### LEDiL Disclaimer:

Some holders may allow multiple installations after the optics are removed, but LEDiL does not guarantee this or accept liability in any circumstances where possible malfunctioning or damage to the product, component, individual or property is caused by such actions.



# PROFILES

Some LEDiL lenses are designed to fit existing aluminium profiles like GIZA from Klus for example. (https://klusdesign.com/product/42)

#### Currently supported product families:

- FLORENCE-1R
- FLORENTINA
- ZENIA

#### LEDiL Clips:

Achieve a sleak and uniform luminaire exterior by connecting lenses in continuous rows with LEDiL retaining clips.


Clip A and C for installation on a plate and Clip B for profile installation


- C14353 FLORENCE-1R-CLIP-A for 40 mm wide PCB's (like Philips Fortimo) and screw mount
- C14409 FLORENCE-1R-CLIP-B fits straight into aluminum profile, no screws needed.
- C14751 FLORENCE-1R-CLIP-C for 24 mm wide PCB's and screw mount

# FLORENCE-1R assembly

Place the lens in the aluminium profile and fasten it with the clips. Make sure the whole lens is evened out and that every hole reserved for connectors are hidden inside the profile.


The fastening clips will be installed on both sides of every lens. This allows lenses to be connected in a continuous row to achieve uniform appearance.

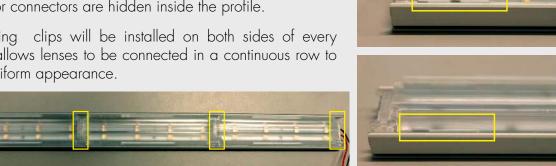

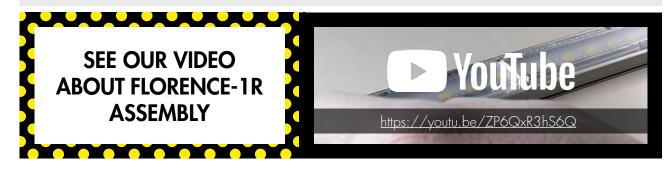



C14353\_FLORENCE-1R-CLIP-A

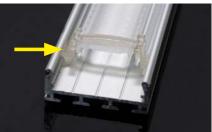

C14409\_FLORENCE-1R-CLIP-B




# PCB DESIGN

Make sure that the LEDs optical center is aligned correctly under the lens, for it may not always be at the centre of the LEDs frame (for example in the Philips Lumileds Rebel series). The recommended tolerance for LED positioning is ±0.1 mm.

Many LEDiL optics have positioning pins that require holes in the PCB. The holes need to be 0.1 mm larger than the pin size with +0.1/-0 mm tolerance limits. The tolerance for the holes location is  $\pm 0.1$  mm. Some LEDiL optics have position pins shaped as + and -. In these cases the + shaped pin needs to have a round hole and the - shaped pin an oblong hole. This leaves more room for thermal expansion.

Some LEDiL products have clips to fasten the optics straight on to the PCB. The little claws that go under the PCB need to have enough empty space reserved for them. Note that the clips can only be used with 1.6 mm thick PCBs. In most cases the PCB needs to be 1.6 mm thick, but in some special cases this may also vary.

Always remember to check the corresponding product datasheet for any special requirements.

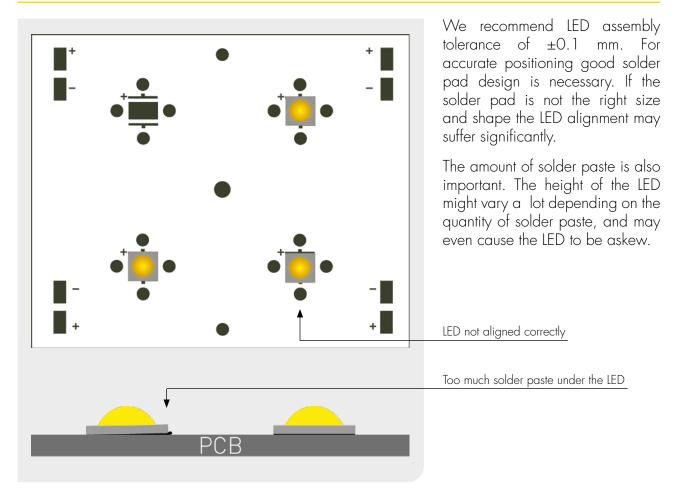


# LED ASSEMBLY



# LED CHIP POSITIONS

Pleae note that due to varying asymmetric chip locations, especially on mid-power LEDs, the exact source of light is not always located at the centre of the LED packet. Take this into account when making or choosing PCB designs.

If maximum uniformity is required LEDiL recommends rotating such LEDs on the PCB in a regular pattern for smoother results.

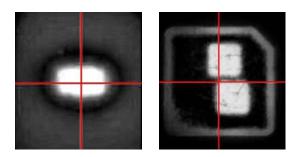

# LED COMPATIBILITY TOLERANCES

For an LED to be mechanically compatible with our lenses there must be 0.2 mm safety distance between the LED and the closest part of he lens design. With products that come with installation tape this safety margin must be 0.3 mm. These numbers come from the fact that the TIM or soldering paste between the LED and the heat sink is approximately 0.1 mm thick, and installation tape requires an additional 0.1 mm for natural shrinkage.

# DISTANCE BETWEEN LENSES

Many LEDiL products have a module based structure and can be installed next to each other without any noticeable shading. Some lenses from the same product family can even be mixed together and used inside the same luminaire.

As a general guideline, we recommend lens distances follow the same pattern as the LED pitches inside one module. Usually the easiest way to calculate position to the next module is between the centre points, rather than using sides or optics.

Please remember to visit our website <u>www.ledil.com</u> to see if there are more recent installation guides or application notes available for individual products.

Silicone seal of IP-2X6 module

2.6

Silicon seal with ribs

# 

# SEALING AND INGRESS PROTECTION OF LEDIL OPTICS


Many LEDiL modules are designed to be sealed against environmental hazards with commonly available potting compounds. Sealant can be applied with a dispenser either manually or with an automated XY-table.

Before adding any sealing compounds, ensure the installation surface, and the optic with its accessories are even.

Modules that have an integrated silicone gasket do not need to be potted. To ensure intended level of ingress protection, please make sure that the silicone gasket is correctly in place before installation.



Only apply potting compound outside the optical areas. STRADA lenses for example are designed with barrier walls to keep the compound out of the lenses.

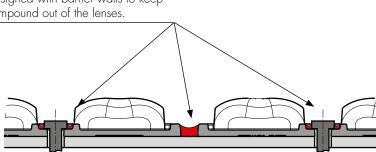

0

1,6mm thick PCB

Note! In order to maintain the desired level of ingress protection, screws with thread-locking fluids should be thoroughly tested in advance for VOC (volatile organic compounds) or stress cracking, and any remaining cutting fluids used in heat sink machining must be carefully removed. Solid thread-locking screws should be used. The temperature and pressure differentials inside and outside the lens can cause seal performance to degrade over time. If more ventilation is needed inside the lens this must be done in such a way as to not compromise the ingress protection. E.g. by using ventilation solutions from 3rd party manufacturers.

IP ratings indicated in LEDiL product specifications are based on IEC 60598-1:2014 ed. 8.0 and are conducted internally. The final IP rating is subject to design and surface finish of luminaire parts and must be individually tested.




When working with LED lighting one important issue to take into consideration is heat. Good thermal design plays a key role in the performance and lifetime of the application. There are three different ways for heat to transfer: conduction, convection and radiation. Always make sure that the thermal management is sufficient enough for the application.

**Conduction** is the transfer of heat through solid materials with direct contact. For example the heat from an LED junction to the heat sink is transferred by conduction.

**Convection** is the transfer of heat through the movement of gases or fluids. A typical example in LED applications is the heat transferred from heat sink to air.

**Radiation** is the transfer of thermal energy by electromagnetic radiation. This radiation causes thermal motion of charged particles in matter. In LED applications transfer through radiation is found in the light itself. This is extremely important to remember since LEDs keep getting more and more powerful.

The best choice of optic is not always the material that can handle more heat, because some materials absorb more radiant flux than others. This basically means that an optics efficiency is directly linked to how hot the lens will get.

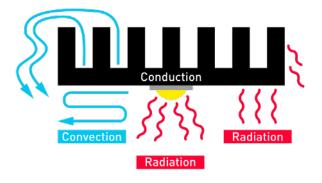





# HEAT SINK MACHINING

All heat sink machining needs to be done before lens assembly. Some lenses need holes for wires and for fastening. For example LEDiL's STRADA-IP-2X6 products need to be fastened to the heat sink with screws. After cable holes and threaded screw holes are machined, ensure that the anodized heat sink surface is even. Screw thread hole accuracy is  $\pm 0.1$  mm. Vertical straightness tolerance for screws is  $\pm 10.1$  mm A. Please be sure to remove all aluminum particles from the holes and the heat sink surface.

# THERMAL INTERFACE MATERIALS

For good heat transfer, a thermal interface material must be used between the heat sink and the PCB/ COB LED. This material can be thermal pad, thermal glue, thermal paste, phase change material or double-sided thermal tape. The material choice depends on the situation and power used by the application. The thermal resistance of the thermal interface depends on the thermal conductivity of the material, material thickness, area and the pressure applied to the interface. We recommend using a thin layer of thermal interface material to minimize thermal resistance.

It is always the customer's responsibility to ensure reliable and sufficient cooling and heat transfer between all luminaire components. If a sufficient amount of pressure on the heat sink cannot be maintained over time we recommended using either thermal glue and/or screws for the PCB/LED fastening.

While using thermal interface materials, remember that the material needs to be chemically compatible with the LEDs. Bad material choice might significantly reduce the LEDs lifetime. For example Cree has created a test method for chemical compatibility. More information about the test can be found on Cree's web page.



# THERMAL MEASUREMENTS

Infrared (IR) imaging and thermocouple measurement systems can be used for monitoring temperatures in LED applications, but the following must be acknowledged.

- IR imaging is a preferred method for lens and reflector temperature measurements
- Low emissivity surfaces are challenging to measure with an IR camera because reflected temperatures can also be seen in thermal image (1)
- Thermocouples cannot be placed on top of a lens due to the absorption of the radiant flux (2)
- Tiny thermocouples (AWG 40 recommended) can be used to measure LED case, PCB and heat sink temperatures where radiant flux doesn't interfere, and target surfaces cannot be exposed to the IR camera



#### LENSES

Switch on the light and let temperatures rise until they stabilize. Remove any obstacles (e.g. glass cover) quickly to expose the target surface and take an image on the top surface of the lens. Start to record video sequence and turn the lens over quickly to catch the maximum temperature from the bottom side of the lens.

#### REFLECTORS

Attach a thermocouple on the surface of the reflector with a small aluminum tape and monitor temperatures until they stabilize **(3)**. Paint the target area, attach a tape with known emissivity or remove metallization on the outer surface of the reflector and take an IR image from that area **(4)**.

#### COB LEDs

LED case temperature, Tc, can be measured with a thermocouple that is firmly glued/soldered to the Tc measurement point of the LED module **(5)**.





# METAL COATING

Different materials and coatings used by LEDiL have to undergo numerous tests before being accepted. All the materials and coatings must be permanent, durable and show no signs of peeling, fingerprints, cracks, black spots, scratches, smudging or discoloration.

We always heat test beyond our recommended limits to fully ensure our products quality. For more extreme environments some materials have been tested with diluted NaOH liquid and in an artificially created salt mist. These surfaces should be completely undamaged to pass.


Both the HMDS and lacquer layer increase aluminium coating durability, but the reflector must be protected from water and other hazards. Weather exposure tests must be carried out during the design process.



# VACUUM EVAPORATION PVD

LEDiL uses vacuum evaporation PVD (Physical Vapor Deposition) to add a reflective aluminum coating to PC reflectors. Before aluminum can be added, adhesion between the reflectors and the aluminum coating must be improved. This is conventionally done by adding a layer of lacquer to the reflector surfaces.


- High quality both functionally and decoratively
- Reflectors will not be subject to chemical of thermal stress
- Good performance in cross-cut test
- 1) Top lacquer (to protect surface)
- 2) Al coat (in vacuum)
- 3) Base lacquer (to improve adhesion)
- 4) Substrate (part to be coated)

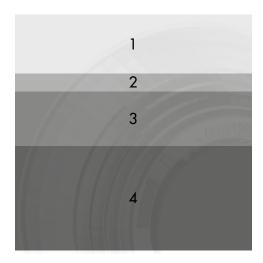

# HMDS

HMDS is a simplified name for a glow polymerization method. Plasma treatment is first used to clean the reflector surfaces of any unfavorable materials to improve adhesion. Then the aluminum coating is added via vacuum evaporation and finally HMDS-monomers are added and a polymerization reaction takes place.

- Thin and protective layer
- Good optical performance
- Good durability against heat
- 1) HMDS plasmapolymerisation (to protect surface)
- 2) Al coat (in vacuum)
- 3) Glow discharge activation of surface (to improve adhesion)
- 4) Substrate (part to be coated)

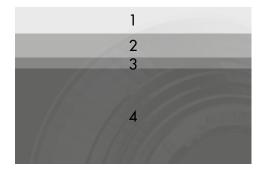



# STORAGE

To maintain long-term product quality under storage, please ensure that the environment is kept at normal room temperature without too much humidity and that the products are kept in their original packaging.

# LINKS TO USEFUL INFORMATION:



Follow LEDiL in social media:

