
Email: sales@linengineering.com | techsupport@linengineering.com

www.linengineering.com


### **MOTOR SPECIFICATIONS**




## **DIMENSIONS**

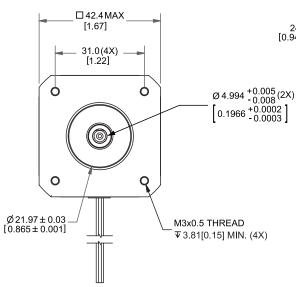

#### Part Number WO-4118S-04P Step Angle 1.8° Frame Size NEMA 17 Body Length (Dim. A) 1.34 in (34 mm) Current 1.34 Amps/Phase Holding Torque 42 oz-in (0.3 Nm) 2.5 Ohms/Phase Resistance Rotor Inertia 0.18 oz-in<sup>2</sup> 4 Number of Leads Connection Parallel Weight 0.4 lbs (0.18 kg)

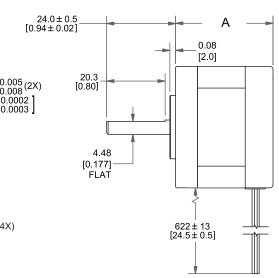

## **PERFORMANCE CURVE**

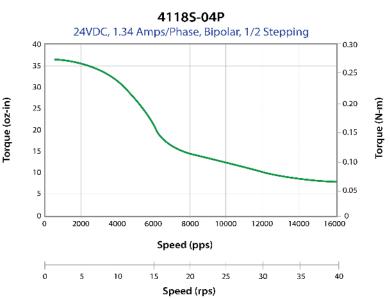

#### **OPERATING SPECIFICATIONS**

Radial Play	0.001" max @ 1 lbs load
End Play	0.003" max @ 2 lbs load
Shaft Run Out	0.002" TIR
Concentricity of Mounting Pilot to Shaft	0.003" TIR
Perpendicularity of Shaft to Mounting Face	0.003" TIR
Max Axial Load	6 lbs
Maximum Case Temperature	80 C
Ambient Temperature	-20° to 50° C
Storage Temperature	-20° to 100° C
Humidity Range	85% or less, non-condensing
Magnet Wire Insulation	Class B 130° C
Insulation Resistance	100MΩ at 500 VDC
Dielectric Strength	500 VAC for 1 minute

#### **WIRING TABLE**

COLOR	FUNCTION
Red	A+ Phase
Blue	A- Phase
Green	B + Phase
Black	B- Phase

## **OPERATION & USAGE TIPS**



Do not disassemble motors; a significant reduction in motor performance will occur.



Do not machine shafts; this will have a negative effect on shaft run out and perpendicularity.



Do not disconnect motor from drive while in operation.



Do not use holding torque/detent torque of motor as a fail safe brake.



Do not hold motor by lead wires.



Do not exceed the rated current; this will burn the motor.

FAILURE TO COMPLY WITH THESE RECOMMENDATIONS WILL VOID ALL WARRANTY TERMS

## **RECOMMENDED**



Microstepping Driver R208



Single Axis Controller + Driver R256-RO

# Motion Control, Solved.

**MOTOR ENGINEERING & MANUFACTURING** 







Small Batch to OEM Volume Production

