

The Frontline SD Protocol Analyzer includes powerful Frontline software and the SD/SDIO/SPI/ MMC hardware interface.

Key Features and Benefits

- Data You Can Trust
 Non-intrusive in-line capture
 and analysis provides
 uncontaminated views of the
 data you need
- Current and Compatible Support for 1 bit, 4-bit, and SPI modes makes sure you're compatible with current SD, SDIO and MMC specifications
- Compact unit delivers big features to developers of SD, SDIO, SPI and MMC technologies, in the field or at the bench
- Comprehensive Protocol
 Analysis

Can be used in conjunction with other Frontline devices for interoperability analysis over multiple bus types

Faster to Market Reduces debug time with simultaneous live capture, display, decode, filtering and detection of protocol errors



SD 2.0 PROTOCOL ANALYZER

frontline

The Frontline[®] SD 2.0 Protocol Analyzer allows developers and engineers to thoroughly analyze SD, SDIO, MMC and SPI communications, as well as *Bluetooth*[®] data carried over the SDIO physical layer, by simultaneously capturing, decoding, displaying, filtering, and detecting errors - *all live*.

Powered by USB, this small form-factor analyzer provides non-intrusive analysis without any compromises; the Frontline SD comes loaded with support for SPI and MMC specification, and captures data at High-Speed 480 Mbps - it's the ideal field or bench tool for developers of SD/SDIO/MMC-equipped devices or *Bluetooth* devices that use SDIO technology.

Big Window into a Small Format

The Frontline SD provides developers and engineers with one compact and portable point of access to multiple bus types, including SD, SDIO, MMC and SPI, and supports 1 and 4-bit modes ensuring compatibility with current specifications. Not only does the device provide a non-intrusive window into native-format bus performance and command and response tokens, but also allows *Bluetooth* developers to capture *Bluetooth* data as it's transported over the SDIO bus.

Once captured, data can be viewed, debugged and target-searched for errors with the powerful and mature Frontline software. The Frontline SD can significantly reduce the time you spend debugging SD/SDIO device protocol and timing issues, and help to bring your SD, SDIO, MMC, SPI or *Bluetooth* product to market faster.

Summary Pane displays a one line overview of each data frame/message. Click on any line to reveal detail in mutiple panes below.

1,037: (Controller) Len=18 SPI: ime Header Msg Size: 6	Unfiltered SDI0/SPI SD		0000	Find:		• 🖌	🛿 🔎 Summary: 🛛 SDIO/
• Msg Type: Card Resp R1b rd Resp R1b	B Frame#	Msg Size	Msg Type	Cmd #	Fram	Delta	Timestamp
- Start Bit: 0	1,029	4	Card Interrupt		16	00:00:00.000900	9/20/2012 3:23:12 759300 PI
Transmission Bit: Card	1.030	4	Card Interrupt		16	00.00.00.000000	9/20/2012 3:23:12.759300 PI
Cmd: 12 (STOP_TRANSMISSION)	1,031	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12 759300 P
Card Status: 0x00000b00	1.032	à	Card Interrupt		16	00.00.00.000000	9/20/2012 3:23:12.759300 PI
OUT_OF_RANGE: No Error	1,033	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12.759300 PI
ADDRESS_ERROR: No Error	1.034	4	Card Interrupt		16	00:00:00.000100	9/20/2012 3:23:12.759400 PI
BLOCK_LEN_ERROR: No Error ERASE_SEQ_ERROR: No Error	1,035	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12:759400 PI
ERASE_SEU_ERHUR: No Error ERASE_PARAM: No Error	1.036	6	Host Cmd	12	18	00:00:00.000100	9/20/2012 3:23:12.759500 PI
	1,037	6	Card Resp R1b	12	18	00:00:00.000000	9/20/2012 3:23:12.759500 PI
- CARD_IS_LOCKED: card unlocked	1,038	6	Host Cmd	18	18	00:00:00.000100	9/20/2012 3:23:12,759600 PI
- LOCK UNLOCK FAILED: No Error	1.039	6	Card Resp R1	10	18	00:00:00.000000	9/20/2012 3:23:12.759600 PI
- COM CRC ERROR: No Error	1.040	a a	Card Interrupt		16	00:00:00.000900	9/20/2012 3:23:12,760500 PI
ILLEGAL COMMAND: No Error	1,041	4	Card Interrupt		16	00:00:00.000000 /	9/20/2012 3:23:12.760500 Pl
- CARD_ECC_FAILED: success	1.042	6	Host Cmd	12	18	00:00:00.000000	9/20/2012 3:23:12.760500 P
CC_ERROR: No Error	1.043	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12.760500 P
- ERROR: No Error	1.044	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12,760500 P
- CSD_OVERWRITE: No Error	1,045	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12.760500 P
WP_ERASE_SKIP: Not Protected	1.046	4	Card Interrupt		16	00:00:00.000000	9/20/2012 3:23:12.760500 P
- CARD_ECC_DISABLED: No Error	1.047	4	Card Interrupt		16	00.00.00.000000	9/20/2012 3:23:12.760500 P
- ERASE_RESET_Cleared CURRENT_STATE: data			8		m		
- READY_FOR_DATA: ready	B000001			0000		00000 0000	0101 00000000
- APP_CMD: Disabled	N0000000			1100		00000 0000	
- AKE_SEQ_ERROR: No Error	R0000110			0000		01011 0000	
CRC: 0x3f	YUUUUU			0000	000	01011 0000	0000 01111111
End Bit 1	P						
	<u>Si</u>						
	R06 00 (0 0 0 0	5 00 00 0	0 0 c	0 0	00 00 0c 0	0 00 <mark>0</mark> b 00 7f
	D		•				
	x						
	PA						
	N						
	15						
s: 1,091 Frames Filtered In: 1,091 Frame	e #s Selected: 1.037:	(1 total) [1 byte:	sl				

Decode Pane shows comprehensive layered decoders of each frame/message with clear, concise descriptions.

Logical Data Pane shows data in bindary, hex and character formats.

Specifications

Dimensions:

• 89mm x 51mm x 127mm

Supported Specifications:

- SD Specification v2.0, Part 1 & 2
- Security commands, SD specification
- v2.0, Part 3
- SDIO v2.0
- MMC v3.3

Transfer Modes:

- 1-bit
- 4-bit
- SPI

Signals:

- CMD
- DATA0
- DATA1
- DATA2
- DATA3

Timestamp:

100 μs

Clock Rate

• Up to 50 MHz

Operating voltages:

- 1.8V
- 3.3V

Data Decoded:

- SPI
- SD/SDIO
- Bluetooth

Power Supply:

- USB Bus powered
- Supports "Automation" feature to remotely control ComProbe software and bypass Microsoft Windows UI
- Displays clock frequency
- Debug SD/SDIO device protocol and timing issues
- Non-intrusive capture and analysis
- Use with both standard SD form factor connection and embedded applications
- Comes with Micro SD card adapter, compatible with cell phones
- Single-click export
- Packets with protocol violations are flagged in red
- Data captured to PC hard disk
- Session notes and annotated bookmarks allow for quick identification of questionable packets
- Portable main unit size (mm) is 89 x 51 x 127

The Frontline SD Hardware Interface

The Frontline SD 2.0 Protocol Analyzer includes the portable and robust SD/SDIO/SPI/MMC hardware interface, which supports connectivity to SD, SDIO, SPI and MMC-equipped devices. In addition to the standard SD card adapter, a micro SD card adapter is included for sniffing communications between micro SD cards and cell phones.

The SD/SDIO/SPI/MMC interface is one member of an extensive arsenal of technology-specific hardware interfaces, all functioning with the powerful Frontline software. This modular


approach allows greater flexibility in protocol analysis and debugging, and provides comprehensive coexistence views over virtually any combination of protocols.

Supported Configurations

- OS Supported: Windows 7, 8 and 10
- USB Port: USB 2.0 or USB 3.0 High-Speed

Minimum System Requirements

- Processor: Core i5 at 2.7 GHz or faster
- 4 GB of RAM
- 20 GB free disk space

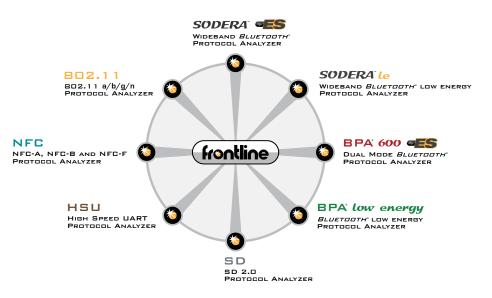

The Frontline Modular Approach

Frontline software is at the core of Frontline protocol analysis, allowing technologyspecific hardware interfaces to work individually or in combination with other hardware interfaces. This modular approach gives the developer or analyst the widest possible range of scenarios for debugging complex communications.

To order or for more information:

www.fte.com frontline_onlinesales@teledyne.com 1.800.359.8570 US & Canada +1.434.984.4500 Fax: 434.984.4505



© Copyright 2017. All rights reserved. BPA, Sodera and the Frontline logo are trademarks and Frontline is registered trademark. The Bluetooth word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. and any use of such marks is under license. Other trademarks and trade names are those of their respective owners.