


Pressure 3 click

From MikroElektronika Documentation

Pressure 3 click carries an Infineon DPS310 digital barometric pressure sensor.

Features and usage notes

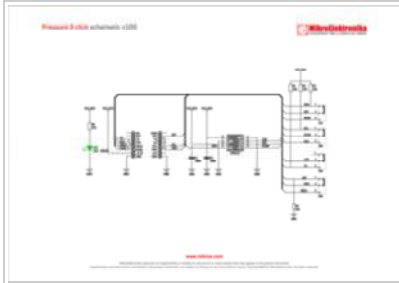

Schematic also available in PDF (http://cdn-docs.mikroe.com/images/9/9c/Pressure_3_click_sche

Pressure 3 click has an operating range from 300 to 1200 hPa with a relative accuracy of 0.06 hPa and absolute accuracy of 1 hPa. DPS310 is a fast sensor with typical measurement time of 27.6 ms for standard mode, down to 3.6 ms in low precision mode.

DPS310 integrates a FIFO (First In First Out) buffer that can store the last 32 measurements. Using the buffer saves power because the target MCU doesn't have to constantly poll for resources.

The sensor is calibrated. Calibration coefficients are used to compensate the measurement results. The data sheet contains detailed instructions on how to convert compensated results to pressure and


temperature values.

The digital measurements are in 24-bit resolution.

Pressure 3 click has both I2C and SPI outputs. The four interface configuration buttons are soldered to mikroBUSTM I2C pins by default. Additionally, there is an Interrupt pin that can be triggered whenever a new measurement is available or if a FIFO buffer is full.

The click uses a 3.3V power supply.

Pressure 3 click

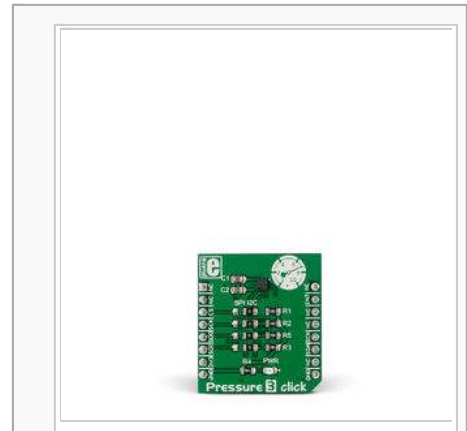

Pressure 3 click

IC/Module	Microchip Infineon DPS310 (http://www.infineon.com/dgdl/Infineon-DPS310+Pressure+Sensor-PB-v01_00-EN.pdf?fileId=5546d462525dbac40152b0a05ad74d56)
Interface	SPI, I2C, INT
Power supply	3.3V
Website	www.mikroe.com/click/pressure-3 (http://www.mikroe.com/click/pressure-3)

Programming

This snippet initializes all necessary pins and functions for using Pressure 3 Click, and performs a test by writing test values to the click, and then reading them back to the user through UART communication.

```

1 void main() {
2
3   Display_Init();
4   I2C1_Init_Advanced(400000, &_GPIO_MODULE_I2C1_PB67);
5   delay_ms(300);
6   Pressure_3_hal_init(0x76, MODE_I2C);
7
8   Set_Status(0x07);
9
10  while (1)
11  {
12     pressure3_calculate_coefficients();
13     calculate_temperature_pressure();
14
15     FloatToStr(Pressure, txt);
16     FloatToStr(Temperature, txt1);
17     TFT_Set_Font(TFT_defaultFont, CL_WHITE, FO_HORIZONTAL);
18     TFT_Write_Text("Pressure:", 30, 70);
19     TFT_Write_Text(txt, 100, 70);
20     TFT_Write_Text("Temperature:", 30, 100);
21     TFT_Write_Text(txt1, 120, 100);
22     Delay_ms(500);
23     TFT_Set_Font(TFT_defaultFont, CL_TEAL, FO_HORIZONTAL);
24
25     TFT_Write_Text("Pressure:", 30, 70);
26     TFT_Write_Text(txt, 100, 70);
27     TFT_Write_Text("Temperature:", 30, 100);
28     TFT_Write_Text(txt1, 120, 100);
29  }
30 }

```

Code examples that demonstrate the usage of Pressure 3 click with MikroElektronika hardware, written for mikroC for ARM, AVR, dsPIC, FT90x, PIC and PIC32 are available on Libstock (<http://libstock.mikroe.com/projects/view/1897/pressure-3-click-example>).

Resources

- data sheet (http://www.infineon.com/dgdl/Infineon-DPS310+Pressure+Sensor-PB-v01_00-EN.pdf?fileId=5546d462525dbac40152b0a05ad74d56)

- Pressure 3 click examples on Libstock (<http://libstock.mikroe.com/projects/view/1897/pressure-3-click-example>)
- mikroBUS standard specifications (<http://download.mikroe.com/documents/standards/mikrobus/mikrobus-standard-specification-v200.pdf>)