
Email: sales@linengineering.com | techsupport@linengineering.com


www.linengineering.com

MOTOR SPECIFICATIONS



DIMENSIONS

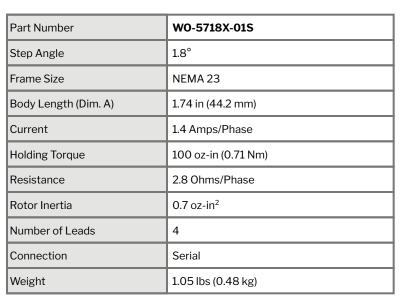

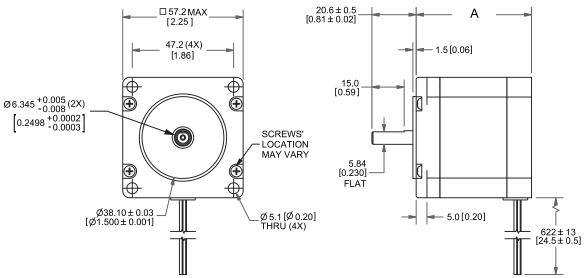

PERFORMANCE CURVE

5718X-01S 24VDC, 1.4 Amps/Phase, Bipolar, 1/2 Stepping 0.6 80 0,5 70 60 0.4 Torque (N-m) 50 40 30 0.2 20 0.1 10 3000 6000 Speed (pps) 8 10 12 16 Speed (rps)

OPERATING SPECIFICATIONS

Radial Play	0.001" max @ 1 lbs load
End Play	0.003" max @ 2 lbs load
Shaft Run Out	0.002" TIR
Concentricity of Mounting Pilot to Shaft	0.003" TIR
Perpendicularity of Shaft to Mounting Face	0.003" TIR
Max Axial Load	13 lbs
Maximum Case Temperature	80 C
Ambient Temperature	-20° to 50° C
Storage Temperature	-20° to 100° C
Humidity Range	85% or less, non-condensing
Magnet Wire Insulation	Class B 130° C
Insulation Resistance	100MΩ at 500 VDC
Dielectric Strength	500 VAC for 1 minute

WIRING TABLE

COLOR	FUNCTION
Red	A+ Phase
Blue	A- Phase
Green	B + Phase
Black	B- Phase

OPERATION & USAGE TIPS



Do not disassemble motors; a significant reduction in motor performance will occur.



Do not machine shafts; this will have a negative effect on shaft run out and perpendicularity.



Do not disconnect motor from drive while in operation.



Do not use holding torque/detent torque of motor as a fail safe brake.



Do not hold motor by lead wires.



rated current; this will burn the motor.

FAILURE TO COMPLY WITH THESE RECOMMENDATIONS WILL VOID ALL WARRANTY TERMS

RECOMMENDED



Single Axis Driver R325P



Single Axis Controller+Driver **R356**

Motion Control, Solved.

MOTOR ENGINEERING & MANUFACTURING







Small Batch to OEM Volume Production

