



MICROCHIP

**High-Frequency Clock Source
Evaluation Board
User's Guide**

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOC® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
= ISO/TS 16949 =**

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, dsPIC, FlashFlex, flexPWR, Heldo, JukeBlox, KeeLoq, KeeLoq logo, Klear, LANCheck, LINK MD, MediaLB, MOST, MOST logo, MPLAB, OptoLyzer, PIC, PICSTART, PIC32 logo, RightTouch, SpyNIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, ETHERSYNCH, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and QUIET-WIRE are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PureSilicon, RightTouch logo, REAL ICE, Ripple Blocker, Serial Quad I/O, SQL, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademarks of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2016, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-0646-4

Object of Declaration: High-Frequency Clock Source Evaluation Board

EU Declaration of Conformity

Manufacturer: Microchip Technology Inc.
2355 W. Chandler Blvd.
Chandler, Arizona, 85224-6199
USA

This declaration of conformity is issued by the manufacturer.

The development/evaluation tool is designed to be used for research and development in a laboratory environment. This development/evaluation tool is not a Finished Appliance, nor is it intended for incorporation into Finished Appliances that are made commercially available as single functional units to end users under EU EMC Directive 2004/108/EC and as supported by the European Commission's Guide for the EMC Directive 2004/108/EC (8th February 2010).

This development/evaluation tool complies with EU RoHS2 Directive 2011/65/EU.

This development/evaluation tool, when incorporating wireless and radio-telecom functionality, is in compliance with the essential requirement and other relevant provisions of the R&TTE Directive 1999/5/EC and the FCC rules as stated in the declaration of conformity provided in the module datasheet and the module product page available at www.microchip.com.

For information regarding the exclusive, limited warranties applicable to Microchip products, please see Microchip's standard terms and conditions of sale, which are printed on our sales documentation and available at www.microchip.com.

Signed for and on behalf of Microchip Technology Inc. at Chandler, Arizona, USA


Derek Carlson
VP Development Tools

12-Sep-14
Date



HIGH-FREQUENCY CLOCK SOURCE EVALUATION BOARD USER'S GUIDE

Table of Contents

Preface	5
Introduction.....	5
Document Layout	5
Conventions Used in this Guide	6
Recommended Reading.....	7
The Microchip Website.....	7
Customer Support	7
Document Revision History	7
Chapter 1. Quick Start Instruction	
1.1 Description	8
1.2 Supply Voltage Setup	10
1.3 Oscillator Phase Noise	11
Appendix A. Schematics and Layouts	
A.1 Introduction	13
A.2 Board – Schematic	14
A.3 Board – Top Silk	15
A.4 Board – Top Copper and Silk	15
A.5 Board – Top Copper	16
A.6 Board – Bottom Copper	16
A.7 Board – Bottom Copper and Silk	17
A.8 Board – Bottom Silk	17
A.9 Board – Schematic	18
A.10 Board – Top Silk	19
A.11 Board – Top Copper and Silk	19
A.12 Board – Top Copper	20
A.13 Board – Bottom Copper	20
A.14 Board – Bottom Copper and Silk	21
A.15 Board – Bottom Silk	21
Appendix B. Bill of Materials (BOM)	22
Worldwide Sales and Service	24



HIGH-FREQUENCY CLOCK SOURCE EVALUATION BOARD USER'S GUIDE

Preface

NOTICE TO CUSTOMERS

All documentation becomes dated, and this manual is no exception. Microchip tools and documentation are constantly evolving to meet customer needs, so some actual dialogs and/or tool descriptions may differ from those in this document. Please refer to our website (www.microchip.com) to obtain the latest documentation available.

Documents are identified with a “DS” number. This number is located on the bottom of each page, in front of the page number. The numbering convention for the DS number is “DSXXXXXXXXA”, where “XXXXXXXX” is the document number and “A” is the revision level of the document.

For the most up-to-date information on development tools, see the MPLAB® IDE online help. Select the Help menu, and then Topics to open a list of available online help files.

INTRODUCTION

This chapter contains general information that will be useful to know before using the High-Frequency Clock Source Evaluation Board. Items discussed in this chapter include:

- Document Layout
- Conventions Used in this Guide
- Recommended Reading
- The Microchip Website
- Customer Support
- Document Revision History

DOCUMENT LAYOUT

This document describes how to use the High-Frequency Clock Source Evaluation Board. The manual layout is as follows:

- **Chapter 1. “Quick Start Instruction”** – Important information about the High-Frequency Clock Source Evaluation Board.
- **Appendix A. “Schematics and Layouts”** – Shows the schematic and layout diagrams.
- **Appendix B. “Bill of Materials (BOM)”** – Lists the parts used to build the High-Frequency Clock Source Evaluation Board.

CONVENTIONS USED IN THIS GUIDE

This manual uses the following documentation conventions:

DOCUMENTATION CONVENTIONS

Description	Represents	Examples
Arial font:		
Italic characters	Referenced books	<i>MPLAB[®] IDE User's Guide</i>
	Emphasized text	...is the <i>only</i> compiler...
Initial caps	A window	the Output window
	A dialog	the Settings dialog
	A menu selection	select Enable Programmer
Quotes	A field name in a window or dialog	"Save project before build"
Underlined, Italic text with right angle bracket	A menu path	<u><i>File>Save</i></u>
Bold characters	A dialog button	Click OK
	A tab	Click the Power tab
N'Rnnnn	A number in verilog format, where N is the total number of digits, R is the radix and n is a digit.	4'b0010, 2'hF1
Text in angle brackets < >	A key on the keyboard	Press <Enter>, <F1>
Courier New font:		
Plain Courier New	Sample source code	#define START
	Filenames	autoexec.bat
	File paths	c:\mcc18\h
	Keywords	_asm, _endasm, static
	Command-line options	-Opa+, -Opa-
	Bit values	0, 1
	Constants	0xFF, 'A'
Italic Courier New	A variable argument	<i>file.o</i> , where <i>file</i> can be any valid filename
Square brackets []	Optional arguments	mcc18 [options] <i>file</i> [options]
Curly brackets and pipe character: { }	Choice of mutually exclusive arguments; an OR selection	errorlevel {0 1}
Ellipses...	Replaces repeated text	var_name [, var_name...]
	Represents code supplied by user	void main (void) { ... }

RECOMMENDED READING

This user's guide describes how to use the High-Frequency Clock Source Evaluation Board. Other useful documents are listed below. The following Microchip documents are available and recommended as supplemental reference resources.

- **MXT573ABC200M000 Data Sheet – “ ± 2.5 ppm Stability 200 MHz LVCMOSTCXO”** (Available using the ClockWorks[®] Configurator software available on the device product page)
- **MCP37231-200 Data Sheet – “200 Msps, 16-/14-Bit Low-Power ADC with 8-Channel MUX”** (DS20005322)

THE MICROCHIP WEBSITE

Microchip provides online support via our website at www.microchip.com. This website is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the website contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or field application engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the website at:
<http://www.microchip.com/support>.

DOCUMENT REVISION HISTORY

Revision A (May 2016)

- Initial Release of this Document.

Chapter 1. Quick Start Instruction

1.1 DESCRIPTION

The High-Frequency Clock Source Evaluation Board is an easy-to-use, high-frequency clock source. It contains a low-noise crystal-oscillator (TCXO, single-ended output). The oscillator requires a 3.3V supply voltage. The output is available at the SMA connector through a bandpass filter (ADM00725) or without the filter (ADM00724).

The evaluation board is initially developed for a clock source of the Microchip Technology's High Speed ADC Evaluation Boards for the MCP37XXX family devices. However, its application can expand into RF and other mixed signal applications as well, where a low noise clock is needed.

[Table 1-1](#) shows the summary of the boards that are currently available from Microchip Technology. [Figure 1-1](#) shows the photos of the boards.


TABLE 1-1: HIGH FREQUENCY CLOCK SOURCE EVALUATION BOARDS (Note 1)

Evaluation Board Part Number	Crystal Oscillator Part Number	Output Frequency	Output Filter	Descriptions
ADM00724	MXT573ABC200M000	200 MHz	Not Included	200 MHz clock source
ADM00725		200 MHz	Included	200 MHz clock source with bandpass filter (Note 2)


Note 1: Contact Microchip Technology for the availability of released evaluation boards for other frequency bands.

2: Clock source with a filter (ADM00725) is highly recommended for the applications where lower harmonic distortion is needed.

Quick Start Instruction

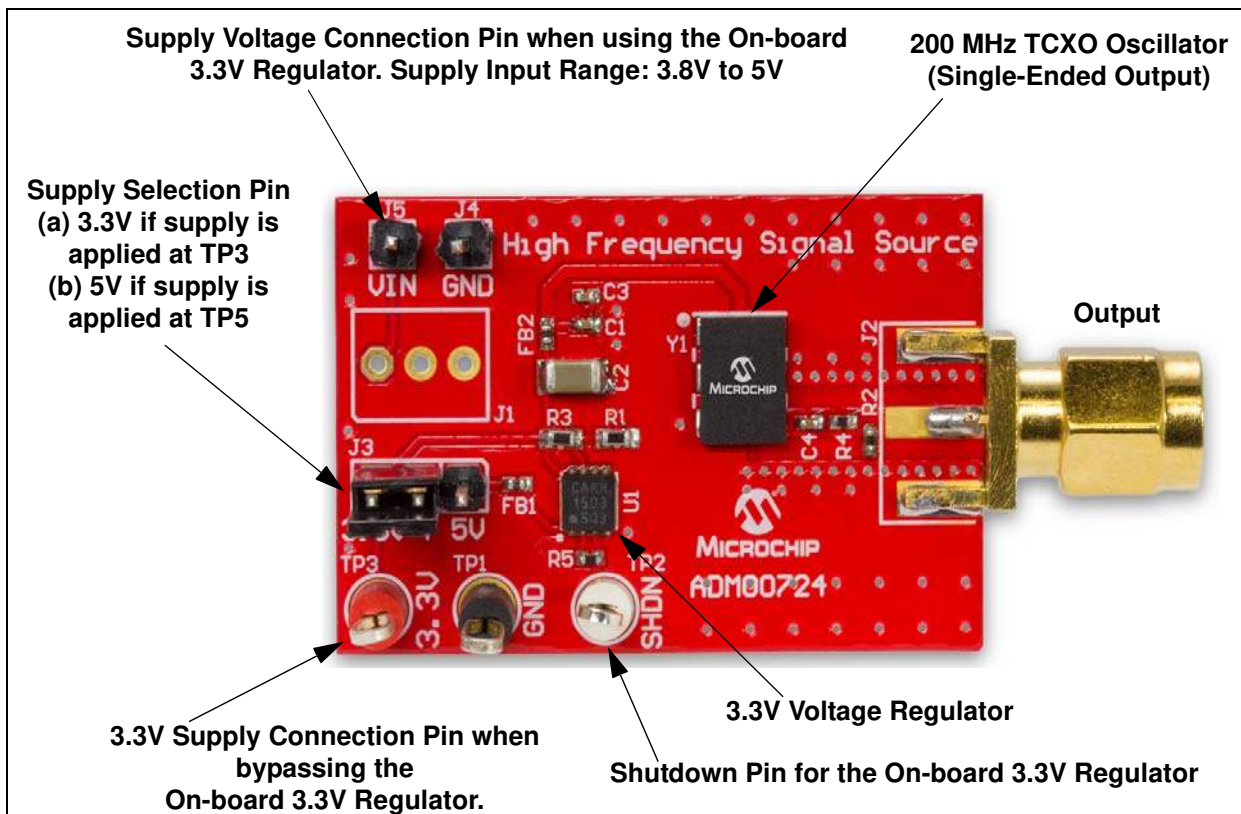

(a) ADM00724: 200 MHz Signal Source Evaluation Board

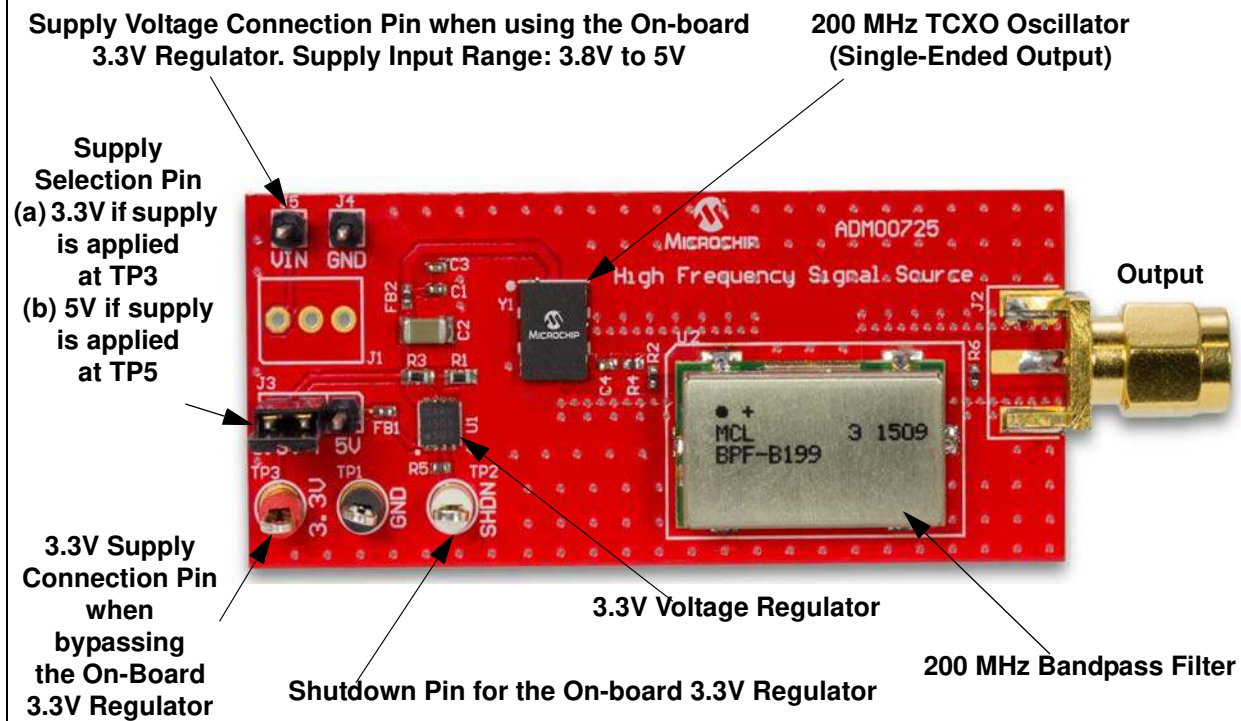

(b) ADM00725: 200 MHz Signal Source Evaluation Board with Bandpass Filter

FIGURE 1-1: High-Frequency Signal Source Evaluation Boards.

1.2 SUPPLY VOLTAGE SETUP

Figure 1-2 shows the block diagram of the evaluation board.

Applying Supply Voltage

The oscillator requires a 3.3V supply voltage. The board includes a 3.3V regulator. The supply voltage applied to the V_{IN} pin (J5) is connected to the input pin of the regulator. Note that the user can provide an exact 3.3V supply at TP3 instead of using the on-board regulator.

Supply Voltage Option

One of the following two choices can be used.

1. When using on-board 3.3V regulator:
 - Provide 3.8V to 5V supply at J5 pin (Positive) and J4 pin (Negative).
 - Connect J3 Jumper to 5V
2. When providing 3.3V supply without using the on-board 3.3V regulator:
 - Provide 3.3V supply at TP3 (Positive) and GND pin.
 - Connect J3 Jumper to 3.3V

Once the supply voltage is applied, a clean 200 MHz LVCMOS output is available at the SMA connector. The output impedance is controlled for 50Ω.

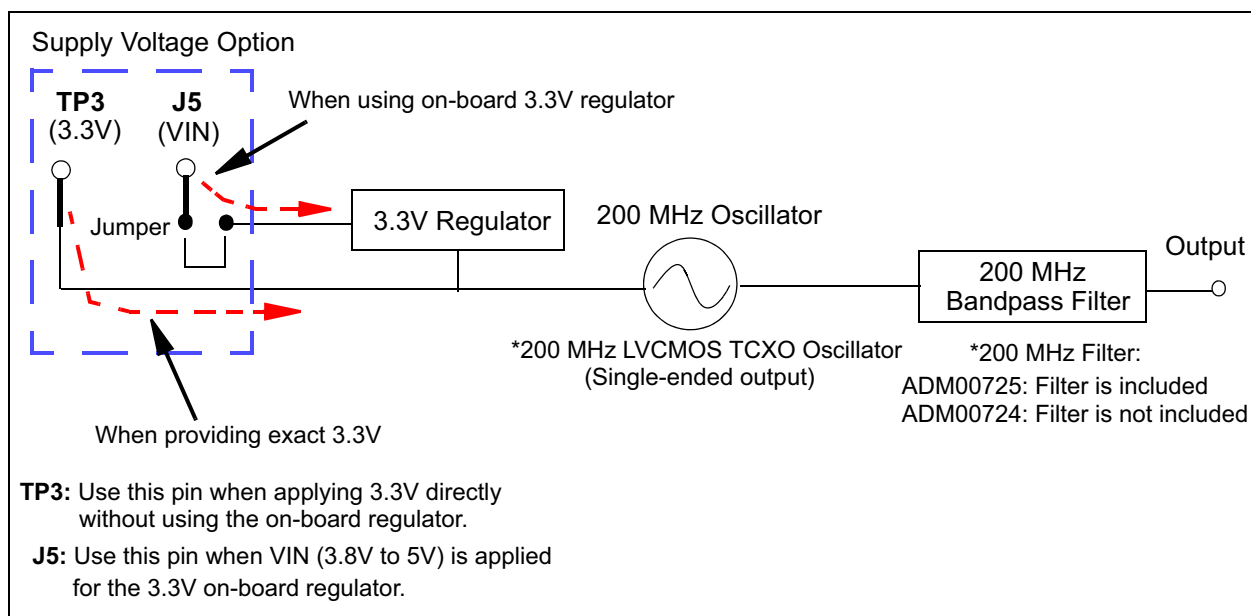


FIGURE 1-2: Evaluation Board Block Diagram.

1.3 OSCILLATOR PHASE NOISE

Figure 1-3 shows the oscillator phase noise plots for the ADM00724 and ADM00725.

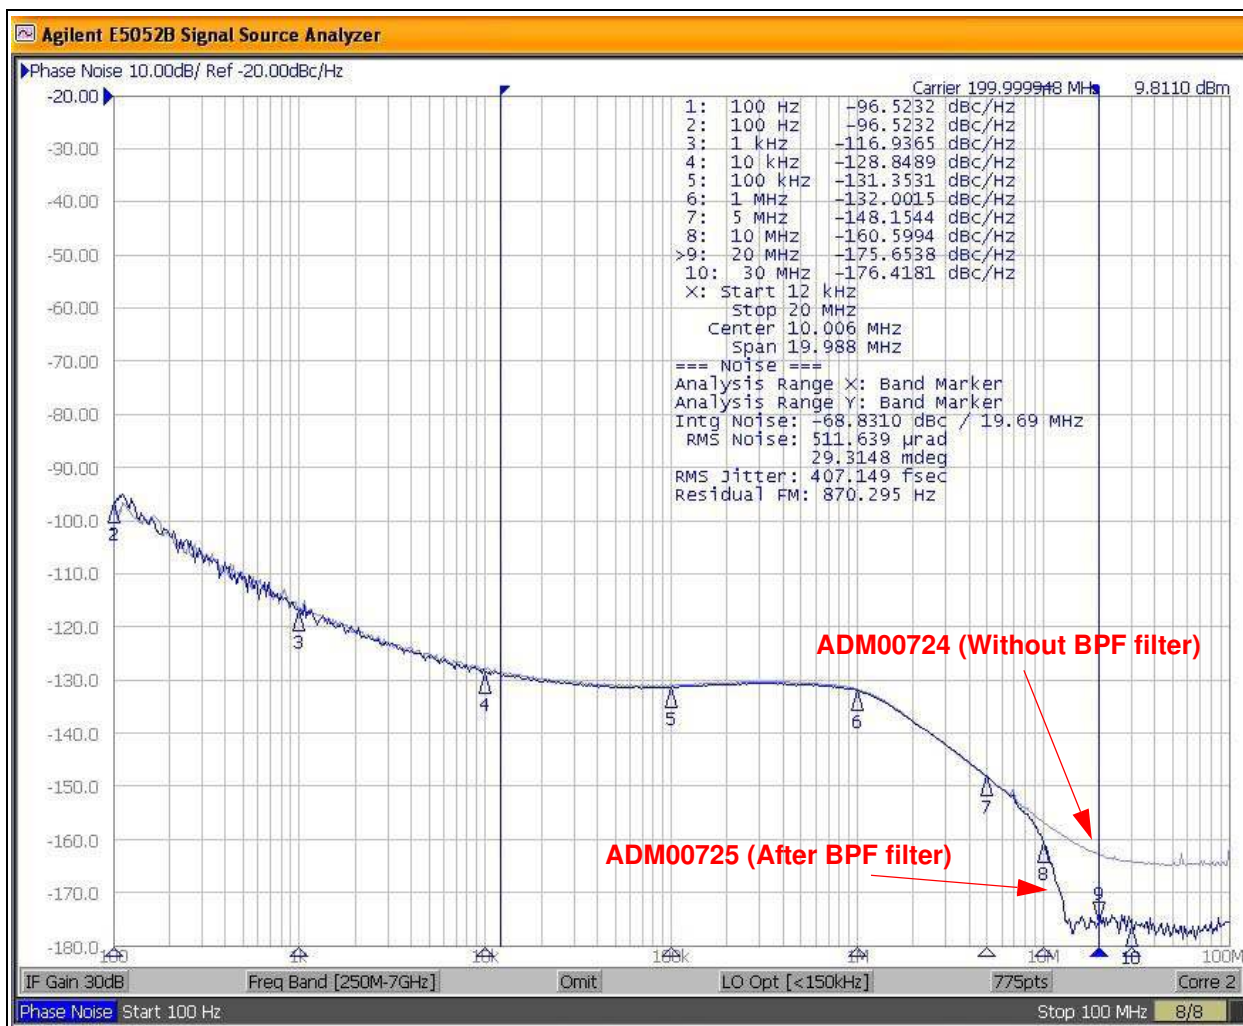


FIGURE 1-3: Phase Noise Plot.

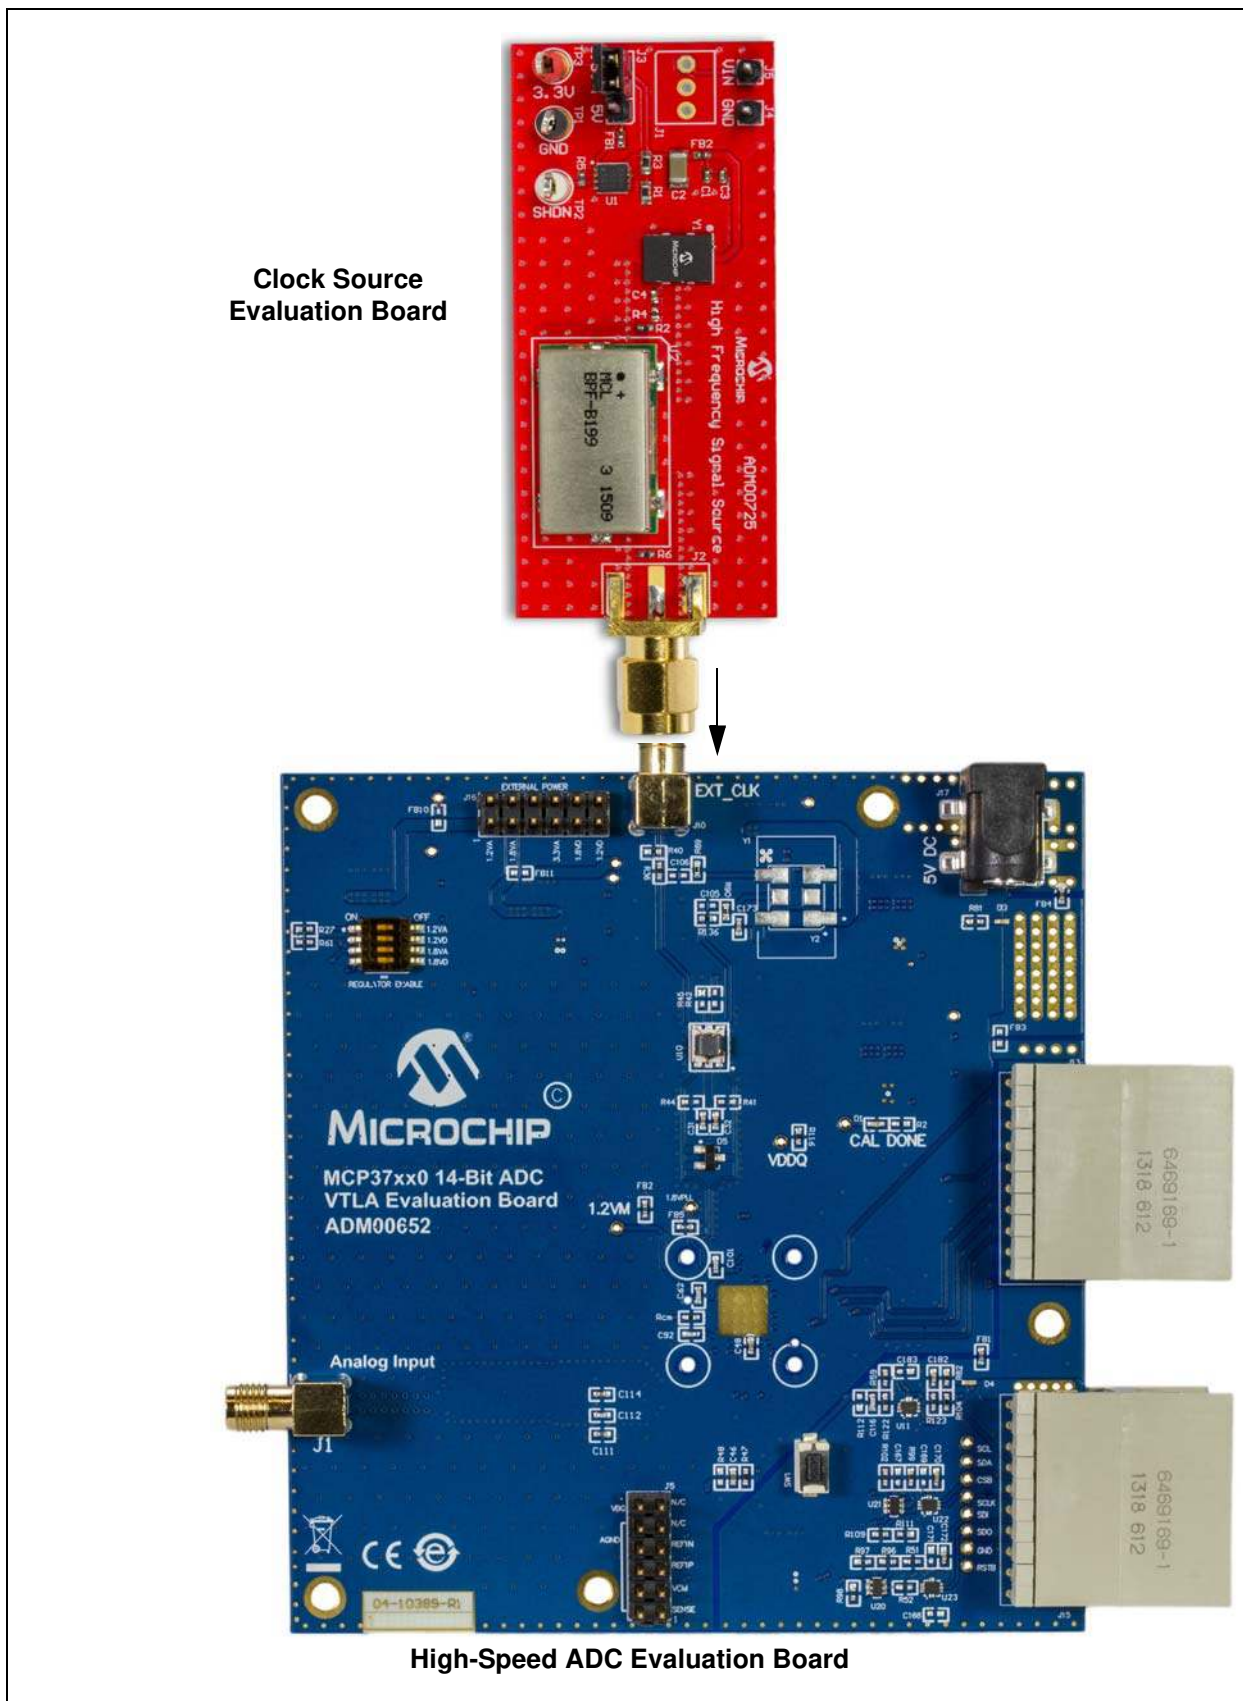


FIGURE 1-4: Application Example: When the Clock Source Evaluation Board is used with the MCP37XX0 High-Speed ADC Evaluation Board.

Appendix A. Schematics and Layouts

A.1 INTRODUCTION

This appendix contains the following schematics and layouts for the High-Frequency Clock Source Evaluation Board:

ADM00724


- Board – Schematic
- Board – Top Silk
- Board – Top Copper and Silk
- Board – Top Copper
- Board – Bottom Copper
- Board – Bottom Copper and Silk
- Board – Bottom Silk

ADM00725


- Board – Schematic
- Board – Top Silk
- Board – Top Copper and Silk
- Board – Top Copper
- Board – Bottom Copper
- Board – Bottom Copper and Silk
- Board – Bottom Silk

A.2 BOARD – SCHEMATIC


ADM00724

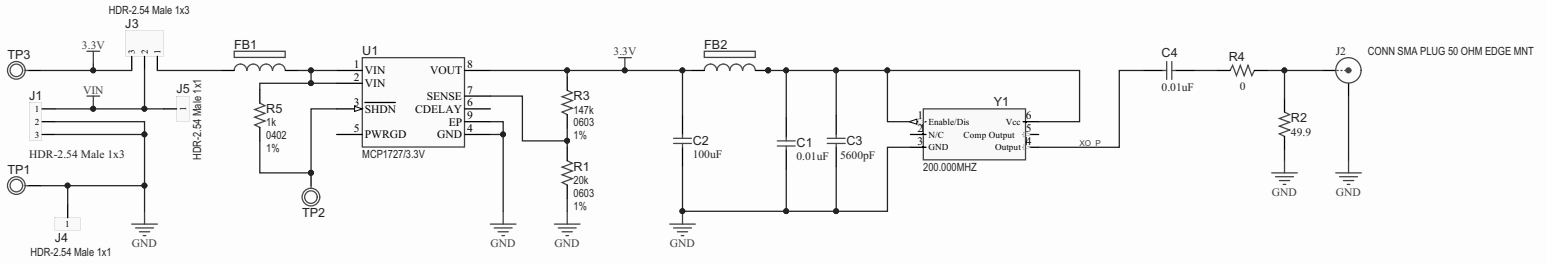


A.3 BOARD – TOP SILK

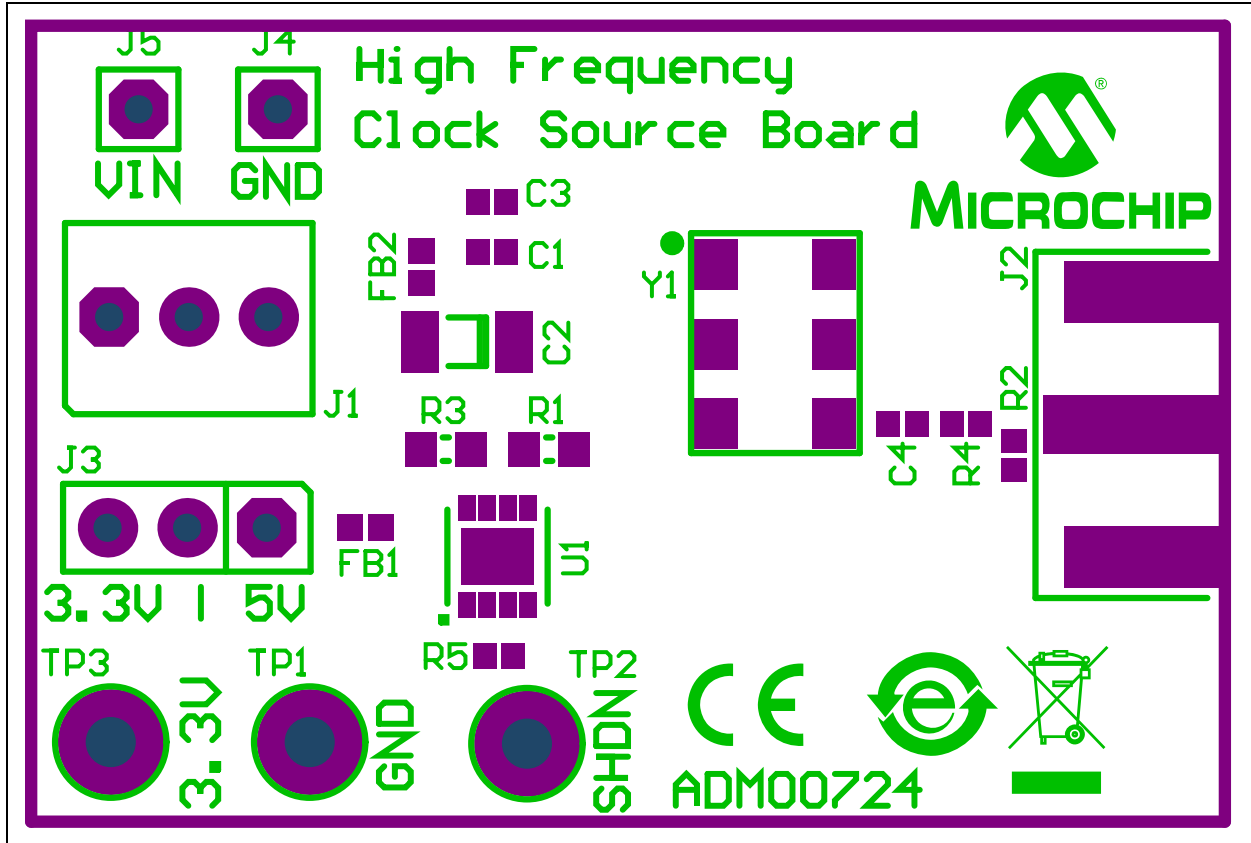


A.4 BOARD – TOP COPPER AND SILK

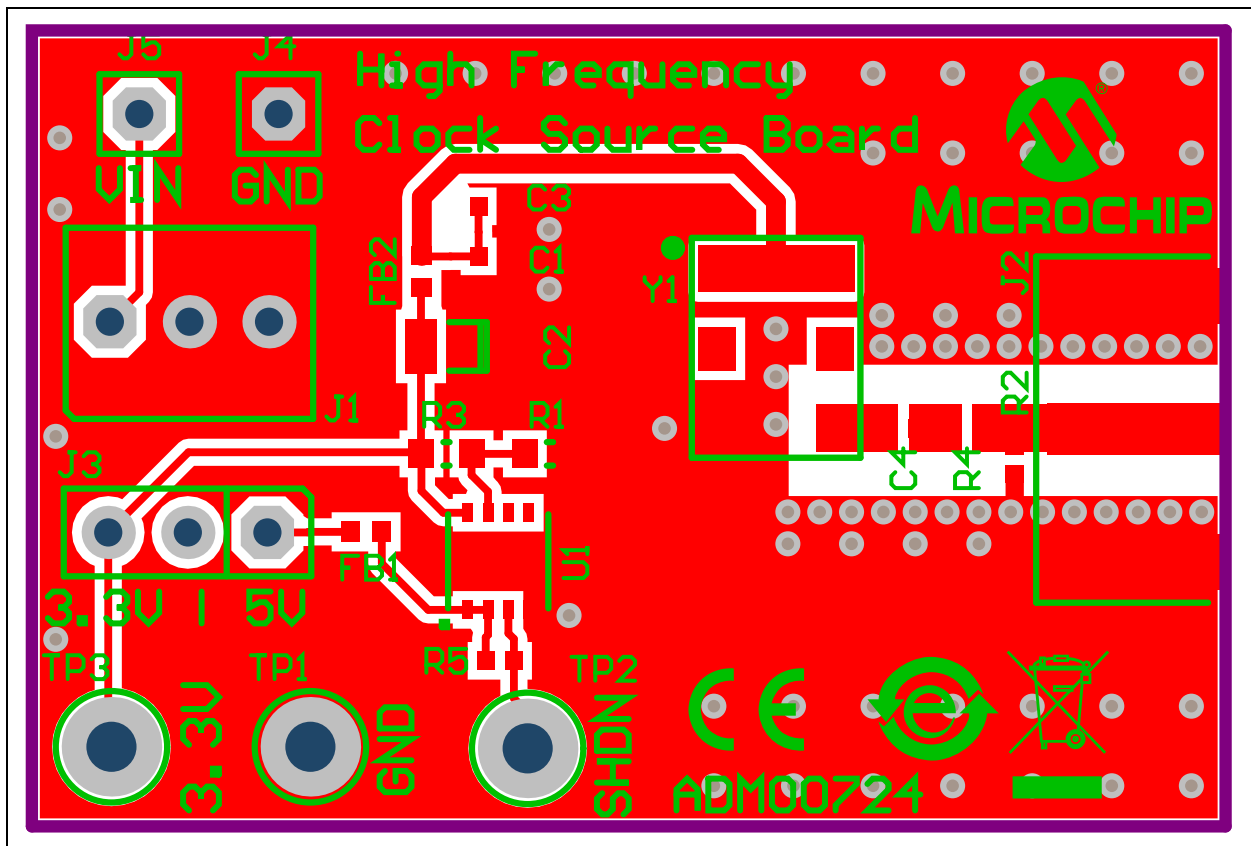


A.5 BOARD – TOP COPPER

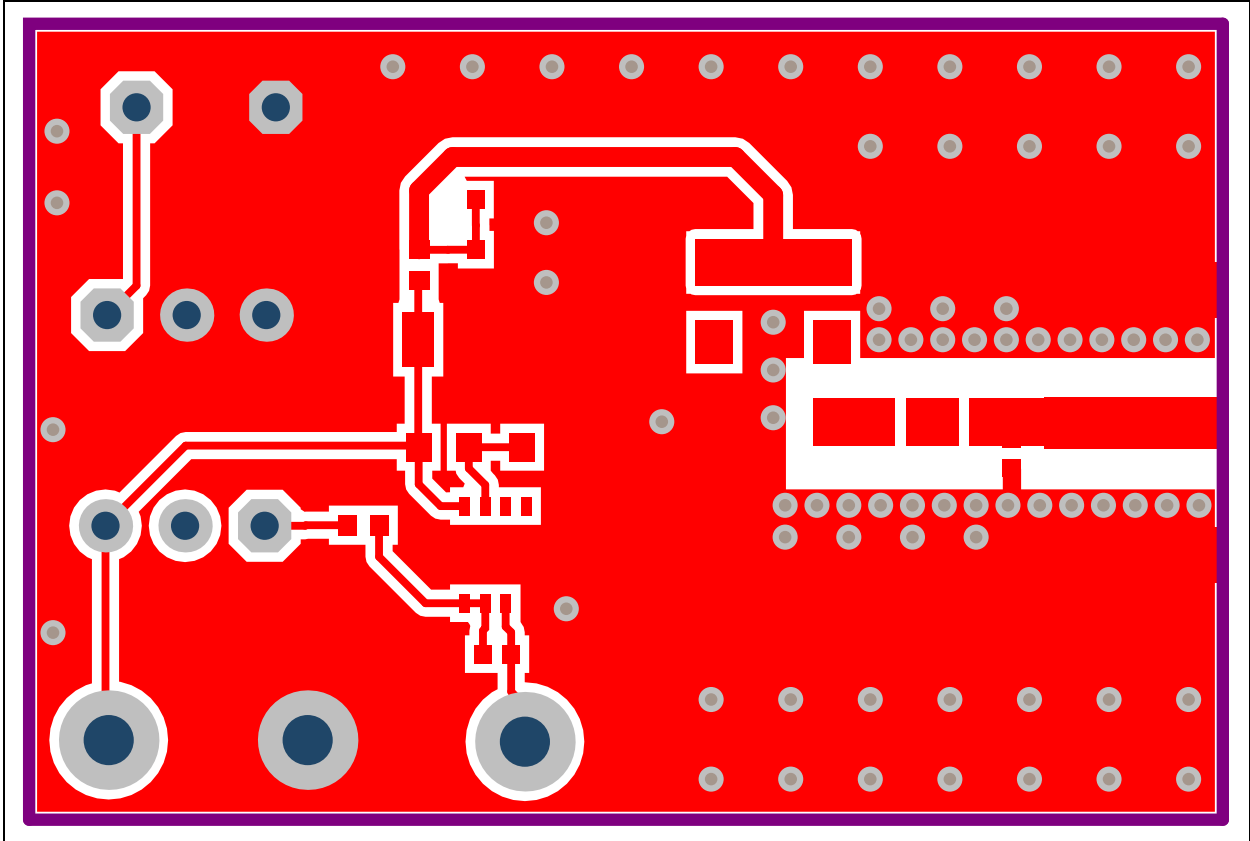


A.6 BOARD – BOTTOM COPPER

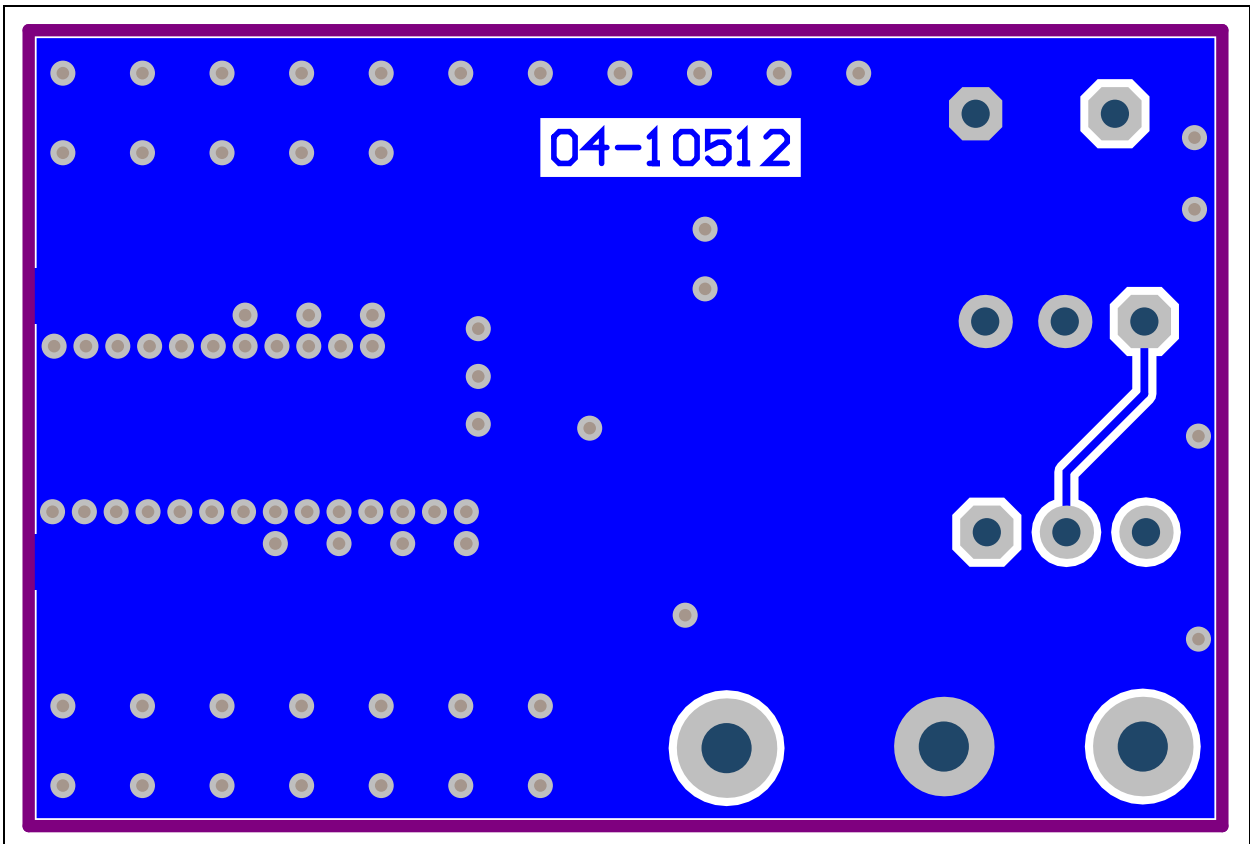


A.7 BOARD – BOTTOM COPPER AND SILK

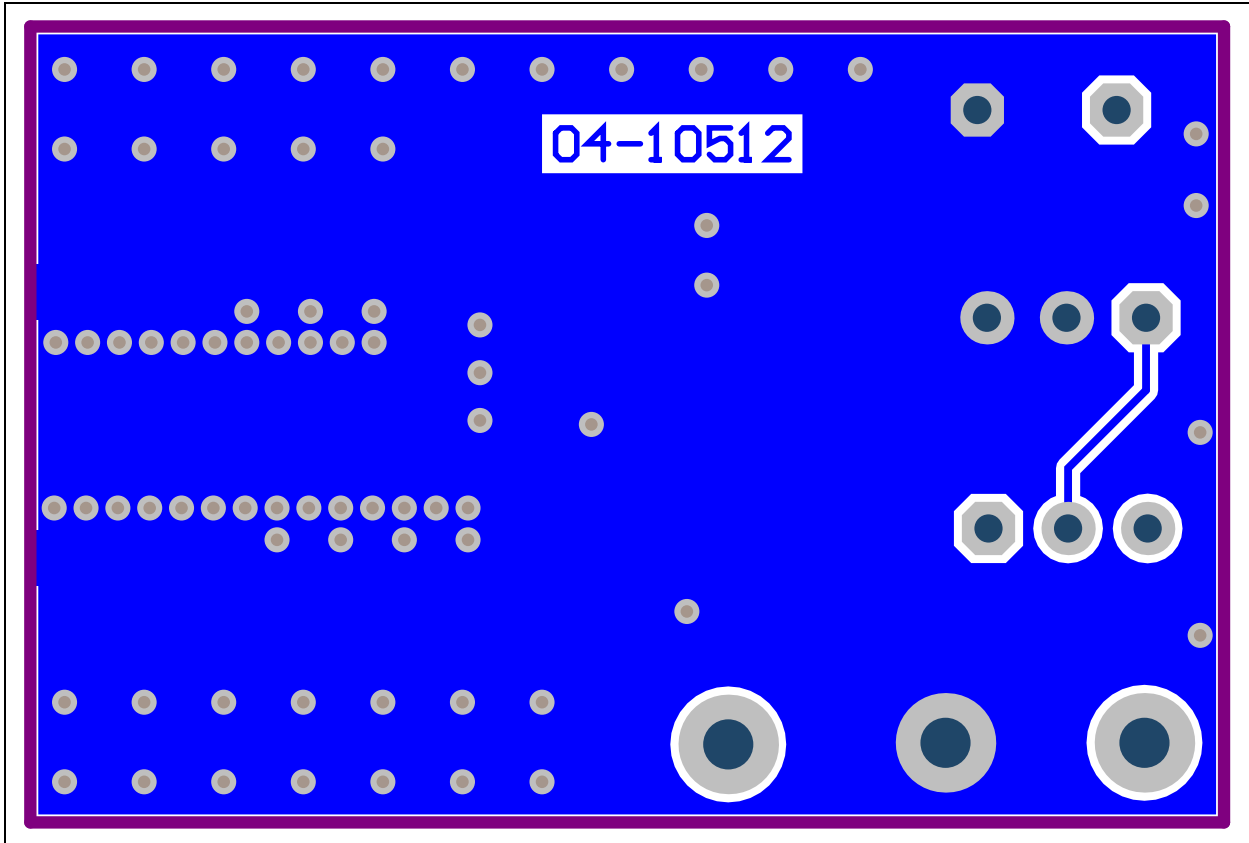


A.8 BOARD – BOTTOM SILK

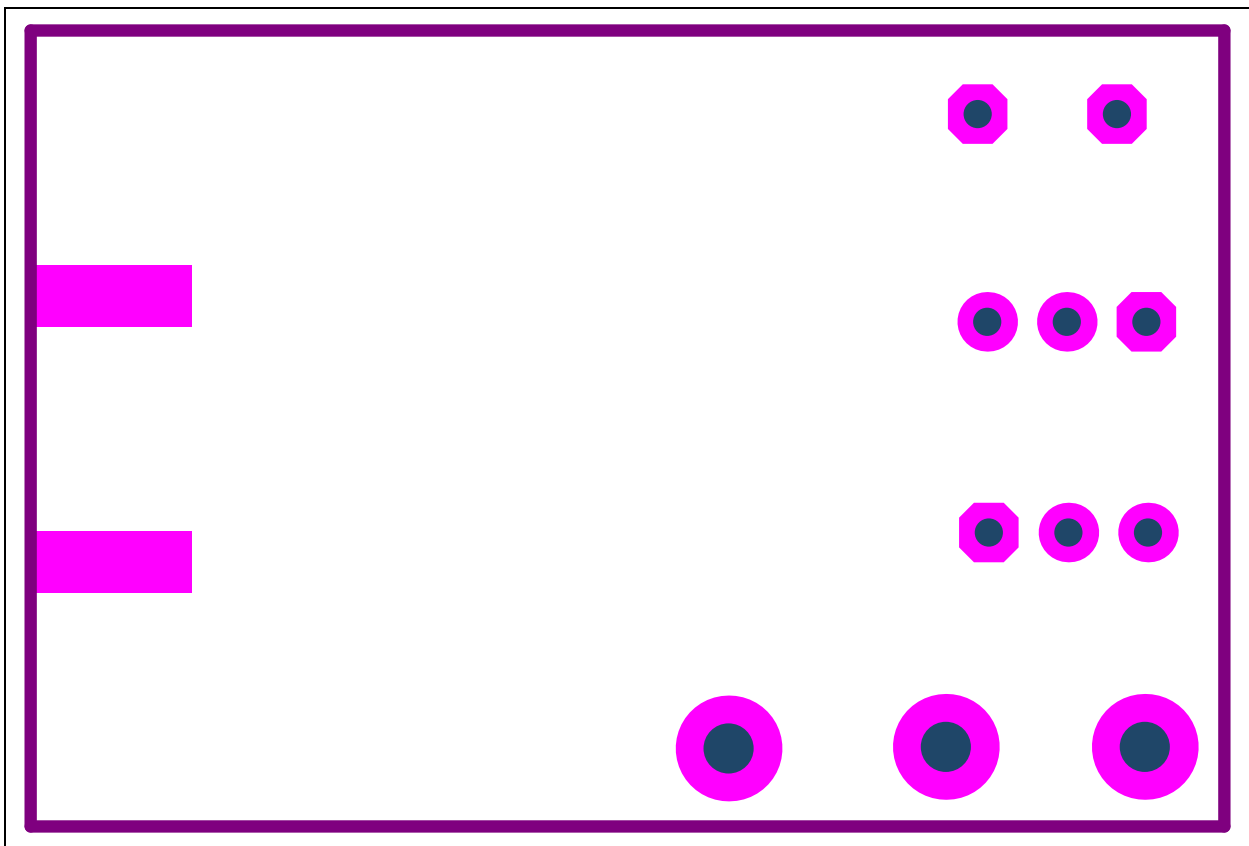


A.9 BOARD – SCHEMATIC

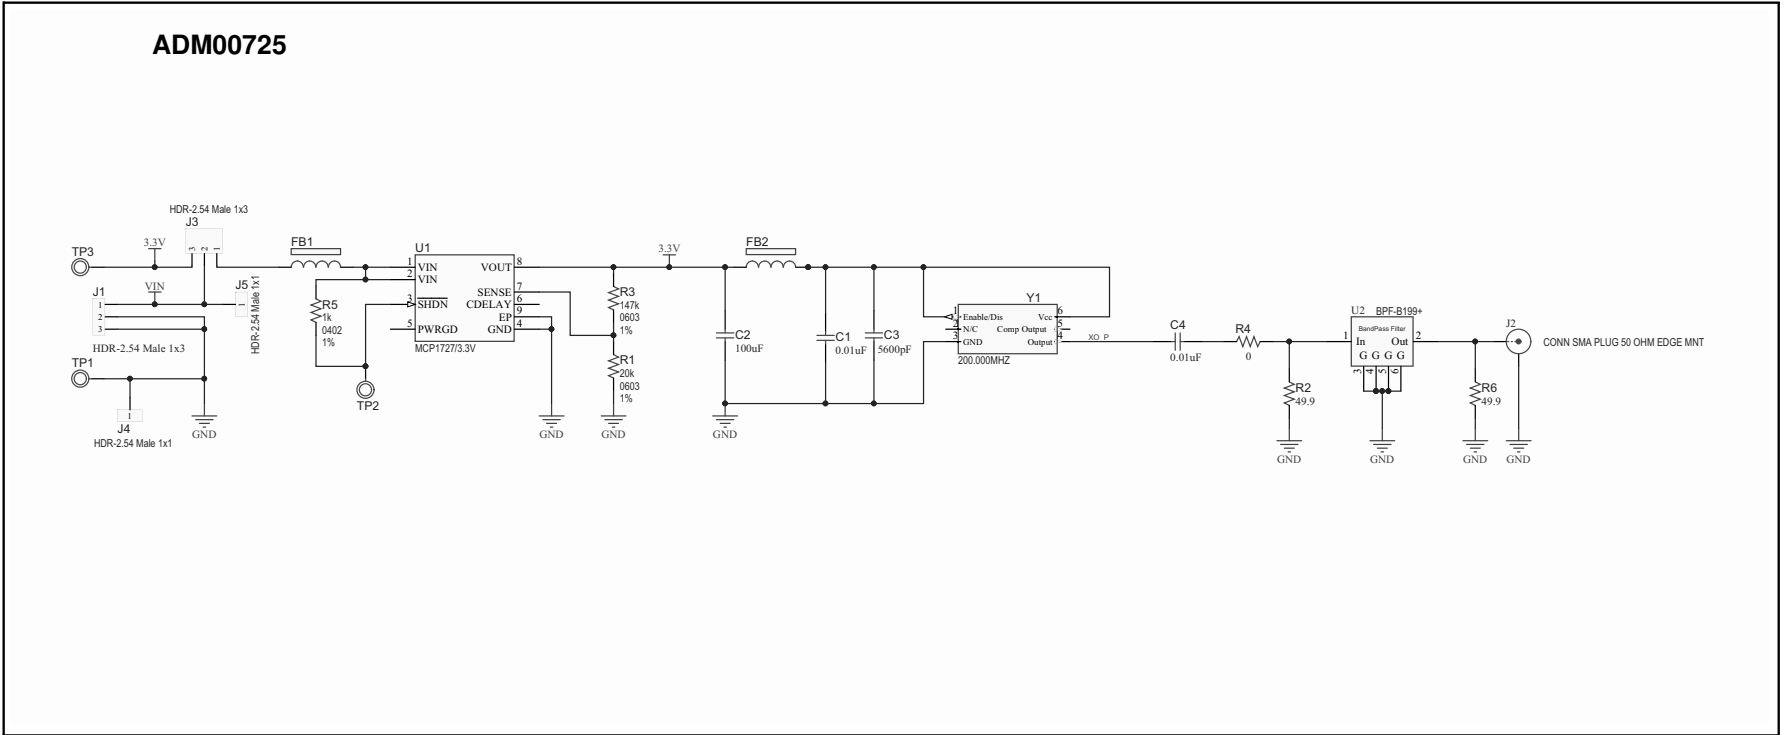


A.10 BOARD – TOP SILK

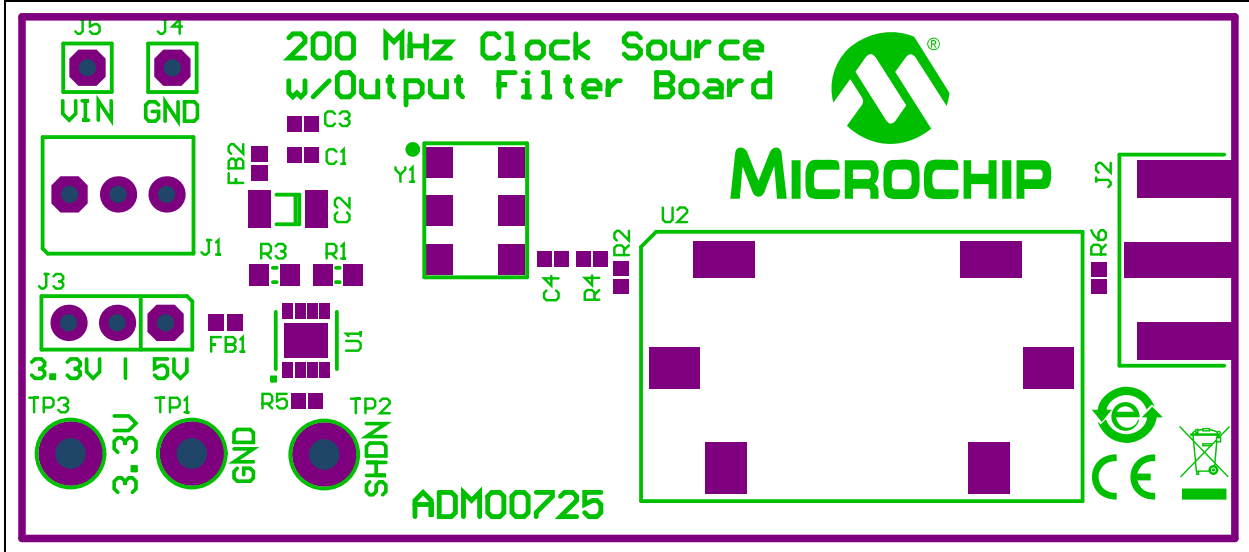


A.11 BOARD – TOP COPPER AND SILK

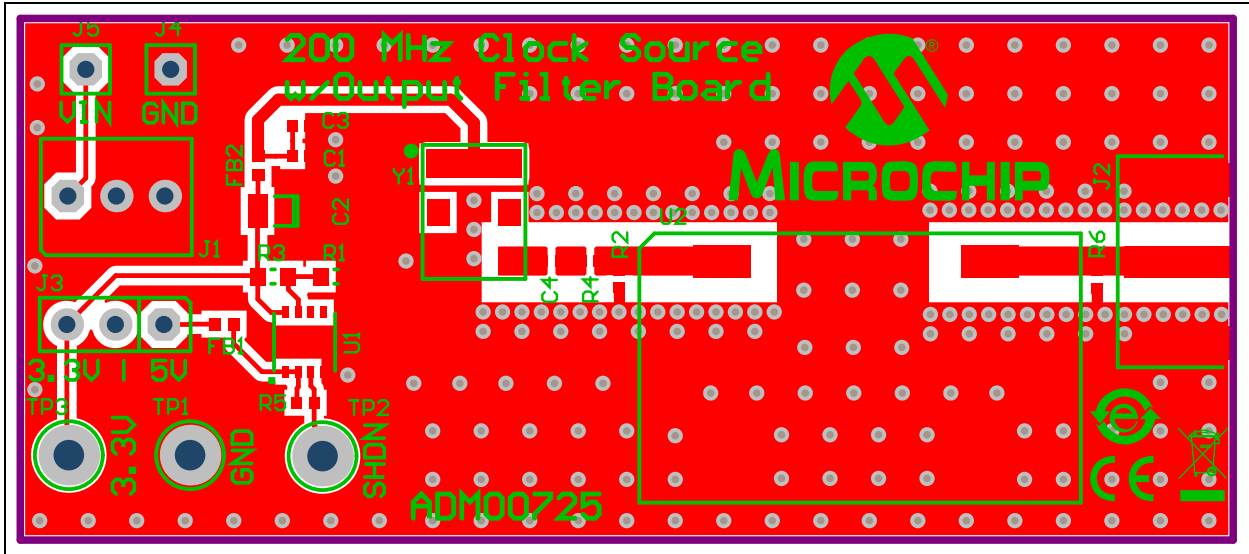


A.12 BOARD – TOP COPPER

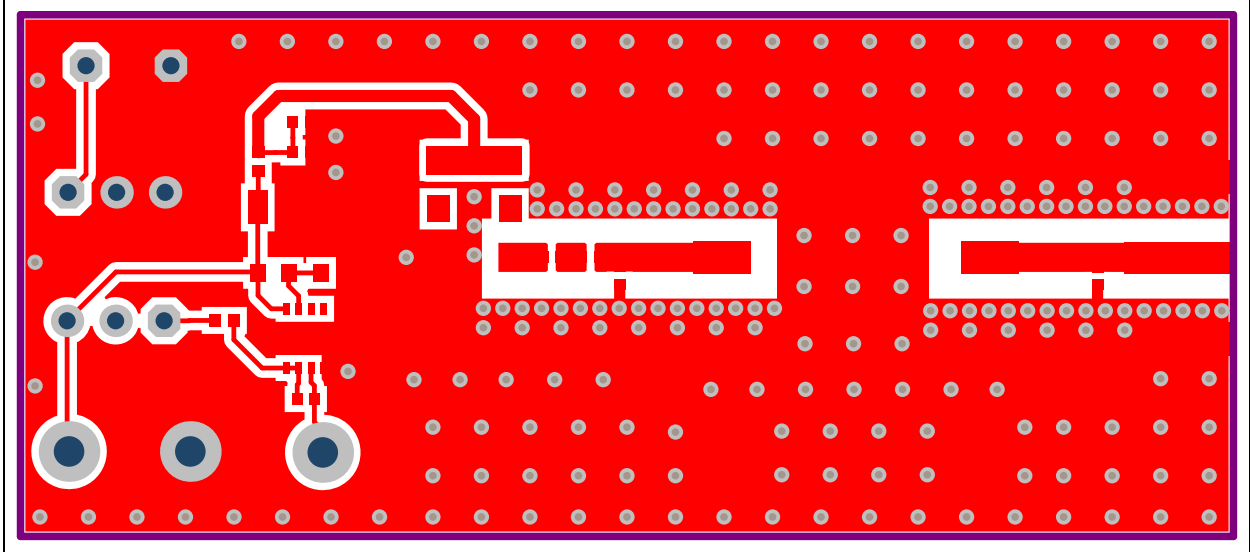

A.13 BOARD – BOTTOM COPPER

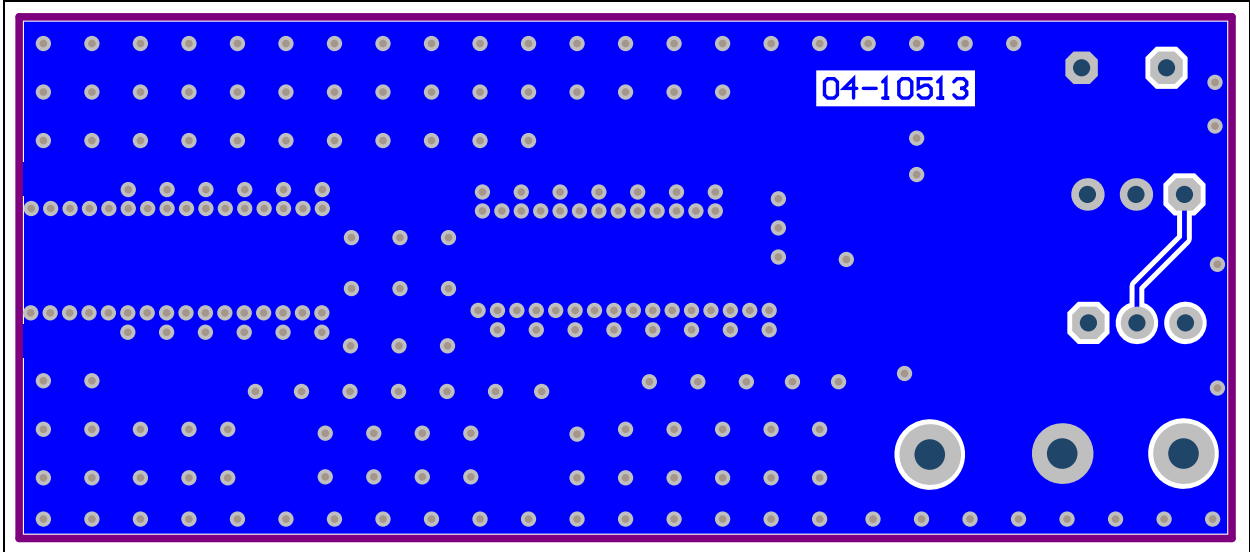

A.14 BOARD – BOTTOM COPPER AND SILK

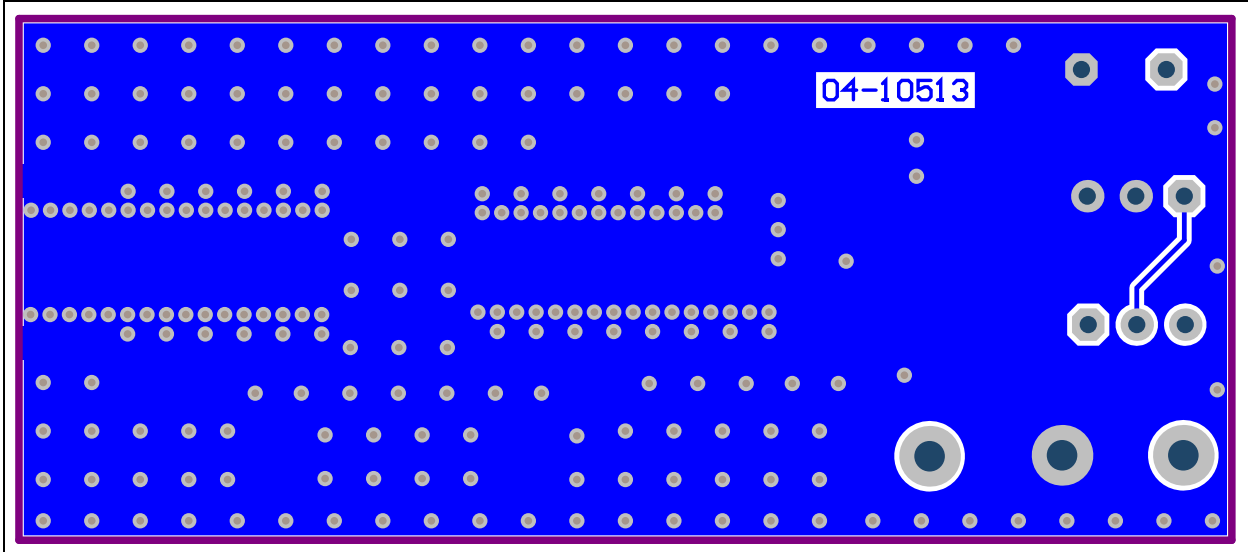

A.15 BOARD – BOTTOM SILK



Appendix B. Bill of Materials (BOM)

TABLE B-1: ADM00724 BILL OF MATERIALS (BOM)

Qty.	Reference	Description	Manufacturer	Part Number
2	C1, C4	Capacitor ceramic 0.01 μ F 16V 10% X7R SMD 0402	KEMET	C0402C103K4RACTU
1	C2	Capacitor ceramic 100 μ F 6.3V 20% X5R SMD 1206	Murata Electronics®	GRM31CR60J107ME39L
1	C3	Capacitor ceramic 5600 PF 50V 10% X7R 0402	Samsung Electro-Mechanics America, Inc.	CL05B562KB5NNNC
2	FB1, FB2	Ferrite Chip 5 Ω 300 MA 0402	Murata Electronics	BLM15BA050SN1D
1	J1	Connector Header-2.54 male 1x3 tin lock 7.49 MH TH. ver- tical	Molex®	0022272031
1	J2	Connector SMA Plug 50 Ω Edge mount	Amphenol Commercial	132365-10
1	J3	Connector Header-2.54 male 1x3 tin 5.84 MH TH. vertical	Samtec, Inc.	TSW-103-07-T-S
2	J4, J5	Connector Header-2.54 male 1x1 gold 5.97 MH TH. vert.	Samtec, Inc.	TSW-101-07-L-S
1	PCB	Printed Circuit Board – High-Frequency Clock Source Evaluation Board	Microchip Technology Inc.	04-10512
1	R1	Resistor TKF. 20 k Ω 1% 1/10W SMD 0603	Yageo Corporation	9C06031A2002FKHFT
1	R2	Resistor SMD. 49.9 Ω 0.1% 1/16W 0402	Panasonic® – ECG	ERA-2AEB49R9X
1	R3	Resistor TKF. 147 k Ω 1% 1/10W SMD 0603	Panasonic – ECG	ERJ-3EKF1473V
1	R4	Resistor TKF. 0R 1/16W SMD. 0402	Yageo Corporation	RC0402JR-070RL
1	R5	Resistor TKF. 1 k Ω 1% 1/10W SMD. 0402	Panasonic – ECG	ERJ-2RKF1001X
1	TP1	Connector TP loop black TH.	Keystone Electronics Corp.	5011
1	TP2	Connector TP loop white TH.	Keystone Electronics Corp.	5012
1	TP3	Connector TP loop red TH.	Keystone Electronics Corp.	5010
1	U1	Micorchip Analog LDO 3.3V MCP1727T-3302E/MF DFN-8	Microchip Technology Inc.	MCP1727T-3302E/MF
1	Y1	\pm 2.5 ppm Stability 200 MHz LVCMOS TCXO	Microchip Technology Inc.	MXT573ABC200M000

Note: The components listed in this Bill of Materials are representative of the PCB assembly. The released BOM used in manufacturing uses all RoHS-compliant components.

Bill of Materials (BOM)

TABLE B-2: ADM00725 BILL OF MATERIALS (BOM)

Qty.	Reference	Description	Manufacturer	Part Number
2	C1, C4	Capacitor ceramic 0.01 μ F 16V 10% X7R SMD 0402	KEMET	C0402C103K4RACTU
1	C2	Capacitor ceramic 100 μ F 6.3V 20% X5R SMD 1206	Murata Electronics®	GRM31CR60J107ME39L
1	C3	Capacitor ceramic 5600 PF 50V 10% X7R 0402	Samsung Electro-Mechanics America, Inc.	CL05B562KB5NNNC
2	FB1, FB2	Ferrite Chip 5 Ω 300MA 0402	Murata Electronics	BLM15BA050SN1D
1	J1	Connector Header-2.54 male 1x3 tin lock 7.49 MH TH. vertical	Molex®	0022272031
1	J2	Connector SMA Plug 50 Ω Edge mount	Amphenol Commercial	132365-10
1	J3	Connector Header-2.54 male 1x3 tin 5.84 MH TH. vertical	Samtec, Inc.	TSW-103-07-T-S
2	J4, J5	Connector Header-2.54 male 1x1 gold 5.97 MH TH. vertical	Samtec, Inc.	TSW-101-07-L-S
1	PCB	Printed Circuit Board – High-Frequency Clock Source Evaluation Board	Microchip Technology Inc.	04-10513
1	R1	Resistor TKF. 20 k Ω 1% 1/10W SMD 0603	Yageo Corporation	9C06031A2002FKHFT
2	R2, R6	Resistor SMD. 49.9 Ω 0.1% 1/16W 0402	Panasonic® – ECG	ERA-2AEB49R9X
1	R3	Resistor TKF. 147 k Ω 1% 1/10W SMD. 0603	Panasonic – ECG	ERJ-3EKF1473V
1	R4	Resistor TKF. 0R 1/16W SMD. 0402	Yageo Corporation	RC0402JR-070RL
1	R5	Resistor TKF. 1 k Ω 1% 1/10W SMD 0402	Panasonic – ECG	ERJ-2RKF1001X
1	TP1	Connector TP loop black TH.	Keystone Electronics Corp.	5011
1	TP2	Connector TP loop white TH.	Keystone Electronics Corp.	5012
1	TP3	Connector TP loop red TH.	Keystone Electronics Corp.	5010
1	U1	Microchip Analog LDO 3.3V MCP1727T-3302E/MF DFN-8	Microchip Technology Inc.	MCP1727T-3302E/MF
1	U2	IC Filter Band Pass. 194 TO 204 MHZ HZ1198 SMD	Mini-Circuits®	BPF-B199+
1	Y1	\pm 2.5 ppm Stability 200 MHz LVCMOS TCXO	Microchip Technology Inc.	MXT573ABC200M000

Note: The components listed in this Bill of Materials are representative of the PCB assembly. The released BOM used in manufacturing uses all RoHS-compliant components.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>

Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland

Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110

Canada - Toronto

Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office

Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon

Hong Kong

Tel: 852-2943-5100
Fax: 852-2401-3431

Australia - Sydney

Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing

Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu

Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing

Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Dongguan

Tel: 86-769-8702-9880

China - Hangzhou

Tel: 86-571-8792-8115
Fax: 86-571-8792-8116

China - Hong Kong SAR

Tel: 852-2943-5100
Fax: 852-2401-3431

China - Nanjing

Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao

Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai

Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang

Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen

Tel: 86-755-8864-2200
Fax: 86-755-8203-1760

China - Wuhan

Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian

Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

ASIA/PACIFIC

China - Xiamen

Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai

Tel: 86-756-3210040
Fax: 86-756-3210049

India - Bangalore

Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi

Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune

Tel: 91-20-3019-1500

Japan - Osaka

Tel: 81-6-6152-7160
Fax: 81-6-6152-9310

Japan - Tokyo

Tel: 81-3-6880-3770
Fax: 81-3-6880-3771

Korea - Daegu

Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul

Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur

Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang

Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila

Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore

Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu

Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung

Tel: 886-7-213-7828

Taiwan - Taipei

Tel: 886-2-2508-8600
Fax: 886-2-2508-0102

Thailand - Bangkok

Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels

Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen

Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris

Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Dusseldorf

Tel: 49-2129-3766400

Germany - Karlsruhe

Tel: 49-721-625370

Germany - Munich

Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan

Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Venice

Tel: 39-049-7625286

Netherlands - Drunen

Tel: 31-416-690399
Fax: 31-416-690340

Poland - Warsaw

Tel: 48-22-3325737

Spain - Madrid

Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Stockholm

Tel: 46-8-5090-4654

UK - Wokingham

Tel: 44-118-921-5800
Fax: 44-118-921-5820

07/14/15