### QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 763 650MA STANDALONE LI-ION BATTERY CHARGER

## LTC4065EDC

# DESCRIPTION

Demonstration circuit DC763 is a complete constantcurrent, constant-voltage battery charger designed to charge single-cell lithium-ion batteries. DC763 is based on the LTC4065 that is available in a  $2mm \times 2mm$  DFN package featuring an exposed bottom-side metal pad for soldering to the PC board. The LTC4065 features an internal MOSFET with thermal feedback loop that regulates the charge current to limit the die temperature during high power operation or high ambient thermal conditions. The preset float voltage is 4.2V with 0.6% accuracy and the constant charge current is 650mA. The DC763 has a jumper for enabling the charger (JP1). Placing the jumper to "OFF" turns off the charger and jumper to "ON" enables the charger. The full-featured DC763 also includes automatic recharge, low-battery charge conditioning (trickle charging), soft-start (to limit inrush current) and a C/10 charge LED indicator. Small surface mount components are used to minimize board space and height.

# Design files for this circuit board are available. Call the LTC factory.

LT is a registered trademark of Linear Technology Corporation

#### Table 1. Performance Summary

PARAMETER	CONDITION	VALUE
Input Voltage		3.75-5.25V
I <sub>BAT</sub> (constant current mode)	Vin=5V, Vbat=3.6V	650mA +/-5%
Float Voltage	Vin=5V	4.20V +/-0.6%
Trickle Charge Threshold		2.9V +/-0.15V
I <sub>BAT</sub> (trickle current mode)		65mA +/-20mA

# **QUICK START PROCEDURE**

Demonstration circuit DC763 is easy to set up to evaluate the performance of the LTC4065. Refer to Figure 1. for proper measurement equipment setup and follow the procedure below:

- 1. Set jumper JP1 to the "ON" position. Adjust the output voltage of the input power supply to OV and then connect the power supply to the Vin and GND pins of the demo board.
- 2. Set the battery simulator to OV, and then connect it to the BAT and GND pins.
- Connect the digital voltmeters as shown in the setup diagram to measure the input voltage V<sub>IN</sub>, charger voltage (VBAT) and the charge current (IBAT).
- **4.** Begin increasing the input voltage to 5V and keep the battery simulator power supply at 0V. The CHRG LED should be on, and the

charge current should be approximately 65mA. This is the trickle charge mode for a deeply discharged battery. Typically, a battery that has not been charged for a long time.

- 5. Starting from OV, slowly increase the battery simulator power supply (VBAT), observing the charger's output voltage on the DVM. When the charger's output voltage exceeds approximately 2.9V, the charger will enter the Constant Current mode of the charge cycle with the charge current (IBAT) increased to the programmed value of approximately 650mA. This is the Constant Current mode.
- 6. Continue to slowly increase the battery simulator power supply, thus simulating a battery accepting charge. The charge current should remain at the programmed value of 650mA until the charger output voltage is within

10mV of the preset voltage, at which time the charge current will begin to decrease. This is the beginning of the Constant Voltage mode of the charge cycle. Continue to slowly increase the battery simulator power supply while observing the CHRG LED to go out when the charge current drops to approximately 10% of the programmed charge current.

**7.** After the timer has timed out, slowly decrease the battery simulator power supply. At approximately 4.1V, the charge current resumes

and a new charge cycle begins. This is the Recharge Threshold Voltage.

- 8. To verify the shutdown mode, move jumper JP1 to the "OFF" position. This shuts the charger down dropping the charge current to OmA.
- 9. To verify battery drain current, remove the input supply voltage. The ammeter that was reading charge current now reads the battery drain current. A typical value is less than 1µA.

## QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 763 650MA STANDALONE LI-ION BATTERY CHARGER

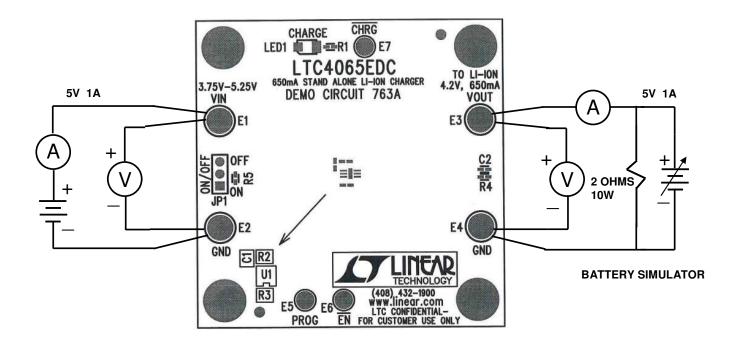


Figure 1. Proper Measurement Equipment Setup





Figure 2. Scope Probe Placement for Measuring Input or Output Ripple

## QUICK START GUIDE FOR DEMONSTRATION CIRCUIT 763 650MA STANDALONE LI-ION BATTERY CHARGER

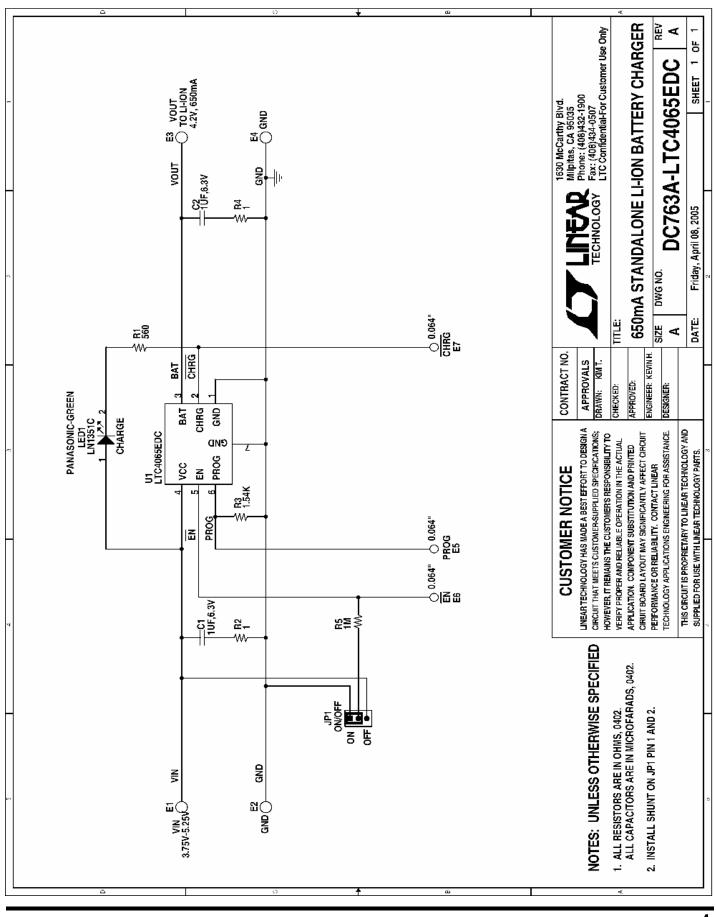

TECHNOLOGY

4