

# ±30 Gauss, Monolithic, High Performance, Low Cost 3-axis Magnetic Sensor


# MMC5603NJ

#### FEATURES

- Monolithic integrated 3-axis AMR magnetic sensor and electronic circuits requiring fewer external components
- Superior Dynamic Range and Accuracy:
  - ✓ ±30 G FSR
  - ✓ 20bits operation mode
  - ✓ 0.0625mG per LSB resolution
  - ✓ 2 mG total RMS noise
  - ✓ Enables heading accuracy of ±1°
- Sensor true frequency response up to 1KHz
- Ultra-Small Wafer Level Package 0.8x0.8x0.4 mm
- On-chip automatic degaussing with built-in SET/RESET function
  - ✓ Eliminates thermal variation induced offset error (Null field output)
  - Clears the residual magnetization resulting from strong external fields
- On-chip sensitivity compensation
- On-chip temperature sensor
- Selftest signal available
- Data\_ready Interrupt (I3C only)
- Low power consumption
- 1 µA power down current
- I<sup>2</sup>C slave, FAST (≤400 KHz) mode
- I3C interface available
- 1.62V to 3.6V wide range single power supply
- 1.2V logic IO
- RoHS compliant

#### **APPLICATIONS**

- Electronic Compass & GPS Navigation
- Position Sensing

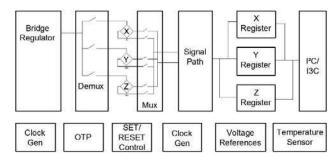

## FUNCTIONAL BLOCK DIAGRAM

## DESCRIPTION

The MMC5603NJ is a monolithic complete 3-axis AMR magnetic sensor with on-chip signal processing and integrated digital bus (I<sup>2</sup>C fast mode and I3C interface), the device can be connected directly to a microprocessor, eliminating the need for A/D converters or timing resources.

It can measure magnetic fields within the full scale range of  $\pm 30$  Gauss (G), with up to 0.0625mG per LSB resolution at 20bits operation mode and 2mG total RMS noise level, enabling heading accuracy of  $\pm 1^{\circ}$  in electronic compass applications. Contact MEMSIC for access to advanced calibration and tilt-compensation algorithms.

An integrated SET/RESET function provides for the elimination of error due to Null Field output change with temperature. In addition it clears the sensors of any residual magnetic polarization resulting from exposure to strong external magnets. The SET/RESET function can be performed for each measurement or periodically as the specific application requires.

The MMC5603NJ is in wafer level package with an ultra-small size of  $0.8x \ 0.8 \ x \ 0.4 \ mm$  and with an operating temperature range from -40 °C to +85 °C.

©MEMSIC, Inc. One Technology Drive, Suite 325, Andover, MA 01810, USA Tel: +1 978 738 0900 Fax: +1 978 738 0196 www.memsic.com

MEMSIC MMC5603NJ Rev.B

Information furnished by MEMSIC is believed to be accurate and reliable. However, no responsibility is assumed by MEMSIC for its use, or for any infringements of patents or other rights of third parties which may result from its use. No license is granted by implication or otherwise under any patent or patent rights of MEMSIC.

Parameter	Conditions	Min	Тур	Мах	Units
Field Range (Each Axis) <sup>1</sup>	Total applied field		±30		G
Supply Voltage	V <sub>DD</sub>	1.62	1.8	3.6	V
VIO		1.2	1.8	V <sub>DD</sub>	V
Supply Voltage rise time				10.0	ms
Supply Current <sup>2</sup> 3	BW=00		3.4	4.0	mA
Supply Current <sup>2,3</sup> (100 measurements/second)	BW=01		2.4	3.0	mA
(100 measurements/second)	BW=10		1.3	1.6	mA
	BW=11		0.75	1.0	mA
Power Down Current <sup>3</sup>			1.0	1.2	μA
Operating Temperature		-40		85	°C
Storage Temperature		-55		125	°C
Linearity Error <sup>3</sup> (Best fit straight line)	FS=±30 G H <sub>applied</sub> =±15 G		0.5	0.75	%FS
Hysteresis <sup>3</sup>	3 sweeps across ±30 G		0.02	0.1	%FS
Repeatability Error <sup>3</sup>	3 sweeps across ±30 G		0.02	0.1	%FS
Alignment Error			±1.0	±3.0	Degrees
Transverse Sensitivity			±1.0 ±2.0	±0.0	%
	BW=00		1.5	2.5	mG
	BW=00		2.0	4.0	mG
Total RMS Noise <sup>3</sup>	BW=10		3.0	5.0	mG
	BW=11		4.0	7.0	mG
Output resolution			20	7.0	Bits
	BW=00	75			Hz
	BW=01	150			Hz
Max Output data rate <sup>4</sup>	BW=10	255			Hz
	BW=11	255		1000	Hz
Heading accuracy <sup>3,5</sup>			±1.0	±3.0	Degrees
	±30 G	-5		5	%
Sensitivity <sup>3,6,8</sup>	With16bits operation		1024		counts/G
	With18bits operation		4096		counts/G
	With 20bits operation		16384		counts/G
Sensitivity Change Over	-40~85 °C			_	
Temperature <sup>3</sup>	Delta from 25 °C±30 G			±5	%
		-1.0		1.0	G
	With16bits operation		32768		Counts
Null Field Output <sup>8</sup>	With18bits operation		131072		Counts
	With 20bits operation		524288		Counts
Null Field Output Change Over Temperature <sup>3</sup>			±0.2	±1.0	mG/°C
Temperature Sensor Output <sup>3</sup>	1	0.6	0.8	1.0	°C/Count
Disturbing Field <sup>7</sup>		32	0.0	1.0	G
Maximum Exposed Field		52		10,000	G
Output Repeatability <sup>3</sup>			2.0	3.0	mG

SPECIFICATIONS (Measurements @ 25 °C, unless otherwise noted; VDD= 1.8 V, Auto\_SR\_en=1, unless otherwise specified)

NOTES:

1. External magnetic field on each axis not continuously higher than 16G.

2. Supply current is proportional to how many measurements performed per second, 75Hz (maximum) for BW=00.

3. Based on 3lots characterization result.

4. The 1000 Hz ODR is available by writing 255 into Register ODR and setting hpower to 1.

5. MEMSIC product enables users to utilize heading accuracy to be 1.0 degree typical when using MEMSIC's proprietary software or algorithm.


6. Sensitivity of the orthogonal axes is analytically derived from raw data and is subsequently processed by MEMSIC software drivers.

7. This is the magnitude of external field that can be tolerated without changing the sensor characteristics. If the disturbing field is exceeded, a SET/RESET operation is required to restore proper sensor operation.

8. Based on shipment test result.

Parameter	Symbol	Test Condition	Min.	Тур.	Max.	Unit
Logic Input Low Level	VIL		-0.5		0.3* V <sub>IO</sub>	V
Logic Input High Level	VIH		0.7*V <sub>IO</sub>		V <sub>IO</sub>	V
Hysteresis of Schmitt input	V <sub>hys</sub>		0.2			V
Logic Output Low Level	V <sub>OL</sub>				0.4	V
Input Leakage Current	li	0.1VIO <vin<0.9vio< td=""><td>-10</td><td></td><td>10</td><td>μA</td></vin<0.9vio<>	-10		10	μA
SCL Clock Frequency	fscl		0		400	kHz
START Hold Time	thd;sta		0.6			μS
START Setup Time	tsu;sta		0.6			μS
LOW period of SCL	t∟ow		1.3			μS
HIGH period of SCL	tнıgн		0.6			μS
Data Hold Time	thd;dat		0		0.9	μS
Data Setup Time	tsu;dat		0.1			μS
Rise Time	tr	From VIL to VIH			0.3	μS
Fall Time	tf	From V <sub>IH</sub> to VIL			0.3	μS
Bus Free Time Between STOP and START	<b>t</b> BUF		1.3			μS
STOP Setup Time	tsu;sто		0.6			μS

## I<sup>2</sup>C INTERFACE I/O CHARACTERISTICS (VIO=1.8 V)

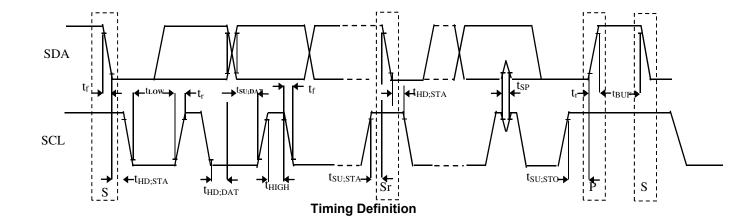

#### ABSOLUTE MAXIMUM RATINGS\* Supply Voltage -0.5 to +5 V Storage Temperature -55 °C to +125 °C Maximum Exposed Field 10000 G

**Note:** Stresses above those listed under Absolute Maximum Ratings may cause permanent damage to the device. This is a stress rating only; the functional operation of the device at these or any other conditions above those indicated in the operational sections of this specification is not implied. Exposure to absolute maximum rating conditions for extended periods may affect the device's reliability.

Pin Description: WLP Package

Pin	Name	Description	I/O
A1	VSA	Connect to Ground	Ρ
A2	SCL	Serial Clock Line	I
B1	VDD	Power Supply	Р
B2	SDA	Serial Data Line	I/O


All parts are shipped in tape and reel packaging with 10000pcs (or 5000pcs per requested) per 7" reel.

Caution:


This is an Electro-static Discharge (ESD) sensitive device.

Ordering Guide:

MMC5603NJ

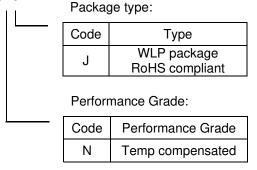

#### MARKING ILLUSTRATION

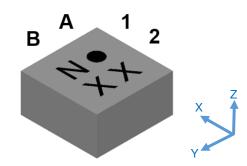

**Note:** "Number" (top-left character) is used to differentiate between similar devices. The black dot marks the location of pin one (1). The 2<sup>nd</sup> line represents the device's Lot Number.


## THEORY OF OPERATION

The Anisotropic Magneto-Resistive (AMR) sensors are special resistors made of permalloy thin film deposited on a silicon wafer. During manufacturing, a strong magnetic field is applied to the film to orient its magnetic domains in the same direction, establishing a magnetization vector. Subsequently, an external magnetic field applied perpendicularly to the sides of the film causes the magnetization to rotate and change angle. This effect causes the film's resistance to vary with the intensity of the applied magnetic field. The MEMSIC AMR sensor is incorporated into a Wheatstone bridge configuration to maximize Signal to Noise ratio. A change in magnetic field produces a proportional change in differential voltage across the Wheatstone bridge

However, the influence of a strong magnetic field (more than 30 G) in any direction could upset, or flip, the polarity of the film, thus changing the sensor characteristics. A strong restoring magnetic field must be applied momentarily to restore, or set, the sensor characteristics. The MEMSIC magnetic sensor has an on-chip magnetically coupled strap: a SET/RESET strap pulsed with a high current, to provide the restoring magnetic field.

#### EXTERNAL CIRCUITRY CONNECTION

The MMC5603NJ can operate from a single 1.62V to 3.6V supply. The circuit connection diagrams below illustrate power supply connection options.

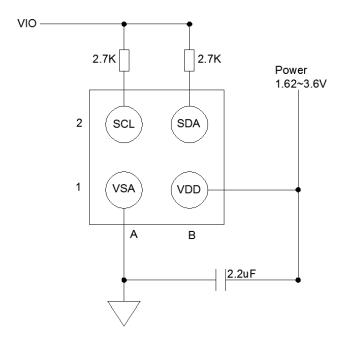

#### <TOP VIEW>

#### **Connection Block Diagram**

#### **PIN DESCRIPTIONS**

VDD-This is the power supply pin. MEMSIC recommends a minimum bypass capacitor of 2.2  $\mu\text{F}$  placed in close proximity to the VDD pin.

VSA – This is the ground pin for the magnetic sensor.

**SDA** – This pin is the I3C/I<sup>2</sup>C serial data line.

**SCL**– This pin is the I3C/I<sup>2</sup>C serial clock line.

## HARDWARE DESIGN CONSIDERATION

- ✓ Provide adequate separation distance to devices that contain permanent magnets or generate magnetic fields (e.g. speakers, coils, inductors) The combined magnetic field to be measured and interference magnetic field should be less than the full scale range of the MMC5603NJ (±30 G).
- Provide adequate separation distance to current carrying traces. Do not route current carrying traces under the sensor or on the other side of the PCB opposite the device.
- ✓ Do not cover the sensor with magnetized material or material that may become magnetized, (e.g., shield box, LCD, battery, iron bearing material).
- ✓ Do not place the device opposite magnetized material or material that may become magnetized located on the other side of the PCB.

MEMSIC MMC5603NJ Rev. B

Page 5 of 18

Details please refer to MEMSIC Magnetic Sensor Hardware Design Layout Guideline for Electronic Device.

#### POWER CONSUMPTION


The power consumed by the device is proportional to the number of measurements taken per second. For example, when BW<1:0>=10, MMC5603NJ consumes 1.3mA (typical) at 1.8V with 100 measurements per second. If only 1 measurements are performed per second, the current will be  $1300*1/100=13\mu A$ .

## I<sup>2</sup>C INTERFACE DESCRIPTION

A slave mode I<sup>2</sup>C circuit has been implemented into the MEMSIC magnetic sensor as a standard interface for customer applications. The A/D converter functionality have been added to the MEMSIC sensor, thereby increasing ease-of-use, and lowering power consumption, footprint and total solution cost.

The I<sup>2</sup>C (or Inter IC bus) is an industry standard bidirectional two-wire interface bus. A master I<sup>2</sup>C device can operate READ/WRITE controls to 128 devices by device addressing. The MEMSIC magnetic sensor operates only in a slave mode, i.e. only responding to calls by a master device.

#### I<sup>2</sup>C BUS CHARACTERISTICS

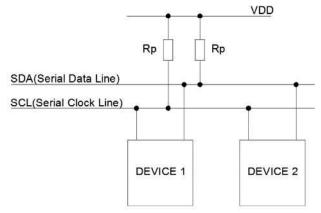

The two wires in the I<sup>2</sup>C bus are called SDA (serial data line) and SCL (serial clock line). In order for a data transfer to start, the bus has to be free, which is defined by both wires in a HIGH output state. Due to the open-drain/pull-up resistor structure and wired Boolean "AND" operation, any device on the bus can pull lines low and overwrite a HIGH signal. The data on the SDA line has to be stable during the HIGH period of the SCL line. In other words, valid data can only change when the SCL line is LOW.

Note: Rp selection guide: 2.7Kohm for a short  $I^{2}C$  bus length (less than 10 cm), and 10Kohm for a bus length less than 5 cm.

Register Name	Address (HEX)	Description
Xout0	00H	Xout[19:12]
Xout1	01H	Xout[11:4]
Yout0	02H	Yout[19:12]
Yout1	03H	Yout[11:4]
Zout0	04H	Zout[19:12]
Zout1	05H	Zout[11:4]
Xout2	06H	Xout[3:0]
Yout2	07H	Yout[3:0]
Zout2	08H	Zout[3:0]
Tout	09H	Temperature output
Status1	18H	Device status1
ODR	1AH	Output data rate
Internal control 0	1BH	Control register 0
Internal control 1	1CH	Control register 1
Internal control 2	1DH	Control register 2
ST_X_TH	1EH	X-axis selftest threshold
ST_Y_TH	1FH	Y-axis selftest threshold
ST_Z_TH	20H	Z-axis selftest threshold
ST_X	27H	X-axis selftest set value
ST_Y	28H	Y-axis selftest set value
ST_Z	29H	Z-axis selftest set value
Product ID	39H	Product ID

# MEMSIC MMC5603NJ Rev. B

## REGISTER DETAILS

REGISTER DETAILS										
Xout0, Xout1, Xou				4	0	0				
Xout0	7	6	5	4	3	2	1	0		
Addr: 00H		Xout[19:12] Read-only								
Mode				Read	l-only					
Xout1	7	6	5	4	3	2	1	0		
Addr: 01H		Ū	U U	Xout[				, <u> </u>		
Mode				Read						
					- 1					
Xout2	7	6	5	4	3	2	1	0		
Addr: 06H		Χοι	ut[3:0]		0	0	0	0		
Mode				Read	l-only					
X-axis output, unsig										
	output			Data						
	ation mode			t[19:4]						
	ation mode			t[19:2]						
20bits oper	ation mode		Xou	t[19:0]						
•			Xou	t[19:0]						
Yout0, Yout1, You	t2	6			3	2	1	0		
Yout0, Yout1, You Yout0		6	Xou	4	3	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H	t2	6		4 Yout[1	19:12]	2	1	0		
Yout0, Yout1, You Yout0	t2	6		4	19:12]	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H	t2	6		4 Yout[1	19:12]	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode	t2 7		5	4 Yout[1 Read	19:12] -only 3		· ·			
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1	t2 7		5	4 Yout[1 Read	19:12] -only 3 11:4]		· ·			
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H	t2 7	6	5	4 Yout[1 Read 4 Yout[	19:12] -only 3 11:4]		· ·			
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2	t2 7	6	5	4 Yout[1 Read 4 Yout[	19:12]  -only   3 11:4]  -only   3	2	· ·	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H	t2 7 7 7	6	5	4 Yout[1 Read 4 Yout[ Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2	t2 7 7 7	6	5	4 Yout[1 Read 4 Yout[ Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H Mode	t2 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7	6	5	4 Yout[1 Read 4 Yout[ Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H Mode Y-axis output, unsig	t2 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7	6	5 5 13:0]	4 Yout[1 Read 4 Yout[ Read 4 Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H Mode Y-axis output, unsig Y-axis	t2 7 7 7 9 ned format. output	6	5 5 13:0]	4 Yout[1 Read 4 Yout[ Read 4 Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H Mode Y-axis output, unsig Y-axis 16bits oper	t2 7 7 9 9 9 1 7 1 7 1 7 1 7 1 7 1 7 1 7 1	6	5 5 11[3:0]	4 Yout[1 Read 4 Yout[ Read 4 Read 0ata t[19:4]	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		
Yout0, Yout1, You Yout0 Addr: 02H Mode Yout1 Addr: 03H Mode Yout2 Addr: 07H Mode Y-axis output, unsig Y-axis output, unsig Y-axis output, unsig Y-axis output, unsig	t2 7 7 7 9 ned format. output	6	5 5 15 11[3:0]	4 Yout[1 Read 4 Yout[ Read 4 Read	I9:12] I-only 3 11:4] I-only 3 0	2	1	0		

# Zout0, Zout1, Zout2

Zout0	7	6	5	4	3	2	1	0
Addr: 04H				Zout[	19:12]			•
Mode				Read	l-only			
			_					
Zout1	7	6	5	4	3	2	1	0
Addr: 05H				Zout	[11:4]			
Mode				Read	l-only			
Zout2	7	6	5	4	3	2	1	0
		Zou	t[3:0]	•	0	0	0	0
Addr: 08H								
Mode				Read	l-only			

Z-axis output, unsigned format.

Z-axis output	Data
16bits operation mode	Zout[19:4]
18bits operation mode	Zout[19:2]
20bits operation mode	Zout[19:0]

## **Temperature Out**

Temperature	7	6	5	4	3	2	1	0		
Addr: 09H				Tout	[7:0]					
Mode		Read-only								

Temperature output, unsigned format. The range is -75-125°C, about 0.8°C/LSB, 0000000 stands for -75°C

## Status1

Device Status1	7	6	5	4	3	2	1	0	
Addr: 18H	Meas_t_ done	Meas_m _done	Sat_se nsor	OTP_read _done	ST_Fail	Mdt_flag _int	Meas_t_d one_int	Meas_m_ done_int	
Reset Value	0	0	0	0	0	0	0	0	
Mode		Read-only							

Bit Name	Description
Meas_m_done_int	Factory use only, reset value is 0.
Meas_t_done_int	Factory use only, reset value is 0.
Mdt_flag_int	Factory use only, reset value is 0.
ST_Fail	Factory use only, reset value is 0.
OTP_read_done	This bit is an indicator of successfully reading its OTP memory either as part of its power up sequence, or after an I2C command that reloads the OTP memory, such as resetting the chip and refreshing the OTP registers.
Sat_sensor	This bit is an indicator of the selftest signal, it keeps low once the device PASS selftest.
Meas_m_done	This bit indicates that a measurement of magnetic field is done and the data is ready to be read. This bit is reset only when any of the magnetic data registers is read.
Meas_t_done	This bit indicates that a measurement of temperature is done and the data is ready to be read. This bit is reset only when the temperature register is read.

## ODR

ODR	7	6	5	4	3	2	1	0	
Addr: 1AH				ODF	R[7:0]				
Reset Value	0	0	0	0	0	0	0	0	
Mode	Write-only								

Bit Name	Descrip	Description									
	continuo increme	e defines the frequency of t ous mode, this byte should nt of 1. The 1000 Hz ODR is e maximum reachable ODR	l not be zero. The conf available by writing 255	igurable ODR is 1 t	o 255, with						
ODR[7:0]	BW	Automatic SET/RESET	No SET/RESET	ODR range							
	00	75Hz	150 Hz	1~75							
	01	150 Hz	255 Hz	1~150							
	10	255 Hz	255 Hz	1~255							
	11	255Hz	hpower=0: 255 Hz; hpower=1: 1000 Hz	1~255							

## Internal Control 0

Control Register 0	7	6	5	4	3	2	1	0
Addr: 1BH	Cmm_fre q_en	Auto_st_ en	Auto_SR _en	Do Reset	Do Set	Start_MD T	Take_me as_T	Take_me as_M
Reset Value	0	0	0	0	0	0	0	0
Mode				Write	-only			

Bit Name	Description
Take_meas_M	Take Measure of Magnetic field, or TM_M bit. Writing a 1 into this location causes the chip to perform a magnetic measurement. This bit is self-clearing at the end of each measurement.
Take_meas_T	Take Measure of Temperature, or TM_T bit. Writing a 1 into this location causes the chip to perform a temperature measurement. This bit is self-clearing at the end of each measurement.
Start_MDT	Factory use only, reset value is 0.
Do Set	Writing a 1 into this location will cause the chip to do the Set operation, which will allow large set current to flow through the sensor coils for 375ns. This bit is self-cleared at the end of Set operation.
Do Reset	Writing a 1 into this location will cause the chip to do the Reset operation, which will allow large reset current to flow through the sensor coils for 375ns. This bit is self-cleared at the end of Reset operation.
Auto_SR_en	Writing a 1 into this location will enable the function of automatic set/reset. This function applies to both on-demand and continuous-time measurements. This bit must be set to 1 in order to activate the feature of periodic set. This bit is recommended to set to "1" in the application.
Auto_st_en	Writing a 1 into this location will enable the function of automatic self-test. The threshold in register 1EH, 1FH, 20H should be set before this bit is set to 1. This bit clears itself after the operation is completed.
Cmm_freq_en	Writing a 1 into this location will start the calculation of the measurement period according to the ODR. This bit should be set before continuous-mode measurements are started. This bit is self-cleared after the measurement period is calculated by internal circuits.

## Internal Control 1

Control Register 1	7	6	5	4	3	2	1	0	
Addr: 1CH	Sw_reset	St_enm	St_enp	Z-inhibit	Y-inhibit	X-inhibit	BW1	BW0	
Reset Value	0	0	0	0	0	0	0	0	
Mode		Write-only							

Bit Name	Description							
	These bandwidth selection bits adjust the length of the decimation filter. They control the duration of each measurement.							
	BW1 BW0 Measurement Time							
BW0 &	0 0 6.6ms							
	0 1 3.5ms							
BW1	1 0 2.0ms							
	1 1.2ms							
	Note: X/Y/Z channel measurements are taken sequentially. Delay Time among those							
	measurements is 1/3 of the Measurement Time defined in the table.							
X-inhibit	Writing "1" will disable this channel, and reduce Measurement Time and total charge per							
Y-inhibit	measurement. When a channel is disabled it is simply skipped during Take Measure routine. Its							
Z-inhibit	output register is not reset and will maintain the last value written to it when this channel was							
	active. Note: Y/Z needs to be inhibited the same time in case needed.							
	Writing 1 into this location will bring a DC current through the self-test coil of the sensor. This							
St_enp	current will cause an offset of the magnetic field. This function is used to check whether the							
	sensor has been saturated.							
St enm	The function of this bit is similar to ST_ENP, but the offset of the magnetic field is of opposite							
	polarity.							

Sw reset	Software Reset. Writing "1" will cause the part to reset, similar to power-up. It will clear all registers
—	and also re-read OTP as part of its startup routine. The power on time is 20mS.

## **Internal Control 2**

Control Register 2	7	6	5	4	3	2	1	0		
Addr: 1DH	hpower	INT_meas _done_en	INT_mdt_ en	Cmm_en	En_prd_s et		Prd_set[2:0]			
Reset Value	0	0	0	0	0	0	0	0		
Mode		Write-only								

Bit Name	Description
Prd_set[2:0]	These bits determine how many measurements are done before a set is executed, when the part is in continuous mode and the automatic set/reset is enabled. From 000 to 111, the sensor will do one set for every 1, 25, 75, 100, 250, 500, 1000, and 2000 samples. In order to enable this feature, both En_prd_set and Auto_SR must be set to 1, and the part should work in continuous mode. Please note that during this operation, the sensor will not be reset.
En_prd_set	Writing 1 into this location will enable the function of periodical set.
Cmm_en	The device will enter continuous mode, if ODR has been set to a non-zero value and a 1 has been written into Cmm_freq_en. The internal counter will start counting as well since this bit is set.
INT_mdt_en	Factory use only, reset value is 0.
INT_meas_done_en	Factory use only, reset value is 0.
hpower	If this bit is set to 1 to achieve 1000Hz ODR.

## ST\_X\_TH

ST_X_TH	7	6	5	4	3	2	1	0
Addr: 1EH				ST_X_	TH[7:0]			
Reset Value	0	0	0	0	0	0	0	0
Mode				Write	-only			

X-axis selftest threshold

# ST\_Y\_TH

ST_Y_TH	7	6	5	4	3	2	1	0
Addr: 1FH		ST_Y_TH[7:0]						
Reset Value	0	0	0	0	0	0	0	0
Mode				Write	e-only			

Y-axis selftest threshold

# ST\_Z\_TH

ST_Z_TH	7	6	5	4	3	2	1	0	
Addr: 20H		ST_Z_TH[7:0]							
Reset Value	0	0	0	0	0	0	0	0	
Mode				Write	-only				

Z-axis selftest threshold

# ST\_X

ST_X	7	6	5	4	3	2	1	0		
Addr: 27H		ST_X[7:0]								
Reset Value		Factory stored value								
Mode		Read/Write								

X-axis selftest set value

## ST\_Y

ST_Y	7	6	5	4	3	2	1	0		
Addr: 28H		ST_Y[7:0]								
Reset Value		Factory stored value								
Mode		Read/Write								

Y-axis selftest set value

# ST\_Z

ST_Z	7	6	5	4	3	2	1	0
Addr: 29H		ST_Z[7:0]						
Reset Value		Factory stored value						
Mode		Read/Write						
7 avia a alfta at a at								

Z-axis selftest set value

## Product ID 1

Product ID 1	7	6	5	4	3	2	1	0	
Addr: 39H	Product ID1[7:0]								
Reset Value	0	0	0	1	0	0	0	0	
Mode	Read-only								

Product ID, used to recognize device.

#### I<sup>2</sup>C INTERFACE OPERATION:

## DATA TRANSFER

A data transfer is started with a "START" condition and ended with a "STOP" condition. A "START" condition is defined by a HIGH to LOW transition on the SDA line while SCL line is HIGH. A "STOP" condition is defined by a LOW to HIGH transition on the SDA line while the SCL line is held HIGH. All data transfer in I<sup>2</sup>C system are 8-bits long. Each byte has to be followed by an acknowledge bit. Each data transfer involves a total of 9 clock cycles. Data is transferred starting with the most significant bit (MSB).

After a START condition, the master device calls a specific slave device by sending its 7-bit address with the 8<sup>th</sup> bit (LSB) indicating that either a READ or WRITE operation will follow, [1] for READ and [0] for WRITE. The MEMSIC device 7-bit device address is [0110000] where the three LSB's are pre-programmed into the MMC5603NJ by the factory.

Note: A total of 8 different addresses can be preprogrammed into MEMSIC device by the factory. This variation of I<sup>2</sup>C address avoids a potential address conflict, either by ICs from other manufacturers or by other MEMSIC devices on the same bus.

The initial addressing of the slave is always followed by the master writing the number of the slave register to be read or written, so this initial addressing always indicates a WRITE operation by sending **[01100000]**. After being addressed, the MEMSIC device being called should respond by an "Acknowledge" signal by pulling SDA line LOW. Subsequent communication bytes can either be

- a) The data to be written to the device register, or
- b) Another START condition followed by the device address indicating a READ operation [01100001], and then the master reads the register data.

Multiple data bytes can be written or read to numerically sequential registers without the need of another START condition. Data transfer is terminated by a STOP condition or another START condition. Two detailed examples of communicating with the MEMSIC device are listed below for the actions of acquiring a magnetic field measurement and magnetizing the sensor.

## **EXAMPLE OF MEASUREMENT**

**1**<sup>st</sup> **cycle**: A START condition is established by the Master Device followed by a call to the slave address [0110000] with the eighth bit held low to indicate a WRITE request.

**2<sup>nd</sup> cycle**: After an acknowledge signal is received by the master device (MEMSIC device pulls SDA line low during 9<sup>th</sup> SCL pulse), the master device sends the address of Control Register 0 as the target register to

be written. The MEMSIC device should acknowledge receipt of the address (9<sup>th</sup> SCL pulse, SDA pulled low).

**3**<sup>rd</sup> **cycle**: The Master device writes to the Internal Control Register 0 the code [00100001] (TM\_M and Auto\_SR\_en high) to initiate data acquisition. The MEMSIC device should send an Acknowledge and internally initiate a measurement (collect x, y and z data). A STOP condition indicates the end of the write operation.

**4**<sup>th</sup> **cycle**: The Master device sends a START command followed by the MEMSIC device's seven bit address, and finally the eighth bit set low to indicate a WRITE. An Acknowledge should be send by the MEMSIC device in response.

**5**<sup>th</sup> **cycle**: The Master device sends the MEMSIC Device Status Register1 as the address to read.

**6**<sup>th</sup> **cycle**: The Master device sends a START command followed by the MEMSIC device's seven bit address, and finally the eighth bit set high to indicate a READ. An Acknowledge should be send by the MEMSIC device in response.

 $7^{th}$  cycle: The Master device cycles the SCL line. This causes the Status Register data to appear on SDA line. Continuously read the Device Status Register1 until the Meas\_M\_Done bit (bit 1) is set to '1'. This indicates that data for the x, y, and z sensors is available to be read.

**8**<sup>th</sup> **cycle**: The Master device sends a START command followed by the MEMSIC device's seven bit address, and finally the eighth bit set low to indicate a WRITE. An Acknowledge should be send by the MEMSIC device in response.

**9**<sup>th</sup> **cycle**: The Master device sends a [0000000] (Xout LSB register address) as the register address to read.

**10<sup>th</sup> cycle**: The Master device calls the MEMSIC device's address with a READ (8<sup>th</sup> SCL cycle SDA line high). An Acknowledge should be send by the MEMSIC device in response.

**11<sup>th</sup> cycle**: Master device continues to cycle the SCL line, and each consecutive byte of data from the X, Y and Z registers should appear on the SDA line. The internal memory address pointer automatically moves to the next byte. The Master device acknowledges each. Thus:

12<sup>th</sup> cycle: Xout[19:12].

13<sup>th</sup> cycle: Xout[11:4].

14<sup>th</sup> cycle: Yout[19:12].

15th cycle: Yout[11:4].

16<sup>th</sup> cycle: Zout[19:12].

17<sup>th</sup> cycle: Zout[11:4].

**18<sup>th</sup> cycle**: Xout[3:2] for 18bits mode. Xout[3:0] for 20bits mode

MEMSIC MMC5603NJ Rev. B

Page 12 of 18

Formal release: 7/12/2018

**19<sup>th</sup> cycle**: Yout[3:2] for 18bits mode. Yout[3:0] for 20bits mode

**20<sup>th</sup> cycle**: Zout[3:2] for 18bits mode. Zout[3:0] for 20bits mode:0].

Master ends communications by NOT sending an 'Acknowledge' and also follows with a 'STOP' command.

## EXAMPLE OF CONTINUOUS MODE

The MMC5603NJ is designed with an on-chip continuous mode, or CMM. When enabled, the part will periodically take a measurement and store the results in I<sup>2</sup>C register. The frequency of these measurements is controlled by a setting in I<sup>2</sup>C register. The results of the last measurement can be read by the host. This mode, while it consumes more current, eliminates the need for the host to request measurements every time.

First the user needs to write the desired number into ODR[7:0]. It should be a non-zero integer, otherwise the continuous mode will not be activated. Then Cmm\_freq\_en is set to 1 to let the internal circuitry to calculate the target number for the counter. After that Cmm\_en is set to 1 and the continuous mode is started and the internal counter starts to count at the same time.

## EXAMPLE OF SET

**1**<sup>st</sup> **cycle**: A START condition is established by the Master Device followed by a call to the slave address [0110000] with the eighth bit held low to indicate a WRITE request.

**2<sup>nd</sup> cycle**: After an acknowledge signal is received by the master device (The MEMSIC device pulls the SDA line low during the 9<sup>th</sup> SCL pulse), the master device sends [00011011] as the target address (Internal Control Register 0). The MEMSIC device should acknowledge receipt of the address (9<sup>th</sup> SCL pulse).

**3<sup>rd</sup> cycle**: The Master device writes to the MEMSIC device's Internal Control 0 register the code [00001000] (SET bit) to initiate a SET action. The MEMSIC device should send an Acknowledge.

#### EXAMPLE OF RESET

**1**<sup>st</sup> **cycle**: A START condition is established by the Master Device followed by a call to the slave address [0110000] with the eighth bit held low to indicate a WRITE request.

**2<sup>nd</sup> cycle**: After an acknowledge signal is received by the master device (The MEMSIC device pulls the SDA line low during the 9<sup>th</sup> SCL pulse), the master device sends [00011011] as the target address (Internal Control Register 0). The MEMSIC device should acknowledge receipt of the address (9<sup>th</sup> SCL pulse).

**3<sup>rd</sup> cycle**: The Master device writes to the MEMSIC device's Internal Control 0 register the code [00010000] (RESET bit) to initiate a RESET action. The MEMSIC device should send an Acknowledge.

At this point, the MEMSIC AMR sensors have been conditioned for optimum performance and data measurements can commence.

Note:

• The RESET action can be skipped for most applications

USING SET AND RESET TO REMOVE BRIDGE OFFSET

The integrated SET and RESET functions of the MMC5603NJ enables the user to remove the error associated with bridge Offset change as a function of temperature, thereby enabling more precise heading measurements over a wider temperature than competitive technologies. The SET and RESET functions effectively alternately flip the magnetic sensing polarity of the sensing elements of the device.

- The most accurate magnetic field measurements can be obtained by using the protocol described as follows: Perform SET. This sets the internal magnetization of the sensing resistors in the direction of the SET field.
- Perform MEASUREMENT. This measurement will contain not only the sensors response to the external magnetic field, H, but also the Offset; in other words,

## Output1 = +H + Offset.

- Perform RESET. This resets the internal magnetization of the sensing resistors in the direction of the RESET field, which is opposite to the SET field (180° opposed).
- Perform MEASUREMENT. This measurement will contain both the sensors response to the external field and also the Offset. In other words, Output2 = -H + Offset.
- 5) Finally, calculate H by subtracting the two measurements and dividing by 2. This procedure effectively eliminates the Offset from the measurement and therefore any changes in the Offset over temperature.
   H = (Output1-Ouput2)/2.

## Note:


• To calculate and store the offset; add the two measurements and divide by 2. This calculated offset value can be subtracted from subsequent measurements to obtain H directly from each measurement.

## EXAMPLE OF SELFTEST

The MMC5603NJ is designed with an on-chip selftest signal to do self-diagnose of the sensor:

- 1) Read out the selftest signal stored at register 27H, 28H, and 29H.
- 2) Calculate the selftest signal threshold with 80% of the data readout from above registers.
- 3) Write the threshold in to the register 1EH, 1FH, and 20H.
- 4) Write [01000001] (TM\_M and auto\_st\_en high) to Internal Control Register 1BH to initiate a selftest.
- 5) Read out value of Sat\_sensor bit at the Device Status register 18H.
- 6) Sat\_sensor=0, PASS selftest.

## **OPERATING TIMING**

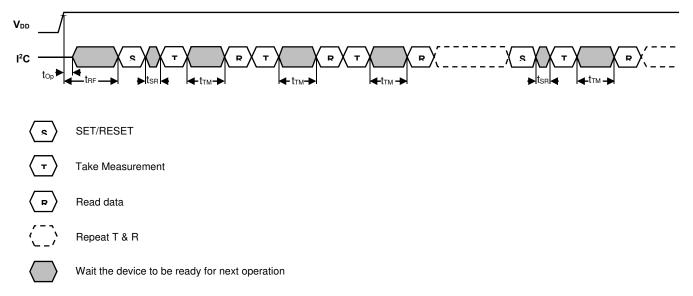


## **Operating Timing Diagram**

Parameter	Symbol	Min.	Max.	Unit
Time to operate device after $V_{\text{DD}}$ valid	t <sub>Op</sub>	5		ms
Minimum time interval between SET or RESET to other operations	tsr	1		ms
	tтм BW=00	6.6		ms
	t™BW=01	3.5		ms
	t <sub>™</sub> BW=10	2.0		ms
	t™BW=11	1.2		ms

## SOLDERING RECOMMENDATIONS


MEMSIC magnetic sensor is capable of withstanding an MSL1 / 260 °C solder reflow. Following is the reflow profile:

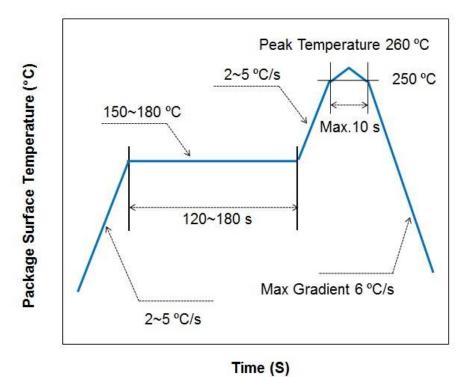

## Note:

- The second reflow cycle should be applied after device has cooled down to 25 °C (room temperature)
- This is the reflow profile for Pb free process
- The peak temperature on the sensor surface should be limited under 260 °C for 10 seconds.
- Solder paste's reflow recommendation should be followed to get the best SMT quality.


If the part is mounted manually, please ensure the temperature could not exceed 260 °C for 10 seconds.

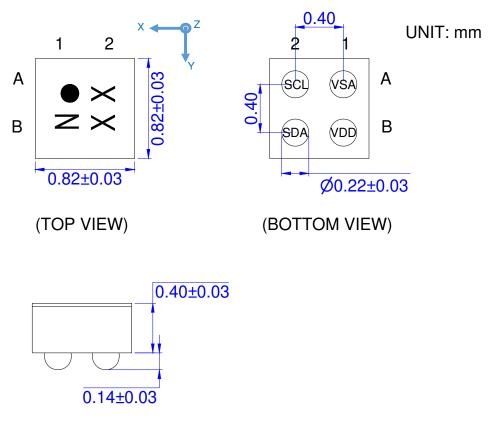

(SIDE VIEW)

## RECOMMENDED LAND PATTERN DESIGN

UNIT: mm

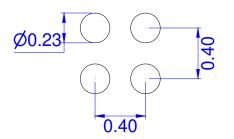

RELATIONSHIP BETWEEN THE MAGNETIC FIELD AND OUTPUT CODE The measurement data increases as the magnetic flux density increases in the arrow directions.

