PanView iQ[™] Interconnect Fibre Patch Cords – Low Smoke Zero Halogen (LSZH)



specifications

Interconnect fibre patch cords shall include a PanView iQ^{∞} LC Connector on one end, which shall include a copper conductor on top of the plug, which shall mate with a PanView iQ^{∞} patch panel. The other end of the Interconnect fiber patch cord shall include a standard, duplex LC connector, which shall be compatible with LC based transceiver interfaces in equipment such as switches and routers. The fibre patch cords shall be available in singlemode and multimode configuration. Fibre interconnect cords shall enable intelligent physical infrastructure management for interconnect architecture by verifying switch port connection and communicating with the system software to allow improved network visibility.



technical information

Standard requirements:	All connectors exceed TIA/EIA-455-21A: 500 mating cycles Compliant with: TIA/EIA-568-C.3 and ISO/IEC 11801 IEC-61754-20 (International Interface Standard) TIA-604-10 (FOCIS-10) IEC 60332-3 (LSZH) flame rating
Insertion loss:	Per connection: 0.10dB typical, 0.25dB max. (OM3, OM4) 0.35dB max. (LC singlemode)
Return loss:	26dB min. (10Gig multimode) 55dB min. (singlemode)
Intermateability requirements:	Meet all individual type requirements
Packaging:	Supplied one per bag, carton of 10

key features and benefits

100% performance tested	Assurance that each patch cord will deliver the critical optical performance requirements							
Documented metrics	Insertion loss data recorded for every patch cord							
Lifetime traceability	Test data is traceable to a QC number on each patch cord							
Metallic continuity element	Provides continuity through the connector enabling the PanView iQ [™] System to robustly monitor patch cord connectivity Meets IEC-60332-3 (LSZH) flame rating for standard rated jacket compliant safety							
Low smoke zero halogen								
Singlemode endface	Every singlemode end face is inspected to be in 100% compliance with geometry as defined in Telcordia GR-326-CORE, Issue 3. UPC polishing delivers return loss of 55dB minimum							
Certified 10 GbE performance	10Gig patch cords and pigtails are tested per IEEE 802.3ae 10 GbE to support network transmission speeds up to 10 Gb/s for link lengths up to 300m for OM3 and up to 550 meters for OM4 at 850nm to assure high performance and reliability							
Variety of length	Meets individual length requirements for greater system flexibility							

applications

Panduit's PanView iQ™ System Hardware, which includes intelligent patch panels, modules and cabling, seamlessly feeds information directly into the Physical Infrastructure Manager (PIM™) Software Platform to provide continuous real-time patch field monitoring and visibility of physical infrastructure connectivity, for enhanced system reliability and security, and capacity management. PViQ™ Patch Panels support tiered installations to provide customers with the flexibility of installing

passive connectivity that may be upgraded to fully managed at a future time. PanView iQ™ Interconnect Fibre Patch Cords enable intelligent physical infrastructure management for interconnect architectures by communicating with the system software to allow improved network visibility. Interconnect fibre patch cords can reduce patch panel requirements by 50% over cross-connect designs, reducing installation and deployment costs.

PanView iQ™ System

PanView iQ™ Fibre Patch Cords

Singlemode LC-PViQ

LC LSZH: PVQ9LE10LQM##.#

OM3 Multimode LC-PViQ LC,

LSZH: PVQXLE10LQM##.#

OM4 Multimode LC-PViQ LC,

LSZH: PVQZLE10LQM##.#

PanView IQ™ Fibre Trays

Modular, intelligent,

blank 24-port

no adapters: PVQ-FMT

ОМ3

multimode MTP: PVQ-FMTMTP-ZX

OM4

multimode MTP: PVQ-FMTMTP-ZZ
singlemode MTP: PVQ-FMTMTP-9

PanView iQ™ Intelligence Modules

Panel manager

(PM): PVQ-PM

Expansion module

(EM): PVQ-EM

NOTE: PM requires PanView iQⁿ Power Supply (not included).

PanView iQ™ Power Supply

12 volt power supply

 (North America):
 PVQ-PS12VDC-S

 (Europe):
 PVQ-PS12VDC-E

 (UK):
 PVQ-PS12VDC-U

 (Japan):
 PVQ-PS12VDC-J

 (China):
 PVQ-PS12VDC-C

PIM™ Software Platform and Modules

Base

functionality module:

dule: PIM-BASE

Connectivity management

management module:

PIM-CONNECT*

Maintenance support, and warranty

agreement: PIM-CAMA


Software and

documentation: PIM-MFDIA

##.# — Available in ½ meter length increments from 00.5m to 10.0m

*To order this module, add the appropriate letter to the end of the part number, based on the size of the installation: -S (<50 racks); -M (50-199 racks); -L (200-399 racks); -X (400+ racks). For example, the part number for the Connectivity Management Module for 250 racks is PIM-CONNECT-L.

PanView iQ™ Interconnect Fibre Patch Cords – Low Smoke Zero Halogen (LSZH)

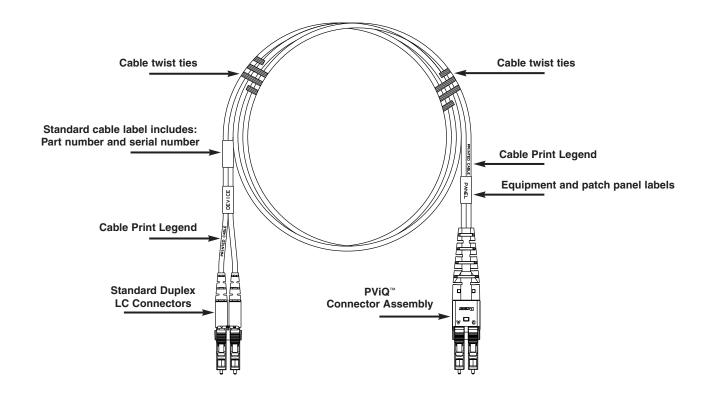

Example Description: PVQ9LE10LQM05.0 = PanView[™] Interconnect Fibre Patch Cord, 9/125μm singlemode, LSZH 1.6mm jacketed, standard duplex LC – to – PanView[™] Duplex LC, 5.0 metres long

Р	V	Q	9	L	E	1	0	L	Q	M	0	5		0
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15

1, 2, & 3 - Product Family

PVQ – PanView iQ[™] Interconnect Cords (Std. Duplex LC – to – PanView LC)

4 - Fibre Type

- 9 OS1/OS2 9/125μm singlemode
- X OM3 10Gig 50/125µm
- Z OM4 10Gig 50/125µm

5 - Jacket Rating

L - Low Smoke Zero Halogen (LSZH)

6 - Jacket Diameter

E – 1.6mm Duplex Zip Cord Cable

7 & 8 - Connector A

10 - Standard LC duplex fibre connector

9 & 10 - Connector B

LQ - PanView™ LC Duplex Fibre Connector

11 - Length Unit of Measure

M – Metres

12, 13, 14 and 15 - Length in Metres

Available: 00.5 - 10.0 in ½ metre increments

Dimensions are in millimetres

WORLDWIDE SUBSIDIARIES AND SALES OFFICES

PANDUIT CANADA Markham, Ontario cs-cdn@panduit.com Phone: 800.777.3300 PANDUIT EUROPE LTD. London, UK cs-emea@panduit.com Phone: 44.20.8601.7200 PANDUIT SINGAPORE PTE. LTD. Republic of Singapore cs-ap@panduit.com Phone: 65.6305.7575 PANDUIT JAPAN Tokyo, Japan cs-japan@panduit.com Phone: 81.3.6863.6000 PANDUIT LATIN AMERICA Guadalajara, Mexico cs-la@panduit.com Phone: 52.33.3777.6000 PANDUIT AUSTRALIA PTY. LTD. Victoria, Australia cs-aus@panduit.com Phone: 61.3.9794.9020

For a copy of Panduit product warranties, log on to www.panduit.com/warranty

