
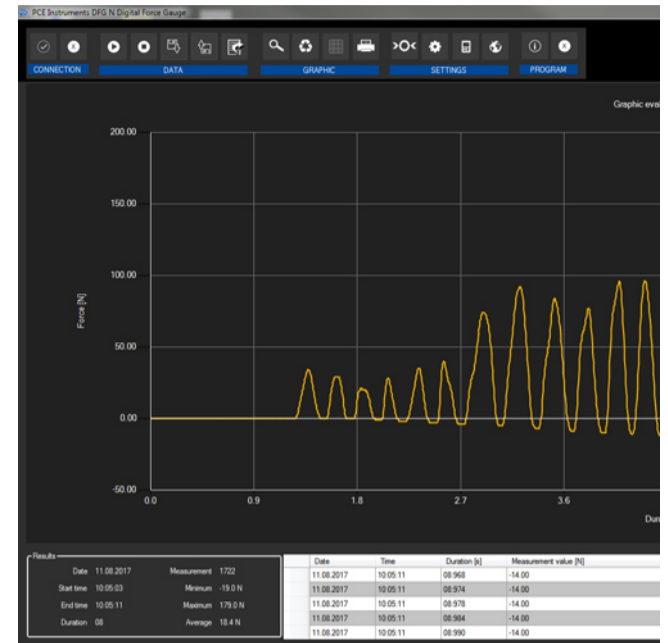


Force Gage PCE-DFG N 10K

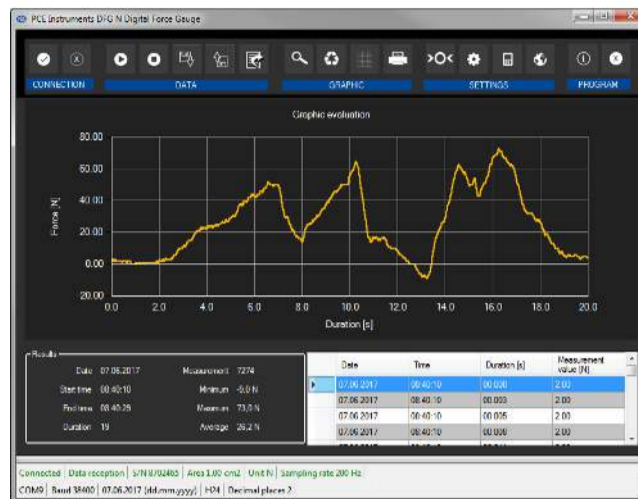

PCE-DFG N Force Gage series with external measuring cell and USB interface for connection to a PC

The force gage measures both tensile and compressive forces with very high resolution. The tensile force and the compressive force are often determined in the test laboratory, for example, to determine the yield strength, the pull-off force, and the force required to actuate a push-button or switch. The force gage is supplied with an external measuring cell. Depending on the model, the force gage can measure up to 10,000 N / 2,248 lbs. Models for 1,000 N / 225 lbs, 2,500 N / 562 lbs and 5,000 N / 1,124 lbs are still available. Various eyelets or hooks with M10 or M12 thread can be adapted to the measuring cells, but your own devices with this thread can be mounted on the measuring cell.

The force gage is equipped with a USB interface. This interface makes it possible to read the measurement data into the PC software. This makes it possible to create measurement logs and save and export them. The force gage has a graphic LCD that displays the measured values both numerically and graphically. Furthermore, the force measuring device is protected to IP54 and can therefore also be used in harsh industrial environments, as well as train and pressure tests can be carried out outdoors in bad weather conditions easily.

Various force test stands are available for adaptation to the force gage. The internal memory and the included hooks, extensions and tips complete the performance of this force gage. A special feature of the PCE-DFG N force gage is that the measuring cells are interchangeable among the models. By entering the sensitivity in mV / V, all measuring cells can be used with just one handheld device.

- ▶ USB interface
- ▶ Graphic display
- ▶ Fast response time
- ▶ PC software
- ▶ Store 100 readings internally or unlimited to PC
- ▶ Measuring cells easily changeable

Specifications

Measuring range	0 ... 10,000 N / 0 ... 2,248 lbs
Resolution	5 N / 1.12 lbs
Accuracy	± 0.1% of the measuring range
Measurement units	N, kg, lb, KPa
Display	2.8" TFT graphic display
Alarm Modes	Inside, Outside, Crack, Shutdown
Sampling rate	6 ... 1600 Hz
Storage	100 measurements
Power supply	NiMH battery, 6V / 1600-mAh
Battery life	About 10 hours
Power adapter / charging adapter	12V / 1A
Outputs	Interface: USB Switching output: 12V / 50-mA
Protection class	IP 54
Operating and storage conditions	-10 ... 50°C / 14 ... 122°F 5 ... 95% rh non-condensing
Mounting thread Measuring cell	
up to 1,000 N / 225 lbs	M10
2,500 ... 10,000 N / 562 ... 2,248 lbs	M12
Dimensions	200 x 97 x 42 mm / 7.9 x 3.8 x 1.7
Weight	540 g / 1.2 lbs

More information

Manual



Datasheet



Diagram



Software Manual



More product info



Similar products



Subject to change