


**STRAIGHT BULKHEAD JACK PANEL SEAL  
FULL CRIMP-TYPE - CABLE 11/50 D**

**R161.331.200**  
**SERIES N**

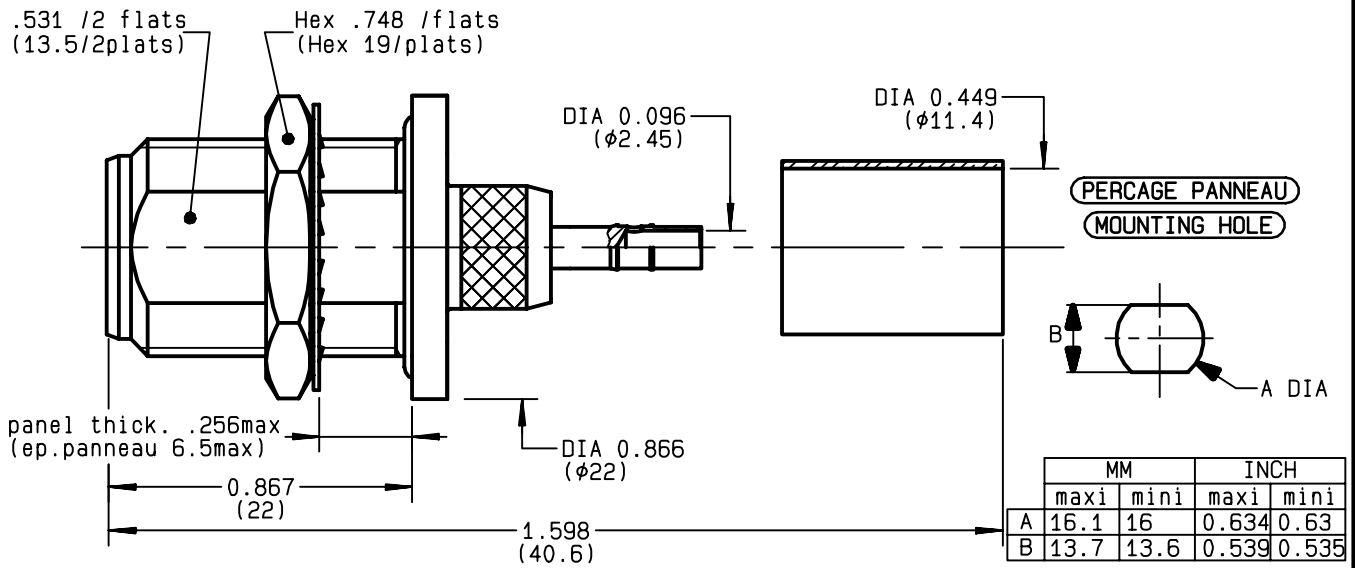

NOMINAL IMPEDANCE	<b>50</b>	Ω
FREQUENCY RANGE	<b>0-11</b>	GHz
TEMPERATURE RATING	<b>-55/+155</b>	°C
V.S.W.R	<b>1.30</b> +	x F(GHz)Maxi
RF INSERTION LOSS	<b>0.048</b>	√F(GHz) dB Maxi
VOLTAGE RATING	<b>1400</b>	Veff Maxi
DIELECTRIC WITHSTANDING VOLTAGE	<b>2500</b>	Veff Mini
INSULATION RESISTANCE	<b>5000</b>	MΩMini
HERMETIC SEAL	<b>NA</b>	Atm.cm <sup>3</sup> /s
LEAKAGE (pressurized only)	<b>IP 67</b>	
MECHANICAL DURABILITY	<b>500</b>	Cycles
WEIGHT	<b>34.5</b>	gr
SPECIFICATION		

CABLES :	<b>KX 13</b>	
	<b>RG 214</b>	
	<b>RG 225</b>	
OTHERS CHARACTERISTICS		
CABLE RETENTION	<b>400</b>	N Mini
CENTER CONTACT RETENTION		
Axial force - mating end	<b>68</b>	N Mini
Axial force - opposite end	<b>68</b>	N Mini
Torque	<b>NA</b>	cm.N Mini
RECOMMENDED TORQUES		
Mating	<b>NA</b>	cm.N
Panel nut	<b>500</b>	cm.N
Clamp nut	<b>NA</b>	cm.N

CONNECTOR PARTS:	MATERIALS	FINISH	(all values are given in micrometers)
BODY	BRASS	BBR 2	
OUTER CONTACT	BRASS	BBR 2	
CENTER CONTACT	BERYLLIUM COPPER	GOLD 0.5 OVER NICKEL 2	
INSULATOR	PTFE	-	
GASKET	SILICONE RUBBER	-	
OTHERS PIECES	BRASS	BBR 2	

ISSUE **9726D00**      CREATION DATE **21/07/1993**      FILE PART-NUMBER



BONOMINI


The information given here is subject to change without notice. Design changes may be in order to improve the product .

*Connect to the future*




**R161.331.200**

ISSUE **9726D00** SERIES **N**

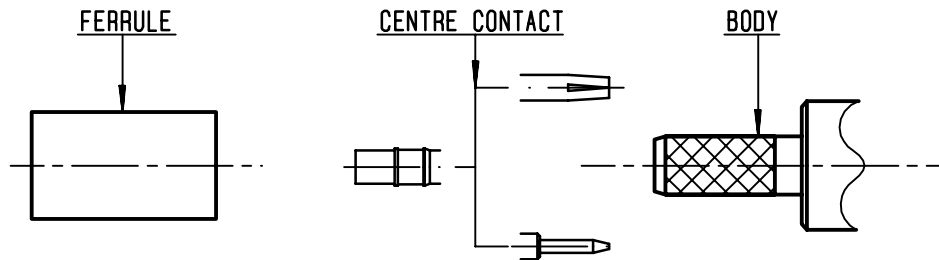

①


Slide onto the cable the ferrule  
Strip the cable .  
-  
-

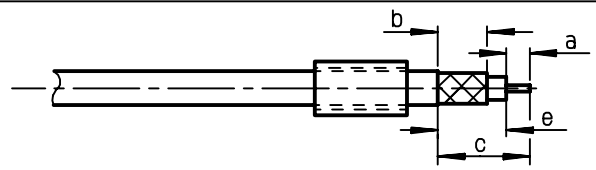

Stripping	a	b	c	d	e
inch	0.197	0.315	0.551	0	0.354
mm	5	8	14		9


②

Slide on centre contact until it bottoms against cable dielectrique .  
Crimp centre contact .  
Crimping tool : R282 231 000 ( Hex. : .100 )  
or R282 293 000 ( M22520/5-01 )  
+ dies R282 235 116 ( Y 116 DANIELS ).  
-

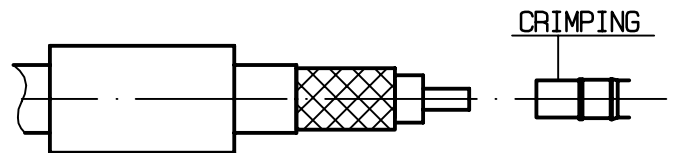

③

Fan the braid .  
Slide cable dielectrique into the body while gently ginding the braid over the knurl  
Push until the dielectrique clicks into position .  
Slide ferrule over braid in direction F .

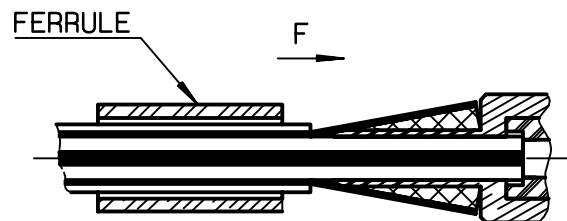

④

Crimp the ferrule with crimping tool R 282 231 000 ( Hex. : .415 ) or crimping tool R282 293 000 ( M22520/5-01 ) + dies R282 235 116 ( Y 116 DANIELS ).  
Cut the excess of braid .  
-  
-

