ONLY FOR REFERENCE

<u>Standard Spec Sheet</u>

Mitsumi Model Name	SOF-268HFT
Mitsumi Model No.	R 66 7903
Operating Force/ Boss	1.9N / With
Mounting Height	1.5mm
Button Shape	Square
Pcs/Reel	5,000


This specification is only for reference. If you have any questions for the details, please contact SW engineering division.

For your adopting the products, the formal supply specification will be provided.

MITSUMI ELECTRIC CO., LTD.

2-11-2, Tsurumaki, Tama-shi. Tokyo 206-8657 Japan.

SWITCH ENGINEERING SECTION 1049,Tateiwa,Iizuka-shi. Fukuoka 820-8533 Japan.

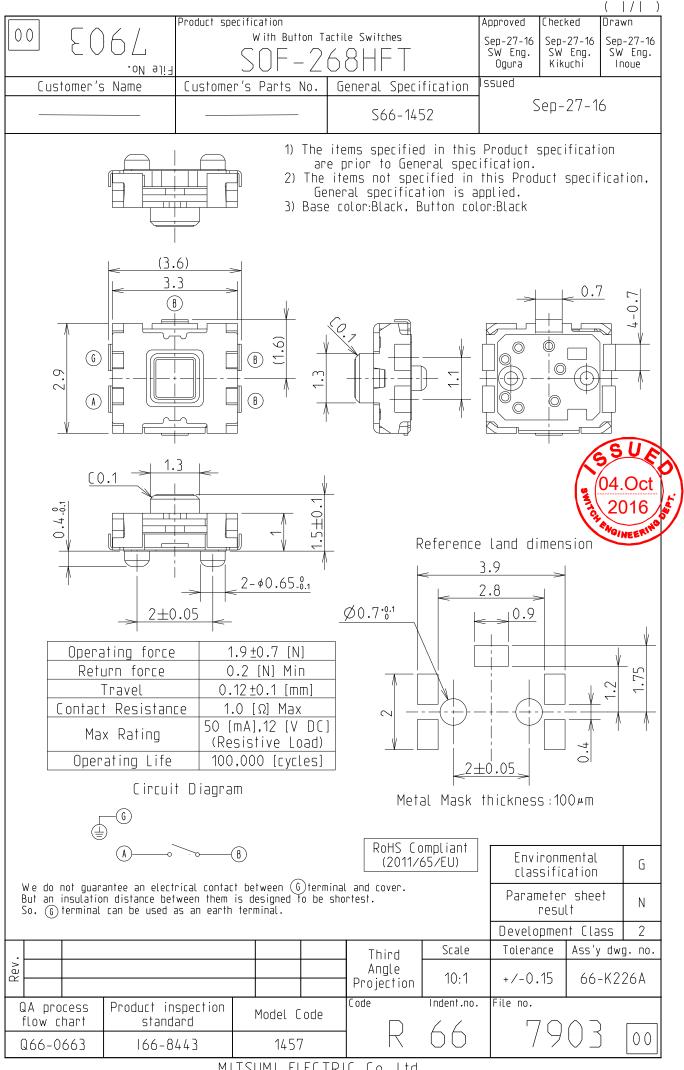

MITSUMI ELECTRIC Co.,Ltd.

										(1) of (9)
				Genera	al Specif	fication		APPROVED	CHECKED	WRITTEN
		_		Conord		noation		Mar.10th.'09	Mar.10th.'09	Mar.10th.'09
	752				on Tooti	le Swite	_	SW	SW	SW
	01/			With Butt			n	Terashita	Kawaguchi	Kikuchi
				S	OF Serie	es		Issue	d Mar. 10th	n, 2009
	1. GENERA	AL SCOF	ΡĒ							
	-	ecificatio	on covers th		-			trical charact	eristics of	
	1-2 TEST C	ONDITI	ONS							
	Tests a	and meas	surements s	hall be made	in the follo	wing standa	ard condition	ns		
			se specified		_					
			•	5 to 35 degree						
			•	ative humidity				atad		
			conditions.	from the jud	gment mad	e, lesis sna		clea		
		-		degrees C, I	-lumidity: 6	5 +/- 5%				
		Sinporal	2.0.20.72		.a.manty. O				650	EX -
	2. APPEAR	ANCE A	ND CONST	RUCTION					1 03.10	

	2-1 Outer dimensions: Refer to the attached drawing.									
	2 thomes and a second s									
	0 0 M (.				r urawnig.				ENGINEER	MS
	2-2 Materia				a arawing.				ANGINEER	INIS
		als: As s	hown in Tab	le-1.	-	cratch dirt	discoloratio	n and contan		INIS
	2-2 Materia 2-3 Appear	als: As s	hown in Tab There shou	le-1. Id be no critic	cal crack, so			n and contan hese problem		me
		als: As s	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem		M ¹⁰
		als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic	cal crack, so al characte	ristics of the	e switch. If t	hese problem		INTE
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem		me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one.	ns don't	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one. (1) COVEI	ıs don't ₹	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC	ıs don't R DN∆4	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI	ıs don't R DN∆4	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE	is don't R DN∆4 R TAPE	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	ele-1.	cal crack, so al characte	ristics of the	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK	IS don't R DN∆4 R TAPE SPRING	me
	2-3 Appear	als: As s ance:	hown in Tab There shou which affec	le-1. Id be no critic t the function	cal crack, so al characte s, the switch	ristics of the	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE	IS don't R DN∆4 R TAPE SPRING	me
	2-3 Appear 2-4 Cross s	als: As s rance: section	hown in Tab There shou which affec affect the c	ele-1. Id be no critic the function haracteristics Fig-1	cal crack, so al characte s, the switch	ristics of the h can be jud	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s <u>F</u> (1) COVER	als: As s rance: section	hown in Tab There shou which affec affect the c	ele-1. Id be no critic t the function haracteristics Fig-1	cal crack, so hal characte s, the switch	ristics of the h can be jud	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s (1) COVER (2) BUTTOM	als: As s rance: section Part Nam	hown in Tab There shou which affec affect the c	Fig-1	cal crack, so hal characte s, the switch	ristics of the h can be jud	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTOM (3) COVER	als: As s rance: section Part Nam	hown in Tab There shou which affec affect the c	lle-1. Ild be no critic t the function haracteristics Fig-1 SUS Nylon Polyimide	cal crack, so hal characte s, the switch	ristics of the h can be jud	e switch. If t	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTOM (3) COVER (4) BASE	als: As s rance: section Part Nam N $\triangle 4$ TAPE	hown in Tab There shou which affec affect the c	ele-1. Id be no critic t the function haracteristics Fig-1 SUS Nylon Polyimide Nylon	cal crack, so al characte s, the switch	ristics of the h can be jud	e switch. If t lged as a g	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S	Part Name N $\triangle 4$ TAPE	hown in Tab There shou which affec affect the c	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm	cal crack, so al characte s, the switch Tab Material	ristics of the h can be jud	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (1) COVER (2) BUTTOM (3) COVER (4) BASE (5) CLICK S (6) TERMIN	Part Name N $\triangle 4$ TAPE	hown in Tab There shou which affec affect the c	Fig-1 SUS Nylon Polyimide Nylon Dia. 2.4 mm	cal crack, so al characte s, the switch Tat Material , SUS onze	h can be juc	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch	Part Name N $\triangle 4$ TAPE	hown in Tab There shou which affec affect the c	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br	cal crack, so al characte s, the switch Tat Material , SUS ronze 011/65/EU)	h can be juc	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING	als: As s rance: section Part Nam N $\triangle 4$ TAPE SPRING IAL n applies	hown in Tab There shou which affec affect the c	Fig-1 SUS Nylon Polyimide Nylon Dia. 2.4 mm	cal crack, so nal characte s, the switch Tat Material , SUS ronze 011/65/EU) awing.	h can be jud	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING △7×4 Ju △6×5 Ju	Part Name N $\triangle 4$ TAPE NAL NAL NAL NAL NAL NAL NAL NAL NAL NAL	hown in Tab There shou which affec affect the c to RoHS Co Refer to the Correct Tabl Changed 2-4	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br ompliance. (20 e attached dra e-1,10-17,11-2	cal crack, so nal characte s, the switch Tat Material , SUS ronze 011/65/EU) awing.	ristics of the h can be juc	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
ion	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING △7×4 Ju △6×5 Ju	Part Name N $\triangle 4$ TAPE NAL NAL NAL NAL NAL NAL NAL NAL NAL NAL	hown in Tab There shou which affec affect the c to RoHS Co Refer to the Correct Tabl Changed 2-2 Changed 4-4	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br ompliance.(20 e attached dra e-1,10-17,11-2 4,3,6-1,11-2	cal crack, so al characte s, the switch Tat Material , SUS onze 011/65/EU) awing. 2	ristics of the h can be juc	e switch. If t lged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI Remarks	IS don't R DN∆4 R TAPE SPRING NAL	
vision	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING △7×4 Ju △6×5 Ju △5×3 De	als: As si rance: section Part Nam N $\triangle 4$ TAPE SPRING JAL n applies ul.1st.'15 un.3rd.'15 ec.25th.'14	hown in Tab There shou which affec affect the c for RoHS Content Refer to the Correct Table Changed 2-4 Changed 4-4 Added 10-17	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br ompliance.(20 e attached dra e-1,10-17,11-2 4,3,6-1,11-2 4,8-1. 7 precaution in	cal crack, so al characte s, the switch Tat Material , SUS onze 011/65/EU) awing. 2 use.	ristics of the h can be juc ble-1	e switch. If t Iged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI	IS don't R DN∆4 R TAPE SPRING	
Revision	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING △7×4 Ju △6×5 Ju △5×3 Da △4×2 Ju	als: As s rance: section Part Nam N $\triangle 4$ TAPE SPRING IAL n applies ul.1st.'15 un.3rd.'15 ec.25th.'14 ul.5th.'13	hown in Tab There shou which affec affect the c for RoHS Co Refer to the Correct Tabl Changed 2-2 Changed 4-4 Added 10-17 Collected en	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br ompliance.(20 e attached dra e-1,10-17,11-2 4,3,6-1,11-2 4,8-1. 7 precaution in ror (Slider => E	cal crack, so al characte s, the switch Tat Material , SUS onze 011/65/EU) awing. 2 use.	ristics of the h can be juck ble-1	e switch. If t Iged as a ge	ID No.	R DN∆4 R TAPE SPRING NAL	
Revision	2-3 Appear 2-4 Cross s 2-4 Cross s (1) COVER (2) BUTTON (3) COVER (4) BASE (5) CLICK S (6) TERMIN *This switch 3. RATING △7×4 Ju △6×5 Ju △5×3 Da △4×2 Ju △3×2 Ap △2×2 Da	als: As s rance: section Part Nam N \triangle 4 TAPE SPRING JAL n applies ul.1st.'15 un.3rd.'15 ec.25th.'14 ul.5th.'13 pr.22th.'13 ec.16th.'11	hown in Tab There shou which affec affect the c for content correct Tabl Changed 2-2 Changed 4-4 Added 10-17 Collected en Deleted item	Fig-1 SUS Nylon Polyimide Nylon dia. 2.4 mm Phosphor br ompliance.(20 e attached dra e-1,10-17,11-2 4,3,6-1,11-2 4,8-1. 7 precaution in	cal crack, so al characte s, the switch Tab Material , SUS onze 011/65/EU) awing. 2 use. Button)	ristics of the h can be juc ble-1	e switch. If t lged as a ge	hese problem ood one. (1) COVEI (2) BUTTC (3) COVEI (4) BASE (5) CLICK (6) TERMI Remarks	R DN∆4 R TAPE SPRING NAL	

4. ELECTRICA	L CHARACTERISTICS	
Items	Test conditions	Criteria
4-1 Contact Resistance	 Placing the switch such that the direction of switch operation is vertical and applying a below static load to the operating direction, measurement shall be made. (1)Depression 1.5 to 2 times the operating force of the standard center value. (2)Measuring method To be measured with A.C. 1 kHz +/- 200 Hz 	Refer to the attached drawing.
	(MAX. 20 mV, 50 mA)	
4-2 Insulation Resistance	Measurements shall be made following the test set force below: (1)Test voltage : 100 V DC for 1 min. (2)Applied position : Between all terminals, between terminal and cover.	10 M ohm min.
4-3 Withstanding Voltage	Measurements shall be made following the test set force below (1)Test voltage :100V AC (50/60 Hz) for 1min. (2)Leak current :2 mA (3)Applied position :Between all terminals, between terminal and cover.	There shall be no damage and breakdown.
4-4	Lightly striking the center of the knob at a rate	ON bounce :10 ms. Max.
Bouncing	encountered in normal use (3 to 4 operations per sec.), bounce shall be tested at "ON" and "OFF". $ \begin{array}{c} & & \\ & & \\ & & \\ \hline & & \\ & & \\ & & \\ \hline & & \\ &$	OFF bounce:10 ms. Max.
	55 03.Jul 2015	
	12 MAGINEENING	File No. 1452

Items	Test conditions	Criteria
5-1 Operating Force	Placing the switch such that the direction of switch operation is vertical and then gradually increasing the load applied to the center of the stem, the maximum load required for the switch to come to a stop shall be measured. The measurement shall be made just after 10 times pushing.	Refer to the attached drawing.
5-2 Return Force	The sample switch is installed such that the direction of switch operation is vertical and, upon depression of the stem in its center the whole travel distance, the force of the stem to return to its free position shall be measured. The measurement shall be made just after 10 times pushing.	Refer to the attached drawing.
5-3 Travel	Placing the switch such that the direction of switch operation is vertical and then applying a static load to the center of the stem, the travel distance for the switch to come to a stop shall be measured. The measurement shall be made just after 10 times pushing.	Refer to the attached drawing.
5-4 Stopper Strength	Placing the switch such that the direction of switch operation is vertical and then a below static load shall be applied in the direction of stem operation. 1) Depression: 30 N 2) Time: 15 s 3) Push rod shape: dia. 2.0 with flat tip dia.1.0 with flat tip (SOF-242HST / HNT) Fig-2	There shall be no sign of damage mechanically and electrically.
5-5 Impact Proof	 Measurements shall be made following the test set forth below. 1) Acceleration: 735 m/s2 2) Acting time: 6 msec 3) Test direction: 6 directions 4) Cycles of test: 3 cycles per direction (18 cycles in total) 	There shall be no sign of damage mechanically and electrically.
5-6 Vibration Resistance	 Measurements shall be made following the test set forth below. 1) Range of oscillation: 10 to 55 Hz 2) Amplitude, pk-to-pk: 1.5 mm 3) Cycle of sweep: 10-55-10 Hz in approx. 1 minute 4) Mode of sweep: Logarithmically sweep or uniform sweep 5) Direction of oscillation: Three mutually perpendicular directions, including the direction of stem travel 6) Duration of testing: 2 hours each, for a total of 6 hours 	There shall be no sign of damage mechanically and electrically.
		File No. 1452

Items	Test conditions	Criteria
5-7 Solderability	 Measurements shall be made following the test set force below: 1) Soldering temperature: 230 +/- 5 degrees C 2) Soldering time : 3 +/- 0.5 seconds 3) Solder : Sn-3.0Ag-0.5Cu 4) Soldering flux : Rosin 25%, Alcohol 75% 	More than 75% of the dipped part shall be covered with solder.
5-8 Soldering heat Resistance	 1) Hand soldering 1.1) Temperature of soldering iron tip: 350 +/- 5 degrees C 1.2) Soldering time: 3 +1/-0 seconds 1.3) The soldering iron should be applied to the terminals. 1.4) Excessive load should not be applied. 1.5) Power of the soldering iron should not exceed 15 W. 2) Reflow soldering 2.1) Heating method: Far-infrared heating 2.2) Temperature-time profile (Maximum value): As shown below. 2.3) Allowable soldering time: 2 times Temp fleegrees C] 250 90+/- 30 sec 30±10 sec 0 Profile of Reflow Soldering (Max) Time [sec] The condition mentioned above is a temperature on the PWB/FPC surface on which parts are mounted. There are cases where board's temperature greatly differs from switch's surface temperature, depending on board's material, size, thickness, etc. Please care, therefore, should be used not to allow switch's surface temperature to exceed 250 degrees C. The above temperature profile is the conditions for heat resistance test. Therefore, conditions of soldering shall be confirmed under actual production conditions. 	There shall be no damage on appearance. Electrical performance in Section 4 shall be assured. Operating force (Item 5-1) shall be assured.
1) Do not over 2) Following th 3) Safeguard t 4) As the cond	autions for soldering heat when you solder with soldering iron. e soldering process, do not clean the switch with a solvent or the lik he switch assembly against flux penetration from its top side. itions vary somehow on the kind of reflow soldering equipment,	e. 03.Jul 2015 SUCO 03.Jul 2015

please make sure you have the right one before use.

- 5) As the click ratio may deteriorate when a high heat load is applied, reflow soldering should be performed in the shortest period and at the lowest temperature possible.
- 6) Please use the proper amount of solder in order to prevent the flux penetration into the switch.
- 7) Switch terminals and PWB/FPC upper face shall be free from flux prior to soldering.
- 8) Note that if the load is applied to the terminals during soldering it might cause deformation and defects in electrical performance.

File No.

1452

6. ENDURANC	E	
Items	Test conditions	Criteria
6-1	Measurements shall be made following the test set forth below :	Contact resistance:1 ohm max.
Operating	(1) DC12 V 50 mA resistive load.	Insulation resistance:
Life	(2) Rate of operation: 2 operations per second.	10 M ohm min.
	(3) Depression:	Bounce:
	: The maximum load of a specification of the operating force.	ON bounce 20 msec max.
	(4) Cycles of operation: Refer to the attached drawing.	OFF bounce 20 msec max.
	(5)Pusher	Withstanding voltage: Item 4-3
	: Material SUS, dia. 4.0 Tip: flat shape	Operating force: -30 to +30% of
		initial force
		Travel: Item 5-3
7. ENVIRONME	Test conditions	Criteria
7-1	After testing at +60+/-3 degrees C and 90 to 96%	Contact resistance:1 ohm max.
Humidity	in relative humidity for 96 +/-5 hours, the sample is	Insulation resistance:
Resistance	allowed to stand under normal temperature and humidity	10 M ohm min.
	conditions within an hour, then, measurement shall be made	Bounce:
	within an hour.	ON bounce 20 msec max.
	*Water drops shall be removed.	OFF bounce 20 msec max.
		Withstanding voltage: Item 4-3
		Operating force: -30 to +30% of
		initial force
7-2	After testing at +85+/-3 degrees C for 96 +/-5 hours, the sample is	Travel: Item 5-3
Heat	allowed to stand under normal temperature and humidity	
Resistance	conditions within an hour, then, measurement shall be	
	made within an hour.	
7.0		
7-3	After testing at $-40+/-3$ degrees C for 96 $+/-5$ hours, the sample is	
Cold	allowed to stand under normal temperature and humidity	
Resistance	conditions within an hour, then, measurement shall be	
	made within an hour.	
	*Water drops shall be removed.	
7-4	Following continuous five cycles of the temperature	
Temperature	cycling test set forth below:	
Cycling		
	85+/-2	
	degrees	
		SUA
	-40+/-3	13 10
	dgrees C120 min120 min	(" (03.Jul)
	4	2015
	10 to 15 min 10 to 15 min	OH 2010 S
	1 cycle	TO/NEERIT
	1	<u> </u>
		File No.
		1452

8. USE CONDITIONS



8-1 Operating temperature range: -10 to +60 degrees C.

(Temperature range which switch is electlically ON and OFF).

- 8-2 Using Environment
 - 1) Do not expose the switch to corrosive gas such as sulfur gas, and salty wind.
 - 2) Visible dust must be cleared.
 - 3) As the switch may deform and change its quality, please do not apply excessive force to the switch.
- 9. STORAGE CONDITIONS
- 9-1 Storage temperature: -25 to 85 degrees C. No freeze and condensation.
- 9-2 Using Environment
 - 1) Do not expose the switch to corrosive gas such as sulfur gas, and salty wind.
 - 2) Visible dust must be cleared.

3) As the switch may deform and change its quality, please do not apply excessive force to the switch.

- 9-3 Storage Method
 - 1) Store the switches in the following condition: with neither direct sunshine nor corrosive gas and in normal temperature.
 - 2) Do not stack too many switches for strafe. Shall be free from high temperature and high humidity.
 - 3) The operating part of the switch should be free position in storage.
- **10. PRECAUTIONS IN USE**
- 10-1 Do not clean the switch with a solvent or the like.
- 10-2 Never use the product beyond the rated current and voltage.
- 10-3 Do not apply excessive load to the terminals and the operating part.
- 10-4 Larger stress than specified and/or shock shall not be applied to the operating part.
- 10-5 The stress shall be not applied to the upper face of the switch.
- 10-6 The switch will be broken, if you give larger stress than specified while operating. Take most care not to give both upward and downward stress to the switch when you operate it.
- 10-7 As the switch may be broken, please do no apply a load of more than 5 N to the switch bosses.
- 10-8 After mounting the switches on PWB/FPC, please do not stack too many PWB/FPC in order to avoid excessive load to the switch mounted area.
- 10-9 The dimensions of a pattern for mounting a printed circuit board shall refer to the recommended dimensions in the outline drawing.
- 10-10 Use of organic acid flux shall be avoided because it may cause corrosion of the switch. Please make sure the type of flux before you use it.



1452

File No.

- 10-11 As this switch is designed for reflow soldering, if you place it at the edge of PWB/FPC for convenience then flux may get into the sliding part of the switch during automatic dip soldering after being mounted, so do not apply auto dip after being mounted.
- 10-12 If the switch is given stress from the side, the cover may drop off and it may result in damages to switch functions. Therefore, please handle it with extreme care.
- 10-13 The operating part should be moved to the appointed position in order to ensure proper operation.
- 10-14 Do not give stress to the upper face of the switch while operating and use the switch under given stress.
- 10-15 If you use this product in one of the following environmental conditions, progress of sulfaration and oxidization on the contact part (silver) will be accelerated, which may cause contact failure. Therefore, be careful about the operation environment.
 - 1) Around a sulfarate hot spring where sulfide gas is generated.


2) In case this product is always used in a place where exhaust gas from automobiles exist. 10-16 If you push the edge of stem, the switch might not operate properly.

An actuator to push the stem of switch in device case needs to be designed to touch the whole surface of the stem evenly. (Fig-3)

10-17Unless provided for otherwise, the products have been designed and manufactured for application in equipment and devices which are sold to end users in the market,

including audio-visual (AV) equipment, electrical home appliances, office machines,


information and communication equipment, and amusement equipment. The products are not intended for use in, and must not be used for, any application for nuclear equipment, driving equipment for aerospace or any other unauthorized use. With the exception of the abovementioned prohibited applications, please contact our sales representative and/or evaluate the total system regarding applicability for applications involving high levels of safety and liability such as medical equipment, burglar alarm equipment, disaster prevention equipment and undersea equipment. Please also incorporate fail-safe design, protection and redundant circuitry, malfunction protection, and/or fire protection into the complete system to ensure safety and reliability of the total system.






1452

File No.

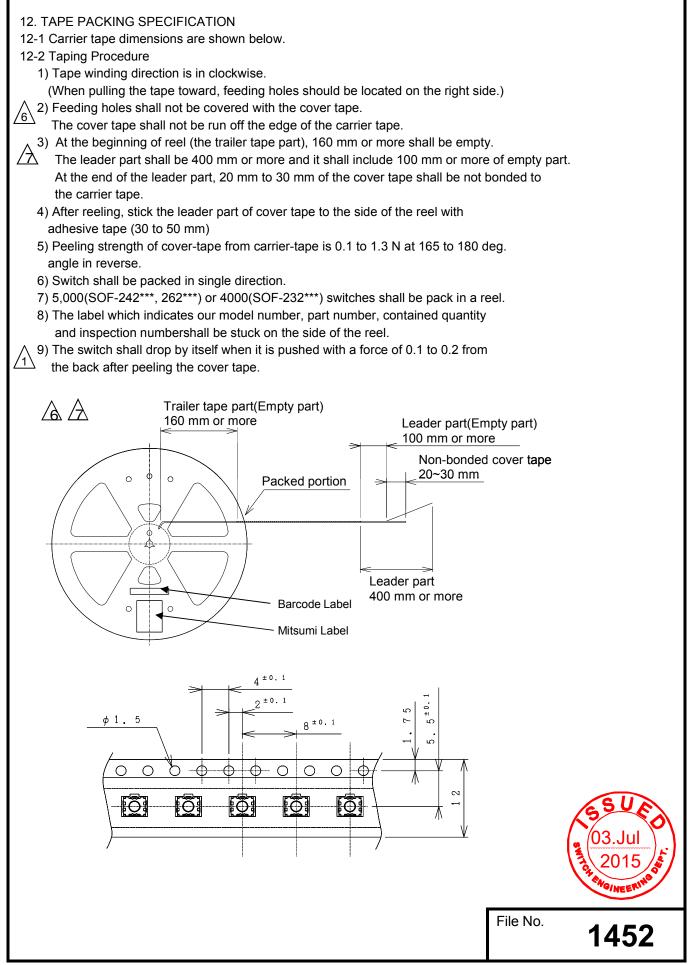

MITSUMI ELECTRIC CO., LTD.

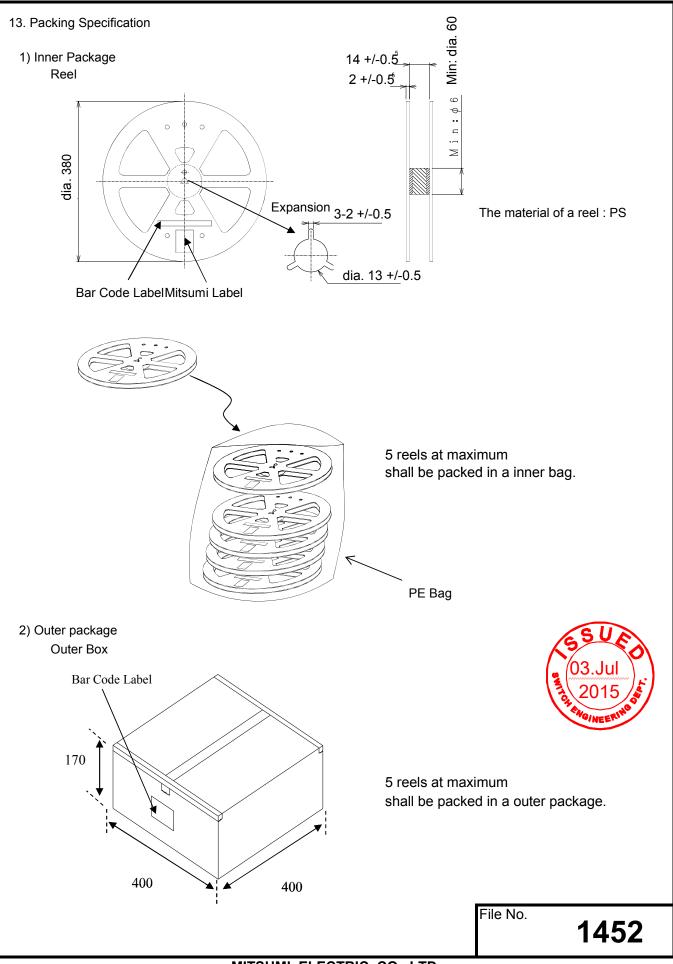

MITSUMI ELECTRIC CO., LTD.