















































with MIN level and MAX temperature electrical sensors, technopolymer

MATERIAL

Transparent polyamide based (PA-T) technopolymer Highly resistant to shocks, solvents, oils with additives, aliphatic and aromatic hydrocarbons. petrol, naphtha, phosphoric esters.

Avoid contact with alcohol or detergents containing alcohol.

SCREWS

Nickel-plated brass with hexagon socket.

PACKING RINGS

NBR synthetic rubber O-Ring.

Polyamide based (PA) technopolymer in red colour, with a built-in magnetic element to activate the electric contact when the oil level drops to the minimum set at 40mm over the screw axis (dimension I).

MIN LEVEL ELECTRICAL SENSOR

It generates an electric signal when the oil level reaches the minimum

The inside of the cavity where the sensor is contained is completely resinated in order to increase the thermal and electric insulation.

Right side output including protection against water sprays (protection class IP 65 according to EN 60529 on page A-18).

MAX TEMPERATURE ELECTRICAL SENSOR (80°C)

It is set at a standard intervention temperature of 80°C, placed close to a metallic plate which serves as a conductor of the heat of the fluid for a faster transmission and a lower dissipation. The inside of the cavity where the sensor is contained is completely resinated in order to increase the thermal and electric insulation.

For a correct assembly see Warnings (see page 1789).

CONTRAST SCREEN

White lacquered aluminium. The housing, in the appropriate external rear slot, guarantees the best protection from direct contact with fluid. It can be taken out before assembly to allow the insertion of level lines or words

SCREW-COVERS

Polyamide based technopolymer, grey colour.

STANDARD EXECUTIONS

- HCY-E-ST-NO: with electrical contact normally open.
- HCY-E-ST-NC: with electrical contact normally closed.

MAXIMUM CONTINUOUS WORKING TEMPERATURE 80°C (with oil).

TECHNICAL DATA

In laboratory tests carried out with mineral oil type CB68 (according to ISO 3498) at 23°C for a limited period of time, the weld stood up to: 14 bar (HCY.76), 9 bar (HCY.127) and 8 bar (HCY.254).

For use with other fluids and under different pressure and temperature conditions, please contact ELESA Technical Department.

In any case we suggest to verify the suitability of the product under the actual working conditions.

SPECIAL EXECUTIONS ON REQUEST

- Column level indicators in different materials (polycarbonate), for use with special fluids and/or at high temperatures.
- AISI 316 stainless steel or nickel-plated brass screws
- Column level indicators with change-over electrical contact.
- Execution with PT100 temperature electrical probe for connection to
- Electrical sensors set at the following temperatures: 50°, 60°, 70°C.



Electrical features	MIN level sensor							
Power supply	AC/DC							
Electric contacts	NO normally open							
Electric contacts	NC normally closed							
Maximum applicable valtage	NC: 150 Vac, 150 Vdc							
Maximum applicable voltage	NO: 230Vac, 230 Vdc							
NAin	NC: 1A							
Maximum switching current	NO: 2A							
Maximum commutable navia	NC: 20 W / 20 V.A.							
Maximum commutable power	NO: 40 W / 40 V.A.							
Cable gland	Pg 7 (for cables in sheath with Ø 6 or 7 mm)							
Conductors cross-section	Max. 1.5 mm ²							

Electrical features	MAX temperature sensor								
Power supply	AC/DC								
Electric contacts	NO normally open								
Electric contacts	NC normally closed								
Voltage /	250 Vac- 10 A	(venietive leads)							
Maximum current	60 Vdc - 3 A	(resistive loads)							
Cable gland	Pg 7 (for cables in sheath with Ø 6 or 7 mm)								
Conductors cross- section	Max. 1.5 mm ²								
Do not mount this indicator in proximity to magnetic fields.									










TWO-PIN CONNECTOR ASSEMBLY INSTRUCTIONS

- 1. Remove the connector from the indicator by unscrewing the set screw placed in the bottom, take the contact holder out and loosen the cable gland.
- 2. Slip on the two-pole cable into the connector (standard connector) and connect the wires to the terminals nr. 1 and nr. 2 of the contact
- 3. Assemble by pressing the contact holder into the connector in the required position.
- 4. Screw the connectors to the indicator and then tighten the cable glands.

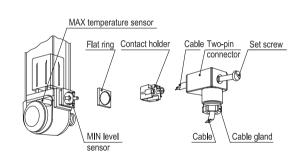

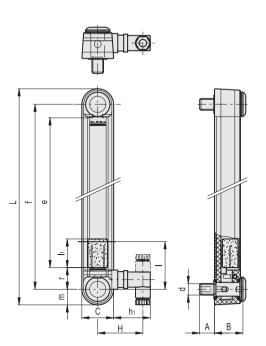



Conversion Table 1 mm = 0.039 inch mm inch 76 2.99 127 5.00 10.00 254

METRIC

Code	Description	f	d	Α	В	С	Н	L	е	h1	ı	l1	m	r	d'-0.2	f'±0.2	C# [Nm]	₫
111151	HCY.76-E-ST-NO-M12	76	M12	22	29	32	46	108	41	37	40	17	16	20	10.5	76	10	175
111152	HCY.76-E-ST-NC-M12	76	M12	22	29	32	46	108	41	37	40	17	16	20	10.5	76	10	175
111161	HCY.127-E-ST-NO-M12	127	M12	22	29	32	46	159	93	37	40	29	16	20	12.5	127	10	173
111162	HCY.127-E-ST-NC-M12	127	M12	22	29	32	46	159	93	37	40	29	16	20	12.5	127	10	173
111171	HCY.254-E-ST-NO-M12	254	M12	22	29	32	46	286	219	37	40	29	16	20	12.5	254	10	240
111172	HCY.254-E-ST-NC-M12	254	M12	22	29	32	46	286	219	37	40	29	16	20	12.5	254	10	240

Maximum tightening torque.

Accessories for hydraulic systems